

# Waste Tank Summary Report for Month Ending June 30, 2005

RECEIVED  
AUG 20 2005  
EDMC

Prepared for the U.S. Department of Energy  
Assistant Secretary for Environmental Management

**CH2MHILL**  
*Hanford Group, Inc.*

Richland, Washington

Contractor for the U.S. Department of Energy  
Office of River Protection under Contract DE-AC27-99RL14047

Approved for Public Release; Further Dissemination Unlimited



# WASTE TANK SUMMARY REPORT FOR MONTH ENDING JUNE 30, 2005

**AN Naiknimbalkar**

CH2M HILL HANFORD GROUP, INC.

Richland, WA 99352

U.S. Department of Energy Contract DE-AC27-99RL14047

EDT/ECN: DRF

UC:

Cost Center:

Charge Code:

B&R Code:

Total Pages: 45


Key Words: MONTHLY REPORT, WASTE TANK SUMMARY

Abstract: See page 9 (Purpose and Scope)


---

TRADEMARK DISCLAIMER. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof or its contractors or subcontractors.

Printed in the United States of America. To obtain copies of this document, contact: Document Control Services, P.O. Box 950, Mailstop H6-08, Richland WA 99352, Phone (509) 372-2420; Fax (509) 376-4989.

  
Release Approval

8-10-05  
Date

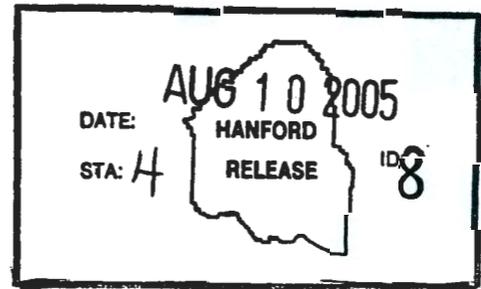

Release Stamp

**Approved For Public Release**

**LEGAL DISCLAIMER** \_\_\_\_\_

This report was prepared as an account of work sponsored by an agency of the United States Government. Neither the United States Government nor any agency thereof, nor any of their employees, nor any of their contractors, subcontractors or their employees, makes any warranty, express or implied, or assumes any legal liability or responsibility for the accuracy, completeness, or any third party's use or the results of such use of any information, apparatus, product, or process disclosed, or represents that its use would not infringe privately owned rights. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof or its contractors or subcontractors. The views and opinions of authors expressed herein do not necessarily state or reflect those of the United States Government or any agency thereof.

This report has been reproduced from the best available copy.

Printed in the United States of America



# **Waste Tank Summary Report for Month Ending June 30, 2005**

Prepared for the U.S. Department of Energy  
Assistant Secretary for Environmental Management

**CH2MHILL**  
*Hanford Group, Inc.*

Richland, Washington

Contractor for the U.S. Department of Energy  
Office of River Protection under Contract DE-AC27-99RL14047

Approved for Public Release; Further Dissemination Unlimited

# Waste Tank Summary Report for Month Ending June 30, 2005

A. N. Naiknimbalkar  
CH2M HILL Hanford Group, Inc.

Date Published  
August 2005

Prepared for the U.S. Department of Energy  
Assistant Secretary for Environmental Management

**CH2MHILL**  
*Hanford Group, Inc.*

Richland, Washington

Contractor for the U.S. Department of Energy  
Office of River Protection under Contract DE-AC27-99RL14047

Approved for Public Release; Further Dissemination Unlimited

**This page intentionally left blank.**

**CONTENTS**

1.0	PURPOSE AND SCOPE.....	9
2.0	WASTE TANK STATUS .....	10
	Table 2.1 Waste Tank Status Highlights.....	10
	Table 2-1. Single-Shell Tanks in Retrieval Status .....	11
	Table 2-2. Single-Shell Tanks Declared Interim Stabilized.....	11
3.0	DOUBLE-SHELL TANKS MONTHLY SUMMARY TABLES .....	13
	Table 3-1. Inventory and Status by Tank - Double-Shell Tanks.....	13
	Table 3-2. Double-Shell Tank Space Allocation, Inventory, and Waste Receipts.....	14
4.0	SINGLE-SHELL TANKS MONTHLY SUMMARY TABLES .....	15
	Table 4-1. Inventory and Status by Tank - Single-Shell Tanks .....	15
	Table 4-2. Single-Shell Tanks Interim Stabilization Status.....	19
	Table 4-3. Single-Shell Tanks Leak Volume Estimates .....	23
5.0	MISCELLANEOUS UNDERGROUND STORAGE TANKS AND SPECIAL SURVEILLANCE FACILITIES.....	28
	Table 5-1. East and West Area Miscellaneous Underground Storage Tanks and Special Surveillance Facilities .....	28
	Table 5-2. East Area Inactive Miscellaneous Underground Storage Tanks and Special Surveillance Facilities .....	29
	Table 5-3. West Area Inactive Miscellaneous Underground Storage Tanks and Special Surveillance Facilities .....	30

**APPENDICES**

APPENDIX A - TANK CONFIGURATION AND FACILITIES CHARTS.....	A-1
Figure A-1. High Level Waste Tank Configuration .....	A-1
Figure A-2. Double-Shell Tank Instrumentation Configuration.....	A-2
Figure A-3. Single-Shell Tank Instrumentation Configuration .....	A-3
Figure A-4. 200 East Tank Waste Contents.....	A-4/5
Figure A-5. 200 West Tank Waste Contents.....	A-6/7
Figure A-6. Hanford Tank Farm Facilities 200 East.....	A-8/9
Figure A-7. Hanford Tank Farm Facilities 200 West.....	A-10/11

ACRONYMS

BBI	Best Basis Inventory
CH2M HILL	CH2M HILL Hanford Group, Inc.
DCRT	Double-Contained Receiver Tank
DIL	Drainable Interstitial Liquid
DLR	Drainable Liquid Remaining
DST	Double-Shell Tank
FSAR	Final Safety Analysis Report effective October 18, 1999
Gal	Gallon
GPM	Gallons Per Minute
ILL	Interstitial Liquid
Kgal	Kilogallons
IS	Interim Stabilized
MT/FIC/ ENRAF	Manual Tape, Food Instrument Corporation, ENRAF Corporation (surface level measurement devices)
OSD	Operating Specifications Document
PFP	Plutonium Finishing Plant
SHMS	Standard Hydrogen Monitoring System
SST	Single-Shell Tank
SWL	Salt Well Liquid
TMACS	Tank Monitor and Control System
TPA	Hanford Federal Facility Consent and Compliance Order, "Washington State Department of Ecology, U.S. Environmental Protection Agency, and U.S. Department of Energy," as amended (Tri-Party Agreement)
TSR	Technical Safety Requirement
TWINS	Tank Waste Information Network System
USQ	Unreviewed Safety Question

## GLOSSARY

### General

**Characterization** - Characterization is understanding the Hanford tank waste chemical, physical, and radiological properties to the extent necessary to ensure safe storage and interim operation, and ultimate disposition of the waste.

**Drainable Interstitial Liquid (DIL)** - Drainable Interstitial Liquid is calculated based on saltcake and sludge volumes, calculated porosity values. Interstitial liquid is the liquid that fills the interstitial spaces of the solids waste. The sum of the interstitial liquid contained in saltcake and sludge minus an adjustment for capillary height is the initial volume of DIL. Interstitial liquid that is not held in place by capillary forces will, therefore, migrate or move with gravity.

**Drainable Liquid Remaining (DLR)** - The total Drainable Liquid Remaining is the sum of drainable interstitial liquid and supernatant.

**Supernatant Liquid** - The liquid above the solids or in large liquid pools covered by floating solids in waste storage tanks.

**Total Waste** - For purposes of this document, solids volume (sludge and saltcake including liquids) plus supernatant liquid.

**Waste Tank Safety Issue** - A potentially unsafe condition in the handling of waste material in underground storage tanks that requires corrective action to reduce or eliminate the unsafe condition. There are currently no waste tank safety issues.

### Interim Stabilization (Single-Shell Tanks only)

**Interim Stabilized (IS)** - A tank which contains less than 50 Kgallons of drainable interstitial liquid and less than 5 Kgallons of supernatant. If the tank was jet pumped to achieve interim stabilization, then the jet pump flow or saltwell screen inflow must also have been at or below 0.05 gpm before interim stabilization criteria are met.

**Jet Pump** - The centrifugal pump and jet assembly are needed to pump the interstitial liquid from the saltwell screen into the pump pit, nominally a 40-foot elevation rise. Pumping rates vary from 0.05 to about 4 gpm.

**Saltwell Screen** - The saltwell system is a 10-inch diameter saltwell casing consisting of a stainless steel saltwell screen welded to a Schedule 40 carbon steel pipe. The casing and screen are to be inserted into the 12-inch tank riser located in the pump pit. The stainless steel screen portion of the system will extend through the tank waste to near the bottom of the tank.

### Retrieval/Closure-(Single-Shell Tanks only)

**Closure (C)** - Final closure of the operable units (tank farms) shall be defined as regulatory approval of completion of closure actions and commencement of post-closure actions. For the purposes of this agreement (Hanford Federal Facility Agreement and Consent Order Change Control Form, Change Number M-45-02-03), all units located within the boundary of each tank farm will be closed in accordance with Washington Administrative Code 173-303-610.

**Retrieval (R)** - The process of removing, to the maximum extent practical, all the waste from a given underground storage tank. The retrieval process is selected specific to each tank and accounts for the waste type stored and the access and support systems available. Generally, retrieval is focused on removal of solids from the tank.

## **Tank Integrity**

Assumed Leaker - The integrity classification of a waste storage tank for which surveillance data indicate a loss of liquid attributed to a breach of integrity.

Sound - The integrity classification of a waste storage tank for which surveillance data indicate no loss of liquid attributed to a breach of integrity.

## **Surveillance Instrumentation**

Annulus - The annulus is the space between the inner and outer shells on DSTs only. Drain channels in the insulating and/or supporting concrete carry any leakage to the annulus space where conductivity probes are installed. The annulus conductivity probes and radiation detectors are the primary means of leak detection for all DSTs.

Automatic FIC - An automatic waste surface level measurement device is manufactured by the Food Instrument Corporation (FIC). The instrument consists of a conductivity electrode (plummet) connected to a calibrated steel tape, a steel tape reel housing and a controller that automatically raises and lowers the plummet to obtain a waste surface level reading. All FIC gauges are read manually. FICs are being replaced by ENRAF detectors (see below).

Drywells - Historically, the drywells were monitored with gross logging tools as part of a secondary leak monitoring system. In some cases, neutron-moisture sensors were used to monitor moisture in the soil as a function of well depth, which could be indicative of tank leakage. The routine gross gamma logging data were stored electronically from 1974 through 1994; a program was initiated in 1995 to log each of the available drywells in each tank farm with a spectral gamma logging system. The spectral gamma logging system provides quantitative values for gamma-emitting radionuclides. The baseline spectral gamma logging database is available electronically.

Spectral drywell scans can be run by special request. A select subset of drywells is routinely monitored by the Vadose Zone Characterization Project to assess movement of gamma-emitting radionuclides in the subsurface.

ENRAF 854 ATG Level Detector - FICs and some manual tapes are in the process of being replaced by the ENRAF ATG 854 level detector. The ENRAF gauge, fabricated by ENRAF Incorporated, determines waste level by detecting variations in the weight of a displacer suspended in the tank waste. ENRAFs and future installations will transmit digital level data to TMACS via an ENRAF Computer Interface Unit (CIU). The CIU allows fully remote communication with the gauge, minimizing tank farm entry.

Laterals - Laterals are horizontal drywells positioned 8 to 10 feet under single-shell waste storage tanks, 3 per tank, to detect radionuclides in the soil which could be indicative of tank leakage. These drywells can be monitored by radiation detection probes. Laterals are located only in A and SX farms. There are currently no functioning laterals and no plan to prepare them for use.

Liquid Observation Well (LOW) - In-tank liquid observation wells are used for monitoring the ILL in single-shell tanks. The wells are usually constructed of fiberglass or TEFZEL-reinforced epoxy-polyester resin (TEFZEL is a trademark of E. I. du Pont de Nemours & Company). A few LOWs constructed of steel. Gamma and neutron probes are used to monitor changes in the ILL, and can indicate intrusions or leakage by increases or decreases in the ILL. There are 70 LOWs installed in SSTs that contain or are capable of containing greater than 50 Kgallons of drainable interstitial liquid. All of the LOWs are monitored weekly with the exception of TX-108 which is monitored by request only. Two LOWs installed in DSTs SY-102 and AW-103 are used for special, rather than routine, surveillance purposes only.

Surface Levels - The surface level measurements in all waste storage tanks are monitored by manual or automatic conductivity probes, and recorded and transmitted or entered into the Surveillance Analysis Computer System.

Thermocouple (TC) - A thermocouple is a thermoelectric device used to measure temperature. More than one thermocouple element on a device (probe) is called a thermocouple tree.

**METRIC CONVERSION CHART**

METRIC CONVERSION CHART		
1 inch	=	2.54 centimeters
1 foot	=	30.48 centimeters
1 gallon	=	3.79 liters
1 ton	=	0.91 metric tons
$^{\circ}\text{F} = \left(\frac{9}{5}^{\circ}\text{C}\right) + 32$		
1 Btu/h = 0.2931 watts (International Table)		

## **1.0 PURPOSE AND SCOPE**

This report is the official inventory for radioactive waste stored in underground tanks in the 200 Areas at the Hanford Site. Data that depict the status of stored radioactive waste and tank vessel integrity are contained within the report. This report provides data on each of the existing 177 large underground waste storage tanks and 60 smaller miscellaneous underground storage tanks and special surveillance facilities, and supplemental information regarding tank surveillance anomalies and ongoing investigations. This report is intended to meet the requirement of U.S. Department of Energy Order 435.1 (DOE-HQ, August 28, 2001, Radioactive Waste Management, U.S. Department of Energy-Washington, D.C.) requiring the reporting of waste inventories and space utilization for the Hanford Site Tank Farm tanks.

## 2.0 WASTE TANK STATUS

Note: Changes from the previous month are in **bold print**.

Double-Shell Tanks (DST)	28 double-shell	10/86 - date last DST tank was completed
Single-Shell Tanks (SST)	149 single-shell	1966 - date last SST tank was completed
Assumed Leaker Tanks	67 single-shell	07/93 - date last Assumed Leaker was identified
Sound Tanks	28 double-shell 82 single-shell	1986 - date DSTs determined sound 07/93 - date last SST determined sound
Interim Stabilized Tanks <sup>a</sup> (IS)	149 single-shell	03/04 - date last IS occurred <sup>a</sup>
Retrieval <sup>b</sup>	13 single-shell	03/05 - date last Retrieval completed
Misc. Underground Storage Tanks (MUST) and Special Surveillance Facilities (Active)	10 Tanks East Area 7 Tanks West Area	03/01 - last date a tank was added or removed from MUST list
Misc. Underground Storage Tanks (IMUST) and Special Surveillance Facilities (Inactive) <sup>c</sup>	18 Tanks East Area 25 Tanks West Area	11/01 - last date a tank was added or removed from IMUST list

## Footnotes:

<sup>a</sup> Tanks are declared Interim Stabilized when pumping stops; the tank may be placed in evaluation at this time. Tank U-108 was placed in evaluation on March 18, 2004, due to major equipment failure; documentation was completed August 16 and the declaration letter sent to DOE-RL on September 8, 2004.

Saltwell pumping for the tanks covered by the Consent Decree was completed in March 2004. (Tank C-106 is not included in the Consent Decree and is not Interim Stabilized; Retrieval was completed December 31, 2003). The Consent Decree table and footnotes have been removed from this document; all actions in this decree have been completed.

<sup>b</sup> Tank status for C-104, C-201, C-202, C-203, C-204, S-102, S-103, S-105 and S-106 was changed to "Retrieval," effective October 2002. Tank status for C-103, C-105, C-106, and S-112 was changed to "Retrieval" in October 2003. Retrieval was completed for tank C-106 on December 31, 2003. Retrieval was completed for tank C-203 on March 24, 2005, letter issued to DOE on March 31, 2005. Hanford Federal Facility Agreement and Consent Order (signed August 2004) modified Milestone M-45-00C (Change Order M-45-04-01) changing the regulatory requirements for retrieval of waste in tanks S-103, S-105, and S-106. "Retrieval" status in these tanks is thereby rescinded to allow focusing on the retrieval of wastes and the interim closure of all Waste Management Area C-Farm Single-Shell Tanks.

<sup>c</sup> Tables 5-2. and 5-3., the Inactive Miscellaneous Underground Storage Tanks (IMUST) now reflect only those tanks managed by CH2M HILL Hanford Group, Inc. (CH2M HILL).

## 2.1 WASTE TANK STATUS HIGHLIGHTS

Table 2-1. Single-Shell Tanks in Retrieval Status

Tank Number	Comments
241-C-101	
241-C-102	
241-C-103	
241-C-104	
241-C-105	
241-C-106	Declared "Retrieval Completed," December 31, 2003
241-C-107	
241-C-108	
241-C-109	
241-C-110	
241-C-111	
241-C-112	
241-C-200 series	C-202- Retrieval initiated on June 30, 2005 C-203- Declared "Retrieval Completed," March 24, 2005
241-S-102	Retrieval initiated on December 17, 2004
241-S-103	Status rescinded by HFFACO, August 2004
241-S-105	Status rescinded by HFFACO, August 2004
241-S-106	Status rescinded by HFFACO, August 2004
241-S-112	Retrieval in progress

Table 2-2. Single-Shell Tanks Declared Interim Stabilized

Tank Number	Comments
241-BY-106	Letter sent to DOE on June 30, 2005

### Tank AX-103

The interstitial liquid level (ILL) readings are taken quarterly via neutron probe in a liquid observation well (LOW) in this tank. On December 12, 2004, the LOW reading indicated a 2.7-inch decrease from the previous reading (July 5); a repeated reading on December 16 confirmed the decrease. Problem evaluation report (PER)/Occurrence Report RP 2004-0070 "Tank 241-AX-103 Liquid Waste Level Below Established Baseline" was issued.

The LOW reading frequency was increased to weekly. An Assessment team was formed and the assessment process initiated per TFC-ENG-CHEM-D-42, "Tank Leak Assessment Process." The LOW level has increased from the December 12 reading. The LOW level continues to fluctuate with most readings within the tolerance limit of the baseline. Preliminary analysis indicates that the ILL LOW readings are responding to changes in barometric pressure.

The surface level (ENRAF) has shown no change. A level reading in the leak detection pit was obtained on March 31, 2005. The leak detection pit reading showed no increase that would be indicative of a tank leak.

Three of the drywells surrounding AX-103 were logged on March 1 and 2, 2005. All seven drywells surrounding have been logged since January 1, 2005 and the readings show no evidence of any anomalous increase in gamma activity that would be indicative of a tank leak.

The assessment team met on April 20, 2005 and reached a consensus that a leak from tank AX-103 was highly unlikely. **Tank 241-AX-103 Leak Assessment Report, RPP-RPT-26501 issued on June 30, 2005.**

**Tank BY-106**

**Letter for completion of interim stabilization of single-shell tank 241-BY-106 sent to DOE-RL on June 30, 2005.**

**Tank C-202**

**Retrieval of tank 241-C-202 initiated on June 30, 2005.**

## 3.0 DOUBLE-SHELL TANKS MONTHLY SUMMARY TABLES

Table 3-1. Inventory and Status by Tanks - Double-Shell Tanks.

All volume data obtained from Tank Waste Information Network System (TWINS)								
Tank	Tank Integrity	Tank Level (inches)	Total Waste (Kgal)	Available Space (Kgal)	Waste Volumes			Solids Volume Update
					Supernatant Liquid (Kgal)	Sludge (Kgal)	Saltcake (Kgal)	
<b>241-AN TANK FARM STATUS</b>								
AN-101	SOUND	348	957	187	926	0	31	12/31/03
AN-102	SOUND	388	1068	76	914	0	154	01/01/05
AN-103	SOUND	349	959	185	500	0	459	06/30/99
AN-104	SOUND	383	1053	91	608	0	445	06/30/99
AN-105	SOUND	410	1126	18	588	0	538	01/31/03
AN-106	SOUND	339	932	212	883	32	17	01/30/05
AN-107	SOUND	400	1101	43	871	0	230	12/31/03
7 TANKS - TOTAL			7196	812	5290	32	1874	
<b>241-AP TANK FARM STATUS</b>								
AP-101	SOUND	406	1115	29	1115	0	0	05/01/89
AP-102	SOUND	399	1097	47	1074	23	0	05/31/02
AP-103	SOUND	325	893	251	893	0	0	05/31/96
AP-104	SOUND	399	1098	46	1098	0	0	10/13/88
AP-105	SOUND	414	1138	6	1049	0	89	06/30/99
AP-106	SOUND	412	1134	10	1134	0	0	10/13/88
AP-107	SOUND	126	345	799	345	0	0	10/13/88
AP-108	SOUND	375	1031	113	1031	0	0	10/13/88
8 TANKS - TOTAL			7851	1301	7739	23	89	
<b>241-AW TANK FARM STATUS</b>								
AW-101	SOUND	410	1127	17	731	0	396	01/31/03
AW-102	SOUND	202	555	570	548	7	0	03/31/04
AW-103	SOUND	399	1098	46	785	273	40	07/21/04
AW-104	SOUND	390	1072	72	849	66	157	06/30/99
AW-105	SOUND	152	419	725	156	263	0	06/30/99
AW-106	SOUND	327	900	244	617	0	283	04/01/04
6 TANKS - TOTAL			5171	1674	3686	609	876	
<b>241-AY TANK FARM STATUS</b>								
AY-101	SOUND	65	179	822	83	96	0	06/30/99
AY-102	SOUND	341	938	63	787	151	0	04/01/04
2 TANKS - TOTAL			1117	885	870	247	0	
<b>241-AZ TANK FARM STATUS</b>								
AZ-101	SOUND	320	881	120	829	52	0	06/30/98
AZ-102	SOUND	355	976	25	871	105	0	06/30/99
2 TANKS - TOTAL			1857	145	1700	157		
<b>241-SY TANK FARM STATUS</b>								
SY-101	SOUND	411	1129	15	854	0	275	06/30/99
SY-102	SOUND	220	605	539	460	145	0	09/30/03
SY-103	SOUND	268	737	407	395	0	342	06/30/99
3 TANKS - TOTAL			2471	961	1709	145	617	

## Notes:

1 Kgal differences are the result of computer rounding

Supernatant + Sludge (includes liquid) + Saltcake (includes liquid) = Total Waste

Available Space Volumes include restricted space

Tanks AN-103, AN-104, AN-105, AW-101, SY-101 and SY-103 contain retained gas in the saltcake

Table 3-2. Double-Shell Tank Space Allocation, Inventory and Waste Receipts (all volumes in kgallons)

<b>TOTAL DST CAPACITY</b>						<b>TOTAL DST WASTE INVENTORY</b>	
TOTAL=	31,441					INVENTORY ON 6/30/05	25,663
						INVENTORY ON 5/31/05	25,424
						CHANGE =	239

ALLOCATION OF REMAINING DST SPACE	
TOTAL DST CAPACITY =	31,441
WASTE INVENTORY =	-25,663
(*) DEDICATED OPERATIONAL SPACE =	-2,000
(**) RESTRICTED USAGE SPACE =	-1,700
(***) EMERGENCY SPACE ALLOCATION =	-1,200
REMAINING AVAILABLE SPACE =	878

(\*) Dedicated Operational Space is assumed to equal 2 Mgal for SST retrieval, cross-site transfer receiver, and evaporator feed and slurry.  
 (\*\*) Restricted space associated with flammable gas Waste Group A and tanks controlled for waste feed delivery per Feed Control List, HNF-SD-WM-OCD-015, Tank Farms Waste Transfer Compatibility report. These tanks are: AN-102, -103, -104, -105, -107; AP-101; AW-101, -103, -105; AY-102, and SY-103 (AY-102 is allowed to receive condensate only). Restricted Space does not include Feed Control List tanks AY-101, AZ-102, and SY-102, which are allowed to receive limited types of waste.  
 (\*\*\*) Emergency Space Allocation adjusted in July 2003 per HNF-3484 Rev. 4, includes space for WTP returns.

JUNE DST WASTE RECEIPTS					
FACILITY GENERATIONS		OTHER GAINS ASSOCIATED WITH		OTHER LOSSES ASSOCIATED WITH	
222-S	0	SLURRY	1	SLURRY	2
TANK FARMS	74	CONDENSATE	13	CONDENSATE	5
C-202	0	INSTRUMENTATION	0	INSTRUMENTATION	0
S-102	173	MISCELLANEOUS GAINS	0	MISCELLANEOUS LOSSES	15
S-112	0				
TOTAL =		TOTAL=		TOTAL=	
	247		14		22

WASTE RECEIPT AND EVAPORATOR METRIC					
DATE	DST WASTE RECEIPTS	MISC. DST CHANGES (+/-)	WVR (1)	NET DST CHANGE	TOTAL DST VOLUME
6/05	247	-8	0	239	25,663

(1) WVR is total (before flush) waste volume reduction for 242-A Evaporator

IMPLEMENTATION OF DST SPACE OPTIONS METRIC (TPA MILESTONE M-46-21)			
DATE	INITIATIVES	GAINS TO DATE (1)	GAINS DURING MONTH
6/05	INCREASE DST FILL HEIGHT	0	0
	NET EVAPORATOR WVR (2)	1830	0
	RESERVE EMERGENCY SPACE COMPLIANT WITH DOE O435.1	1100	0
	USE RESTRICTED HEADSPACE	0	0
	TOTAL	2930	0

(1) DST tank space gains since 10/1/02.  
 (2) WVR is net (after flush) waste volume reduction for 242-A Evaporator

4.0 SINGLE-SHELL TANKS MONTHLY SUMMARY TABLES

Table 4-1. Inventory and Status by Tanks - Single-Shell Tanks (sheet 1 of 4).  
All volume data obtained from Tank Waste Information Network System (TWINS)

Tank Number	Tank Integrity	Tank Status	Total Waste (Kgal)	Waste Volumes							Solids Volume Update
				Super-natant Liquid (Kgal)	Drainable Interstitial Liquid (Kgal)	Pumped this Month (Kgal)	Total Pumped (Kgal)	Drainable Liquid Remaining (Kgal)	Sludge (Kgal)	Salt-cake (Kgal)	
<b>241-A TANK FARM STATUS</b>											
A-101	SOUND	IS(4)	320	0	37	0	543	37	3	317	06/30/04
A-102	SOUND	IS	40	3	9	0	40	12	0	37	01/31/03
A-103	ASMD LKR	IS	370	4	86	0	111	90	2	364	01/01/02
A-104	ASMD LKR	IS	28	0	0	0	0	0	28	0	01/27/78
A-105	ASMD LKR	IS	37	0	0	0	0	0	37	0	10/31/00
A-106	SOUND	IS	79	0	9	0	0	9	50	29	01/01/02
6 TANKS - TOTAL			874						120	747	
<b>241-AX TANK FARM STATUS</b>											
AX-101	SOUND	IS	358	0	44	0	369	44	3	355	12/31/03
AX-102	ASMD LKR	IS	30	0	0	0	13	0	6	24	01/01/02
AX-103	SOUND	IS	107	0	22	0	0	22	8	99	09/30/03
AX-104	ASMD LKR	IS	7	0	0	0	0	0	7	0	01/01/02
4 TANKS - TOTAL			502						24	478	
<b>241-B TANK FARM STATUS</b>											
B-101	ASMD LKR	IS	109	0	20	0	0	20	28	81	01/01/02
B-102	SOUND	IS	32	4	7	0	0	11	0	28	06/30/99
B-103	ASMD LKR	IS	56	0	10	0	0	10	1	55	01/01/02
B-104	SOUND	IS	374	0	45	0	0	45	309	65	01/01/02
B-105	ASMD LKR	IS	290	0	20	0	0	20	28	262	01/01/02
B-106	SOUND	IS	123	1	8	0	0	9	122	0	12/31/03
B-107	ASMD LKR	IS	161	0	23	0	0	23	86	75	01/01/02
B-108	SOUND	IS	92	0	19	0	0	19	27	65	06/30/04
B-109	SOUND	IS	125	0	23	0	0	23	50	75	01/01/02
B-110	ASMD LKR	IS	245	1	27	0	0	28	244	0	01/01/02
B-111	ASMD LKR	IS	242	1	23	0	0	24	241	0	01/01/02
B-112	ASMD LKR	IS	35	3	2	0	0	5	15	17	01/01/02
B-201	ASMD LKR	IS	29	0	5	0	0	5	29	0	07/01/04
B-202	SOUND	IS	28	0	4	0	0	4	28	0	07/01/04
B-203	ASMD LKR	IS	50	1	5	0	0	6	49	0	07/01/04
B-204	ASMD LKR	IS	49	1	5	0	0	6	48	0	07/01/04
16 TANKS - TOTAL			2040						1305	723	
<b>241-BX TANK FARM STATUS</b>											
BX-101	ASMD LKR	IS	48	0	4	0	0	4	48	0	01/01/02
BX-102	ASMD LKR	IS	79	0	0	0	0	0	79	0	06/30/04
BX-103	SOUND	IS	75	13	4	0	0	15	62	0	01/01/83
BX-104	SOUND	IS	100	3	4	0	17	7	97	0	01/01/02
BX-105	SOUND	IS	72	5	4	0	15	9	42	25	01/01/05
BX-106	SOUND	IS	38	0	4	0	14	4	10	28	01/01/05
BX-107	SOUND	IS	347	0	37	0	23	37	347	0	09/18/90
BX-108	ASMD LKR	IS	31	0	4	0	0	4	31	0	01/31/01
BX-109	SOUND	IS	193	0	25	0	8	25	193	0	09/17/90
BX-110	ASMD LKR	IS	205	1	35	0	2	36	65	139	01/01/01
BX-111	ASMD LKR	IS	189	0	6	0	117	6	32	157	01/01/02
BX-112	SOUND	IS	164	1	9	0	4	10	163	0	01/01/02
12 TANKS - TOTAL			1541						1169	349	

Table 4-1. Inventory and Status by Tank - Single-Shell Tanks (sheet 2 of 4).

All volume data obtained from Tank Waste Information Network System (TWINS)												
Tank Number	Tank Integrity	Tank Status	Total Waste (Kgal)	Waste Volumes						Sludge (Kgal)	Salt-cake (Kgal)	Solids Volume Update
				Super-natant Liquid (Kgal)	Drainable Interstitial Liquid (Kgal)	Pumped this Month (Kgal)	Total Pumped (Kgal)	Drainable Liquid Remaining (Kgal)				
<b>241-BY TANK FARM STATUS</b>												
BY-101	SOUND	IS	370	0	24	0	36	24	37	333	01/01/02	
BY-102	SOUND	IS	279	0	40	0	159	40	0	279	06/30/04	
BY-103	ASMD LKR	IS	417	0	55	0	96	55	9	408	01/31/03	
BY-104	SOUND	IS	358	0	44	0	330	44	45	313	01/01/02	
BY-105	ASMD LKR	IS	481	0	47	0	45	47	48	433	03/31/03	
BY-106	ASMD LKR	IS	462	-	-	0	99	-	32	430	12/31/03	
BY-107	ASMD LKR	IS	272	0	42	0	56	42	16	256	06/30/04	
BY-108	ASMD LKR	IS	222	0	33	0	28	33	40	182	01/01/02	
BY-109	SOUND	IS	287	0	37	0	157	37	24	263	06/30/04	
BY-110	SOUND	IS	366	0	20	0	213	20	43	323	01/01/02	
BY-111	SOUND	IS	301	0	14	0	313	14	0	301	06/30/04	
BY-112	SOUND	IS	286	0	24	0	116	24	2	284	03/31/02	
12 TANKS - TOTAL			4101						296	3805		
<b>241-C TANK FARM STATUS</b>												
C-101	ASMD LKR	IS/R	88	0	4	0	0	4	88	0	11/29/83	
C-102	SOUND	IS/R	316	0	62	0	47	62	316	0	09/30/95	
C-103	SOUND	IS/R	75	4	10	0	114	11	71	0	12/31/03	
C-104	SOUND	IS/R	259	0	29	0	0	29	259	0	01/01/02	
C-105	SOUND	IS/R	132	0	10	0	0	10	132	0	02/29/00	
C-106	SOUND	/R	3	Retrieval Completed, 12/31/03			-	-	3	0	12/31/03	
				See Footnote (1), page 18								
C-107	SOUND	IS/R	247	0	30	0	41	30	247	0	06/30/04	
C-108	SOUND	IS/R	66	0	4	0	0	4	66	0	02/24/84	
C-109	SOUND	IS/R	63	0	4	0	0	4	63	0	06/30/04	
C-110	ASMD LKR	IS/R	178	1	37	0	16	38	177	0	06/14/95	
C-111	ASMD LKR	IS/R	57	0	4	0	0	4	57	0	06/30/04	
C-112	SOUND	IS/R	104	0	6	0	0	6	104	0	09/18/90	
C-201	ASMD LKR	IS/R	1	0	0	0	0	0	1	0	01/01/02	
C-202	ASMD LKR	IS/R	-	Retrieval in progress			-	-	-	-	06/30/04	
				See Footnote (2), page 18								
C-203	ASMD LKR	IS/R	0	Retrieval Completed, 03/24/05			-	-	0	0	03/24/05	
				See Footnote (5), page 18								
C-204	ASMD LKR	IS/R	2	0	0	0	0	0	2	0	01/31/03	
16 TANKS - TOTAL			1593						1586	0		
<b>241-S TANK FARM STATUS</b>												
S-101	SOUND	IS	352	0	45	0	67	45	235	117	04/31/04	
S-102	SOUND	/R	-	Retrieval in progress			-	-	-	-		
				See Footnote (6), page 18								
S-103	SOUND	IS (3)	237	1	45	0	24	46	9	227	06/30/04	
S-104	ASMD LKR	IS (4)	288	0	49	0	0	49	132	156	12/20/84	
S-105	SOUND	IS (3)	406	0	42	0	114	42	2	404	01/01/02	
S-106	SOUND	IS (3)	455	0	26	0	204	26	0	455	02/28/01	
S-107	SOUND	IS	358	0	42	0	83	42	320	38	02/04/04	
S-108	SOUND	IS	550	0	4	0	200	4	5	545	01/01/02	
S-109	SOUND	IS	533	0	16	0	34	16	13	520	06/30/01	
S-110	SOUND	IS	389	0	30	0	203	30	96	293	01/01/02	
S-111	SOUND	IS (4)	411	-	-	0	100	-	76	335	06/30/04	
S-112	SOUND	/R	-	Retrieval in progress			-	-	-	-		
				See Footnote (7), page 18								
12 TANKS - TOTAL			4351						1312	3090		

Table 4-1. Inventory and Status by Tank - Single-Shell Tanks (sheet 3 of 4).

All volume data obtained from Tank Waste Information Network System (TWINS)											
			Waste Volumes								
Tank Number	Tank Integrity	Tank Status	Total Waste (Kgal)	Super-natant Liquid (Kgal)	Drainable Interstitial Liquid (Kgal)	Pumped this Month (Kgal)	Total Pumped (Kgal)	Drainable Liquid Remaining (Kgal)	Sludge (Kgal)	Salt-cake (Kgal)	Solids Volume Update
<b>241-SX TANK FARM STATUS</b>											
SX-101	SOUND	IS	419	0	43	0	33	44	144	275	06/30/04
SX-102	SOUND	IS	341	0	36	0	98	36	55	286	08/31/04
SX-103	SOUND	IS	509	0	40	0	134	40	78	431	09/30/03
SX-104	ASMD LKR	IS	446	0	48	0	231	48	136	310	04/30/00
SX-105	SOUND	IS	375	0	39	0	153	39	63	312	12/31/02
SX-106	SOUND	IS	396	0	37	0	148	37	0	396	01/31/03
SX-107	ASMD LKR	IS	94	0	7	0	0	7	94	0	07/01/04
SX-108	ASMD LKR	IS	74	0	0	0	0	0	74	0	06/30/04
SX-109	ASMD LKR	IS	241	0	0	0	0	0	66	175	07/01/04
SX-110	ASMD LKR	IS	56	0	0	0	0	0	49	7	07/01/04
SX-111	ASMD LKR	IS	115	0	11	0	0	11	98	17	07/01/04
SX-112	ASMD LKR	IS	75	0	6	0	0	6	75	0	07/01/04
SX-113	ASMD LKR	IS	19	0	0	0	0	0	19	0	01/01/02
SX-114	ASMD LKR	IS	155	0	30	0	0	30	126	29	07/01/04
SX-115	ASMD LKR	IS	4	0	0	0	0	0	4	0	01/01/02
<b>15 TANKS - TOTAL</b>			<b>3319</b>						<b>1081</b>	<b>2238</b>	
<b>241-T TANK FARM STATUS</b>											
T-101	ASMD LKR	IS	99	0	16	0	25	16	37	62	06/30/04
T-102	SOUND	IS	32	13	3	0	0	16	19	0	08/31/84
T-103	ASMD LKR	IS	27	4	3	0	0	7	23	0	11/29/83
T-104	SOUND	IS	317	0	31	0	150	31	317	0	11/30/99
T-105	SOUND	IS	98	0	5	0	0	5	98	0	05/29/87
T-106	ASMD LKR	IS	22	0	0	0	0	0	22	0	01/01/01
T-107	ASMD LKR	IS	173	0	34	0	11	34	173	0	05/31/96
T-108	ASMD LKR	IS	16	0	4	0	0	4	5	11	01/01/01
T-109	ASMD LKR	IS	62	0	11	0	0	11	0	62	01/01/02
T-110	SOUND	IS	370	1	48	0	50	49	369	0	03/31/02
T-111	ASMD LKR	IS	447	0	38	0	10	38	447	0	01/01/02
T-112	SOUND	IS	67	7	4	0	0	11	60	0	04/28/82
T-201	SOUND	IS	30	2	4	0	0	6	28	0	07/01/04
T-202	SOUND	IS	20	0	3	0	0	3	20	0	07/01/04
T-203	SOUND	IS	36	0	5	0	0	5	36	0	07/01/04
T-204	SOUND	IS	36	0	5	0	0	5	36	0	07/01/04
<b>16 TANKS - TOTAL</b>			<b>1832</b>						<b>1690</b>	<b>135</b>	
<b>241-TX TANK FARM STATUS</b>											
TX-101	SOUND	IS	91	0	7	0	0	7	74	17	01/01/02
TX-102	SOUND	IS	217	0	27	0	94	27	2	215	03/31/03
TX-103	SOUND	IS	145	0	18	0	68	18	0	145	01/01/02
TX-104	SOUND	IS	69	2	9	0	4	11	34	33	06/30/04
TX-105	ASMD LKR	IS	576	0	25	0	122	25	8	568	01/01/02
TX-106	SOUND	IS	348	0	37	0	135	37	5	343	03/31/02
TX-107	ASMD LKR	IS	29	0	7	0	0	7	0	29	01/31/03
TX-108	SOUND	IS	127	0	8	0	14	8	6	121	06/30/04
TX-109	SOUND	IS	363	0	6	0	72	6	363	0	01/01/02
TX-110	ASMD LKR	IS	467	0	14	0	115	14	37	430	01/01/02
TX-111	SOUND	IS	364	0	10	0	98	10	43	321	06/30/04
TX-112	SOUND	IS	634	0	26	0	94	26	0	634	01/01/02
TX-113	ASMD LKR	IS	638	0	18	0	19	18	93	545	06/30/04
TX-114	ASMD LKR	IS	532	0	17	0	104	17	4	528	01/01/02
TX-115	ASMD LKR	IS	553	0	25	0	99	25	8	545	06/30/04
TX-116	ASMD LKR	IS	599	0	21	0	24	21	66	533	04/30/03
TX-117	ASMD LKR	IS	480	0	10	0	54	10	29	451	06/30/04
TX-118	SOUND	IS	247	0	31	0	89	31	0	247	06/30/04
<b>18 TANKS - TOTAL</b>			<b>6479</b>						<b>772</b>	<b>5705</b>	

Table 4-1. Inventory and Status by Tank - Single-Shell Tanks (sheet 4 of 4).

All volume data obtained from Tank Waste Information Network System (TWINS)											
Tank Number	Tank Integrity	Tank Status	Total Waste (Kgal)	Waste Volumes							Solids Volume Update
				Super-natant Liquid (Kgal)	Drainable Interstitial Liquid (Kgal)	Pumped this Month (Kgal)	Total Pumped (Kgal)	Drainable Liquid Remaining (Kgal)	Sludge (Kgal)	Salt-cake (Kgal)	
<b>241-TY TANK FARM STATUS</b>											
TY-101	ASMD LKR	IS	119	0	2	0	8	2	72	47	01/31/03
TY-102	SOUND	IS	69	0	13	0	7	13	0	69	01/01/02
TY-103	ASMD LKR	IS	154	0	23	0	12	23	103	51	06/30/04
TY-104	ASMD LKR	IS	44	1	4	0	0	5	43	0	03/31/02
TY-105	ASMD LKR	IS	231	0	12	0	4	12	231	0	04/28/82
TY-106	ASMD LKR	IS	16	0	1	0	0	1	16	0	01/01/02
6 TANKS - TOTALS			633						465	167	
<b>241-U TANK FARM STATUS</b>											
U-101	ASMD LKR	IS	23	0	4	0	0	4	23	0	06/30/04
U-102	SOUND	IS	327	1	37	0	87	38	43	283	12/31/02
U-103	SOUND	IS(4)	417	1	33	0	99	34	11	405	01/01/05
U-104	ASMD LKR	IS	122	0	0	0	0	0	122	0	01/01/02
U-105	SOUND	IS	353	0	44	0	88	44	32	321	03/30/01
U-106	SOUND	IS	170	2	36	0	39	39	0	168	06/30/04
U-107	SOUND	IS	294	0	32	0	135	32	15	279	12/31/03
U-108	SOUND	IS	434	0	46	0	115	46	29	405	09/30/04
U-109	SOUND	IS(4)	401	0	47	0	78	47	35	366	04/30/02
U-110	ASMD LKR	IS	176	0	16	0	0	16	176	0	01/01/02
U-111	SOUND	IS	222	0	31	0	86	31	26	196	08/31/03
U-112	ASMD LKR	IS	45	0	4	0	0	4	45	0	02/10/84
U-201	SOUND	IS	4	1	1	0	0	2	3	0	06/30/03
U-202	SOUND	IS	4	1	0	0	0	1	3	0	06/30/03
U-203	SOUND	IS	3	1	0	0	0	1	2	0	06/30/03
U-204	SOUND	IS	3	1	0	0	0	1	2	0	06/30/03
16 TANKS - TOTALS			2998						567	2423	

Note: +/- 1 Kgal difference in volumes is due to rounding.

Footnote:

- (1) C-106: Volumes: Total waste 2771 gallons, liquids 85 gallons, per RPP-19866, Rev. 1, "Calculation for the Post-Retrieval Waste Volume Determination for Tank 241-C-106," dated February 26, 2004.
- (2) C-202: Volumes estimate as of 6/30/05: 1,301 gallons.
- (3) Hanford Federal Facility Agreement and Consent Order (signed August 2004) modified Milestone M-45-00C (Change Order M-45-04-01) changed the regulatory requirements for retrieval of waste in tanks S-103, S-105, and S-106. "Retrieval" status in these tanks is thereby rescinded.
- (4) Tank A-101 contains retained gas in saltcake; tanks S-102, S-111, U-103, and U-109 contain retained gas in saltcake and sludge.
- (5) C-203: Volumes: Total waste 139 gallons, and sludge 139 gallons, per RPP-CALC-25672, Rev. 0, "Calculation for the Post-Retrieval Waste Volume Determination for Single-Shell Tank C-103," dated March 31, 2005.
- (6) S-102: Volume estimate as of June 28, 2005: Total waste 341,000 gallons.
- (7) S-112: Volume estimate as of May 17, 2005: Total waste 31,000 gallons.

Table 4-2. Single-Shell Tanks Interim Stabilization Status (Sheet 1 of 2).

Tank Number	Tank Integrity	Interim Stabilization Date (1)	Interim Stabilization Method	Tank Number	Tank Integrity	Interim Stabilization Date (1)	Interim Stabilization Method
A-101	SOUND	11/03	JET (16)	BY-107	ASMD LKR	07/79	JET
A-102	SOUND	08/89	SN	BY-108	ASMD LKR	02/85	JET
A-103	ASMD LKR	06/88	AR	BY-109	SOUND	07/97	JET
A-104	ASMD LKR	09/78	AR (3)	BY-110	SOUND	01/85	JET
A-105	ASMD LKR	07/79	AR	BY-111	SOUND	01/85	JET
A-106	SOUND	08/82	AR	BY-112	SOUND	06/84	JET
AX-101	SOUND	06/03	JET (9)	C-101	ASMD LKR	11/83	AR
AX-102	ASMD LKR	09/88	SN	C-102	SOUND	09/95	JET (2)
AX-103	SOUND	08/87	AR	C-103	SOUND	07/03	JET (11)
AX-104	ASMD LKR	08/81	AR	C-104	SOUND	09/89	SN
B-101	ASMD LKR	03/81	SN	C-105	SOUND	10/95	AR
B-102	SOUND	08/85	SN	C-106	SOUND	Retrieval Completed 12/31/03	
B-103	ASMD LKR	02/85	SN	C-107	SOUND	09/95	JET
B-104	SOUND	06/85	SN	C-108	SOUND	03/84	AR
B-105	ASMD LKR	12/84	AR	C-109	SOUND	11/83	AR
B-106	SOUND	03/85	SN	C-110	ASMD LKR	05/95	JET
B-107	ASMD LKR	03/85	SN	C-111	ASMD LKR	03/84	SN
B-108	SOUND	05/85	SN	C-112	SOUND	09/90	AR
B-109	SOUND	04/85	SN	C-201	ASMD LKR	03/82	AR
B-110	ASMD LKR	12/84	AR	C-202	ASMD LKR	08/81	AR
B-111	ASMD LKR	06/85	SN	C-203	ASMD LKR	Retrieval Completed 03/24/05	
B-112	ASMD LKR	05/85	SN	C-204	ASMD LKR	09/82	AR
B-201	ASMD LKR	08/81	AR (3)	S-101	SOUND	12/03	JET (18)
B-202	SOUND	05/85	AR (2)	S-102	SOUND	Retrieval in progress	
B-203	ASMD LKR	06/84	AR	S-103	SOUND	04/00	JET
B-204	ASMD LKR	06/84	AR	S-104	ASMD LKR	12/84	AR
BX-101	ASMD LKR	09/78	AR (3)	S-105	SOUND	09/88	JET
BX-102	ASMD LKR	11/78	AR	S-106	SOUND	02/01	JET
BX-103	SOUND	11/83	AR (2) (3)	S-107	SOUND	08/03	JET (13)
BX-104	SOUND	09/89	SN	S-108	SOUND	12/96	JET
BX-105	SOUND	03/81	SN	S-109	SOUND	06/01	JET
BX-106	SOUND	07/95	SN	S-110	SOUND	01/97	JET
BX-107	SOUND	09/90	JET	S-111	SOUND	12/03	Jet (17)
BX-108	ASMD LKR	07/79	SN	S-112	SOUND	Retrieval in progress	
BX-109	SOUND	08/90	JET	SX-101	SOUND	08/03	JET (12)
BX-110	ASMD LKR	08/85	SN	SX-102	SOUND	08/03	JET (14)
BX-111	ASMD LKR	03/95	JET	SX-103	SOUND	05/03	JET (8)
BX-112	SOUND	09/90	JET	SX-104	ASMD LKR	04/00	JET
BY-101	SOUND	05/84	JET	SX-105	SOUND	08/02	JET (6)
BY-102	SOUND	04/95	JET	SX-106	SOUND	05/00	JET
BY-103	ASMD LKR	11/97	JET (2)	SX-107	ASMD LKR	10/79	AR
BY-104	SOUND	01/85	JET	SX-108	ASMD LKR	08/79	AR
BY-105	ASMD LKR	03/03	JET	SX-109	ASMD LKR	05/81	AR
BY-106	ASMD LKR	12/03	JET (19)	SX-110	ASMD LKR	08/79	AR

Table 4-2. Single-Shell Tanks Interim Stabilization Status (Sheet 2 of 2).

Tank Number	Tank Integrity	Interim Stabilization Date (1)	Interim Stabilization Method	Tank Number	Tank Integrity	Interim Stabilization Date (1)	Interim Stabilization Method
SX-111	ASMD LKR	07/79	SN	TX-111	SOUND	04/83	JET
SX-112	ASMD LKR	07/79	AR	TX-112	SOUND	04/83	JET
SX-113	ASMD LKR	11/78	AR	TX-113	ASMD LKR	04/83	JET
SX-114	ASMD LKR	07/79	AR	TX-114	ASMD LKR	04/83	JET
SX-115	ASMD LKR	09/78	AR (3)	TX-115	ASMD LKR	09/83	JET
T-101	ASMD LKR	04/93	SN	TX-116	ASMD LKR	04/83	JET
T-102	SOUND	03/81	AR (2)(3)	TX-117	ASMD LKR	03/83	JET
T-103	ASMD LKR	11/83	AR	TX-118	SOUND	04/83	JET
T-104	SOUND	11/99	JET	TY-101	ASMD LKR	04/83	JET
T-105	SOUND	06/87	AR	TY-102	SOUND	09/79	AR
T-106	ASMD LKR	08/81	AR	TY-103	ASMD LKR	02/83	JET
T-107	ASMD LKR	05/96	AR	TY-104	ASND KJR	11/83	AR
T-108	ASMD LKR	11/78	AR	TY-105	ASMD LKR	02/83	JET
T-109	ASMD LKR	12/84	AR	TY-106	ASMD LKR	11/78	AR
T-110	SOUND	01/00	JET	U-101	ASMD LKR	09/79	AR
T-111	ASMD LKR	02/95	JET	U-102	SOUND	06/02	JET (5)
T-112	SOUND	03/81	AR (2)(3)	U-103	SOUND	09/00	JET
T-201	SOUND	04/81	AR (3)	U-104	ASMD LKR	10/78	AR
T-202	SOUND	08/81	AR	U-105	SOUND	03/01	JET
T-203	SOUND	04/81	AR	U-106	SOUND	03/01	JET
T-204	SOUND	08/81	AR	U-107	SOUND	10/03	JET (15)
TX-101	SOUND	02/84	AR	U-108	SOUND	03/04	(20)
TX-102	SOUND	04/83	JET	U-109	SOUND	04/02	JET (4)
TX-103	SOUND	08/83	JET	U-110	ASMD LKR	12/84	AR
TX-104	SOUND	09/79	SN	U-111	SOUND	06/03	JET (10)
TX-105	ASMD LKR	04/83	JET	U-112	ASMD LKR	09/79	AR
TX-106	SOUND	06/83	JET	U-201	SOUND	08/79	AR
TX-107	ASMD LKR	10/79	AR	U-202	SOUND	08/79	SN
TX-108	SOUND	03/83	JET	U-203	SOUND	08/79	AR
TX-109	SOUND	04/83	JET	U-204	SOUND	08/79	SN
TX-110	ASMD LKR	04/83	JET				

<b>LEGEND:</b> AR            Administratively Interim Stabilized JET           Saltwell Jet Pumped to Remove Drainable Interstitial Liquid SN            Supernatant Pumped (Non-Jet Pumped) ASMD LKR   Assumed Leaker N/A           Not yet Interim Stabilized		Interim Stabilized Tanks      149 Total Single-Shell Tanks      149
--	--	--

Table 4-2. - Footnotes: (in chronological order)

- (1) These dates indicate when the tanks were actually interim stabilized. In some cases, the official interim stabilization documents were issued at a later date.
- (2) Although tanks 241-BX-103, T-102, and T-112 met the interim stabilization administrative procedure at the time they were stabilized, they no longer meet the updated administrative procedure. The tanks were re-evaluated in 1996 and a letter was issued to DOE-RL recommending that no further pumping be performed on these tanks, based on an economic evaluation. In February 2000, it was determined that five tanks no longer met the stabilization criteria (241-

Table 4-2. – Footnotes continued

- BX-103, T-102, and T-112 exceed the supernatant criteria, and BY-103 and C-102 exceed the Drainable Interstitial Liquid [DIL] criteria).
- An intrusion investigation was completed on tank 241-B-202 in 1996 and it was determined that this tank no longer meets the recently updated administrative procedure for 200 series tanks.
- (3) Original interim stabilization data are missing on four tanks: 241-B-201, T-102, T-112, and T-201. In February 2001, three additional tanks were added to those missing stabilization data: 241-A-104, BX-101, and SX-115.
  - (4) Tank 241-U-109 was declared Interim Stabilized on April 5, 2002. The declaration letter to DOE was issued on June 20, 2002. The surface is primarily a brown colored waste with irregular patches of white salt crystal. Approximately 70% of the waste surface is covered by the salt formations. The waste surface appears dry and shows signs of cracking due to saltwell pumping. There is no visible liquid within the tank.
  - (5) Tank 241-U-102 was declared Interim Stabilized on June 19, 2002. The declaration letter to DOE was issued June 28, 2002. The surface is primarily a gray-brown colored cracked waste with irregular patches of white salt crystal. Approximately 50% of the waste surface is covered by the salt formations. The waste surface appears dry and shows signs of cracking due to saltwell pumping. There is approximately a 5-foot wide pool of visible liquid within the saltwell screen depression.
  - (6) Tank 241-SX-105 was declared Interim Stabilized on August 1, 2002; the declaration letter to DOE was issued August 20, 2002. The surface is a rough, yellowish-gray saltcake waste with an irregular surface of visible cracks and shelves due to saltwell pumping. The waste surface appears to be dry and shows no standing water within the tank.
  - (7) Tank 241-BY-105 was declared Interim Stabilized on March 7, 2003; the declaration letter to DOE was issued March 25, 2003. An in-tank video was taken January 5, 2003. The surface is a rough, yellowish brown saltcake waste with an irregular surface of visible lumps and shelves that were created as the surface was dried out by saltwell pumping. The waste surface appears to be dry and shows no standing water within the tank. A large hole around the saltwell screen shows no evidence of supernatant liquid.
  - (8) Tank 241-SX-103 was declared Interim Stabilized on May 31, 2003; the declaration letter to DOE was issued June 13, 2003. An in-tank video was taken December 31, 2001. The upper waste surface is uneven and rough, with many cracks and shelves due to surface drying caused by saltwell pumping. All estimations regarding waste dimensions were obtained by comparison with known dimensions of installed in-tank equipment.
  - (9) Tank 241-AX-101 was declared Interim Stabilized on June 2, 2003. The declaration letter to DOE was issued January 19, 2004. An in-tank video was taken November 5, 2003. The surface is a dry flaky, crystalline, yellowish-white saltcake waste in a fairly uniform surface of large cracks that were created as the surface dried out by saltwell pumping. The surface is dry and shows no standing water in the tank.
  - (10) Tank 241-U-111 was declared Interim Stabilized on June 25, 2003, due to major equipment failure; the declaration letter to DOE was issued July 14, 2003. An in-tank video was taken March 25, 2003. The surface is a dry, crusty, flat surface saltcake waste with a fairly uniform surface of large cracks and pocked holes that were created as the surface was dried out by saltwell pumping. The waste surface is dry and shows no standing water.
  - (11) Tank 241-C-103 was declared Interim Stabilized on July 11, 2003, due to major equipment failure; the declaration letter to DOE was issued August 13, 2003. An in-tank video was taken March 3, 2003. The surface is a dry-cracked brown sludge type waste, which appears to be relatively level and to have more cracking near the tank walls. There is a roughly 3-foot diameter supernatant pool around the saltwell screen. There are also small supernatant pools around two risers and many liquid pockets across the center waste surface. The ENRAF is out of service and there is no liquid observation well (LOW) installed in the tank.
  - (12) Tank 241-SX-101 was declared Interim Stabilized on August 14, 2003; the declaration letter to DOE was issued August 22, 2003. An in-tank video was taken August 6, 2003. The surface is a rough, yellowish gray saltcake waste with an irregular surface of visible cracks and shelves that were created as the waste was dried out by saltwell pumping. The waste surface appears to be dry and shows no standing water. A cylindrical pool (approximately 5 foot diameter) around the saltwell screen shows evidence of apparent supernatant liquid, but upon closer examination, was determined to be interstitial liquid.

Table 4-2. – Footnotes continued

- (13) Tank 241-S-107 was declared Interim Stabilized on August 28, 2003, due to major equipment failure. Interim Stabilization documentation was issued February 4, 2004; the declaration letter to DOE was issued February 26, 2004. An in-tank video was taken December 12, 2003. The waste appears as a flat, dark, sludge-type waste with an irregular surface of visible cracks created as the waste dried out from saltwell pumping. The waste surface appears to be dry except for a small pool surrounding the saltwell screen.
- (14) Tank 241-SX-102 was declared Interim Stabilized on August 28, 2003, due to major equipment failure. The declaration letter to DOE was issued August 4, 2004. An in-tank video was taken December 10, 2003. The waste is a rough, yellowish-tray saltcake with an irregular surface of visible cracks and shelves that were created as the waste was dried out by saltwell pumping. The waste surface appears to be dry and shows no standing water on the surface.
- (15) Tank 241-U-107 was declared Interim Stabilized on October 7, 2003. The declaration letter to DOE was issued January 19, 2004. An in-tank video was taken February 4, 2003. The surface is a smooth, brownish saltcake with irregular patches of white salt crystals created as the waste was dried out from saltwell pumping. The waste surface appears to be dry and shows no standing water on the surface.
- (16) Tank 241-A-101 was declared Interim Stabilized on November 10, 2003. The declaration letter to DOE was issued June 30, 2004. An in-tank video was taken September 5, 2003. The waste appears as a flat, dark, sludge-type waste with an irregular surface with white clumps of a saltcake-type material. Cracks in the waste surface were created as the waste was dried out by saltwell pumping. The waste surface is dry except for a small pool around the saltwell screen.
- (17) Tank 241-S-111 was declared Interim Stabilized on December 15, 2003, due to major equipment failure. The declaration letter to DOE was issued May 26, 2005.
- (18) Tank 241-S-101 was declared Interim Stabilized on December 29, 2003. The declaration letter to DOE was issued April 30, 2004. An in-tank video was taken March 2, 2004. The waste appears to be a flat, dark, sludge-type waste with an irregular surface with white clumps of saltcake. Also visible are cracks in the waste surface that were created as the waste was dried out by saltwell pumping. The waste surface is dry except for this small pool.
- (19) Tank BY-106 was declared Interim Stabilized on December 31, 2003. **The declaration letter to DOE was issued June 30, 2005.**
- (20) Tank U-108 was declared Interim Stabilized on March 18, 2004, due to major equipment failure. The declaration letter to DOE was issued September 8, 2004. An in-tank video was taken March 8, 2004. The waste is a smooth, brownish saltcake waste with irregular patches of white salt crystals that were created as the waste was dried out by saltwell pumping. The surface appears to be dry with evidence of cracking and no standing water.

Table 4-3. Single-Shell Tank Leak Volume Estimates (Sheet 1 of 2)

Tank Number	Confirmed or Assumed Leaker (3)	Estimated Leak Volume Gallons (2)	Interim Stabilized (11)	Leak Estimate	
				Updated	Reference
241-A-103	1987	5500 (8)	06/88	1987	(j)
241-A-104	1975	500 to 2500	09/78	1983	(a)(p)
241-A-105 (1)	1963	10000 to 270000	07/79	1991	(b)(c)
241-AX-102	1988	3000 (8)	09/88	1989	(h)
241-AX-104	1977	-- (6)	08/81	1989	(g)
241-B-101	1974	-- (6)	03/81	1989	(g)
241-B-103	1978	-- (6)	02/85	1989	(g)
241-B-105	1978	-- (6)	12/84	1989	(g)
241-B-107	1980	8000 (8)	03/85	1986	(d)(f)
241-B-110	1981	10000 (8)	03/85	1986	(d)
241-B-111	1978	-- (6)	06/85	1989	(g)
241-B-112	1978	2000	05/85	1989	(g)
241-B-201	1980	1200 (8)	08/81	1984	(e)(f)
241-B-203	1983	300 (8)	06/84	1986	(d)
241-B-204	1984	400 (8)	06/84	1989	(g)
241-BX-101	1972	-- (6)	09/78	1989	(g)
241-BX-102	1971	70000	11/78	1986	(d)
241-BX-108	1974	2500	07/79	1986	(d)
241-BX-110	1976	-- (6)	08/85	1989	(g)
241-BX-111	1984 (13)	-- (6)	03/95	1993	(g)
241-BY-103	1973	<5000	11/97	1983	(a)
241-BY-105	1984	-- (6)	03/03	1989	(g)
241-BY-106	1984	-- (6)	N/A	1989	(g)
241-BY-107	1984	15100 (8)	07/79	1989	(g)
241-BY-108	1972	<5000	02/85	1983	(a)
241-C-101	1980	20000 (8)(10)	11/83	1986	(d)
241-C-110	1984	2000	05/95	1989	(g)
241-C-111	1968	5500 (8)	03/84	1989	(g)
241-C-201 (4)	1988	550	03/82	1987	(i)
241-C-202 (4)	1988	450	08/81	1987	(i)
241-C-203	1984	400 (8)	03/82	1986	(d)
241-C-204 (4)	1988	350	09/82	1987	(i)
241-S-104	1968	24000 (8)	12/84	1989	(g)
241-SX-104	1988	6000 (8)	04/00	1988	(k)
241-SX-107	1964	<5000	10/79	1983	(a)
241-SX-108 (5)(14)	1962	2400 to 35000	08/79	1991	(l)(p)(s)
241-SX-109 (5)(14)	1965	<10000	05/81	1992	(m)(s)
241-SX-110	1976	5500 (8)	08/79	1989	(g)
241-SX-111 (14)	1974	500 to 2000	07/79	1986	(d)(s)
241-SX-112 (14)	1969	30000	07/79	1986	(d)(s)
241-SX-113	1962	15000	11/78	1986	(d)
241-SX-114	1972	-- (6)	07/79	1989	(g)
241-SX-115	1965	50000	09/78	1992	(n)
241-T-101	1992	7500 (8)	04/93	1992	(o)
241-T-103	1974	<1000 (8)	11/83	1989	(g)
241-T-106	1973	115000 (8)	08/81	1986	(d)

Table 4-3. Single-Shell Tank Leak Volume Estimates (Sheet 2 of 2)

Tank Number	Confirmed or Assumed Leaker (3)	Estimated Leak Volume Gallons (2)	Interim Stabilized (11)	Leak Estimate	
				Updated	Reference
241-T-107	1984	-- (6)	05/96	1989	(g)
241-T-108	1974	<1000 (8)	11/78	1980	(f)
241-T-109	1974	<1000 (8)	12/84	1989	(g)
241-T-111	1979, 1994 (12)	<1000 (8)	02/95	1994	(f)(r)
241-TX-105	1977	-- (6)	04/83	1989	(g)
241-TX-107 (5)	1984	2500	10/79	1986	(d)
241-TX-110	1977	-- (6)	04/83	1989	(g)
241-TX-113	1974	-- (6)	04/83	1989	(g)
241-TX-114	1974	-- (6)	04/83	1989	(g)
241-TX-115	1977	-- (6)	09/83	1989	(g)
241-TX-116	1977	-- (6)	04/83	1989	(g)
241-TX-117	1977	-- (6)	03/83	1989	(g)
241-TY-101	1973	<1000 (8)	04/83	1980	(f)
241-TY-103	1973	3000	02/83	1986	(d)
241-TY-104	1981	1400 (8)	11/83	1986	(d)
241-TY-105	1960	35000	02/83	1986	(d)
241-TY-106	1959	20000	11/78	1986	(d)
241-U-101	1959	30000	09/79	1986	(d)
241-U-104	1961	55000	10/78	1986	(d)
241-U-110	1975	5000 to 8100 (8)	12/84	1986	(d)(p)
241-U-112	1980	8500 (8)	09/79	1986	(d)
67 Tanks					

Table 4-3. - Footnotes:

(1) Current estimates [see Reference (b)] are that 610 Kgallons of cooling water was added to tank A-105 from November 1970 to December 1978 to aid in evaporative cooling. In accordance with Dangerous Waste Regulations [Washington Administrative Code 173-303-070 (2)(a)(ii), as amended, Washington State Department of Ecology, 1990, Olympia, Washington], any of this cooling water that has been added and subsequently leaked from the tank must be classified as a waste and should be included in the total leak volume. In August 1991, the leak volume estimate for this tank was updated in accordance with the WAC regulations. Previous estimates excluded the cooling water leaks from the total leak volume estimates because the waste content (concentration) in the cooling water which leaked should be much less than the original liquid waste in the tank (the sludge is relatively insoluble). The total leak volume estimate in this report (10 to 277 Kgallons) is based on the following (see References):

a. Reference (b) contains an estimate of 5 to 15 Kgallons for the initial leak prior to August 1968.

Reference (b) contains an estimate of 5 to 30 Kgallons for the leak while the tank was being sluiced from August 1968 to November 1970.

Reference (b) contains an estimate of 610 Kgallons of cooling water added to the tank from November 1970 to December 1978, but it was estimated that the leakage was small during this period. This reference contains the statement "Sufficient heat was generated in the tank to evaporate most, and perhaps nearly all, of this water." This results in a low estimate of zero gallons leakage from November 1970 to December 1978.

b. Reference (c) contains an estimate that 378 to 410 Kgallons evaporated out of the tank from November 1970 to December 1978. Subtracting the minimum evaporation estimate from the cooling water added estimate provides a range from 0 to 232 Kgallons of cooling water leakage from November 1970 to December 1978.

Table 4-3. - Footnotes continued

	<u>Low Estimate</u>	<u>High Estimate</u>
Prior to August 1968	5,000	15,000
August 1968 to November 1970	5,000	30,000
November 1970 to December 1978	<u>0</u>	<u>232,000</u>
Totals	10,000	277,000

- (2) Tank leak volume estimates presented here are being updated as a result of additional vadose zone data, tank leak volume assessments and review of tanks for retrieval/closure consideration. Future revisions of the tank summary report will include updated leak volume and radionuclide inventory estimates by farm and will include near surface and vadose contamination from sources in addition to tank leaks that will be used for tank closure planning and performance assessments. Tank leak volume estimates presented here do not include (with some exceptions), such things as: (a) cooling/raw water leaks, (b) intrusions (rain infiltration) and subsequent leaks, (c) leaks inside the tank farm but not through the tank liner (surface leaks, pipeline leaks, leaks at the joint for the overflow or fill lines, etc.), and (d) leaks from catch tanks, diversion boxes, encasements, etc.
- (3) In many cases, a leak was suspected long before it was identified or confirmed. For example, Reference (d) shows that tank U-104 was suspected of leaking in 1956. The leak was confirmed in 1961. This report lists the "assumed leaker" date of 1961. Using present standards, tank U-104 would have been declared an assumed leaker in 1956. In 1984, the criteria designations of "suspected leaker," "questionable integrity," "confirmed leaker," "declared leaker," and "borderline and dormant" were merged into one category now reported as "assumed leaker." See Reference (f) for explanation of when, how long, and how fast some of the tanks leaked. It is highly likely that there have been undetected leaks from single-shell tanks because of the nature of their design and instrumentation.
- (4) The leak volume estimate date for these tanks is before the declared leaker date because the tank was in a suspected leaker or questionable integrity status; however, a leak volume had been estimated prior to the tank being reclassified.
- (5) The increasing radiation levels in drywells and laterals associated with these three tanks could be indicating continuing leak or movement of existing radionuclides in the soil. There is no conclusive way to confirm these observations. (Repeat spectral drywell scans are not part of the current Tank Farm leak detection program but can be run on request a special needs arise. A select subset of drywells is routinely monitored by the Vadose Zone Characterization Project to assess movement of gamma-emitting radionuclides in the subsurface. There are currently no functioning laterals and no plan to prepare them for use).
- (6) Methods were used to estimate the leak volumes from these 19 tanks based on the assumption that their cumulative leakage is approximately the same as for 18 of the 24 tanks identified in footnote (9). For more details see Reference (g). The total leak volume estimate for these tanks is 150 Kgallons (rounded to the nearest Kgallon), for an average of approximately 8 Kgallons for each of 19 tanks.
- (7) The total has been rounded to the nearest 50 Kgallons. Upper bound values were used in many cases in developing these estimates. It is likely that some of these tanks have not actually leaked.
- (8) Leak volume estimate is based solely on observed liquid level decreases in these tanks. This is considered to be the most accurate method for estimating leak volumes.
- (9) The curie content shown is as listed in the reference document and is not decayed to a consistent date: therefore, a cumulative total is inappropriate.
- (10) Tank C-101 experienced a liquid level decrease in the late 1960s and was taken out of service and pumped to a minimum heel in December 1969. In 1970, the tank was classified as a "questionable integrity" tank. Liquid level data show decreases in level throughout the 1970s and the tank was saltwell pumped during the 1970s, ending in April 1979. The tank was reclassified as a "confirmed leaker" in January 1980. See References (p) and (q); refer to Reference (q) for information on the potential for there to have been leaks from other C-farm tanks (specifically, C-102, C-103, and C-109).
- (11) These dates indicate when the tanks were declared to be interim stabilized. In some cases, the official interim stabilization documents were issued at a later date. Also, in some cases, the field work associated with interim stabilization was completed at an earlier date.

Table 4-3. Footnotes continued

- (12) Tank T-111 was declared an "assumed re-leaker" on February 28, 1994, due to a decreasing trend in surface level measurement. This tank was pumped, and interim stabilization completed on February 22, 1995.
- (13) Tank BX-111 was declared an "assumed re-leaker" in April 1993. Preparations for pumping were delayed, following an administrative hold placed on all tank farm operations in August 1993. Pumping resumed and the tank was declared interim stabilized on March 15, 1995.
- (14) The leak volume and curie release estimates on tanks SX-108, SX-109, SX-111, and SX-112 have been re-evaluated using a Historical Leak Model [see Reference (s)]. In general, the model estimates are much higher than the values listed in the table, both for volume and curies released. The values listed in the table do not reflect this revised estimate because, "In particular, it is worth emphasizing that this report was never meant to be a definitive update for the leak baseline at the Hanford Site. It was rather meant to be an attempt to view the issue of leak inventories with a new and different methodology." (This quote is from the first page of the referenced report).
- (15) Tri-Party Agreement milestones (M-45 series) were developed that establish a formalized approach for evaluating impacts on groundwater quality of loss of tank wastes to the vadose zone underlying these tank farms.

SST Vadose Zone Project drilling and testing activities near tank BX-102 were completed in March 2001. A borehole (299-E33-45) was drilled through the postulated uranium plume resulting from the 1951 tank BX-102 overfill event to confirm the presence of uranium, define its present depth, and survey other contaminants of interest such as Tc-99. Samples were collected for laboratory analyses.

Borehole W33-46, adjacent to tank B-110, was drilled to a depth of approximately 190 feet in July 2001. Soil samples were collected for analysis as part of the tank farm vadose zone characterization activities.

On July 31, 2002, the Washington State Department of Ecology issued a letter-directive which suggested a path forward in dealing with the high <sup>99</sup>Tc activity in groundwater at well 299-W23-19 near tank SX-115. No formal remediation is required, however, extensive purging of the well is to be done concurrent with quarterly sampling. In addition, an array of specific conductivity probes is to be placed in the well to monitor the electrical properties of the water (<sup>99</sup>Tc activity is directly proportional to electrical conductivity). A data logger with remote reading capability together with the specific conductivity probes was installed and fully operational on March 11, 2003.

Table 4-3. - References:

- (a) Murthy, K. S., et al., June 1983, *Assessment of Single-Shell Tank Residual Liquid Issues at Hanford Site, Washington*, PNL-4688, Pacific Northwest Laboratory, Richland, Washington.
- (b) WHC, 1991a, *Tank 241-A-105 Leak Assessment*, WHC-MR-0264, Westinghouse Hanford Company, Richland, Washington.
- (c) WHC, 1991b, *Tank 241-A-105 Evaporation Estimate 1970 Through 1978*, WHC-EP-0410, Westinghouse Hanford Company, Richland, Washington.
- (d) Smith, D. A., January 1986, *Single-Shell Tank Isolation Safety Analysis Report*, SD-WM-SAR-006, Rev. 1, Rockwell Hanford Operations, Richland, Washington.
- (e) McCann, D. C., and T. S. Vail, September 1984, *Waste Status Summary*, RHO-RE-SR-14, Rockwell Hanford Operations, Richland, Washington.
- (f) Catlin, R. J., March 1980, *Assessment of the Surveillance Program of the High-Level Waste Storage Tanks at Hanford*, Office of Environmental Compliance and Review, for the U.S. Department of Energy, Washington D.C.
- (g) Baumhardt, R. J., May 15, 1989, Letter to R. E. Gerton, U.S. Department of Energy-Richland Operations Office, *Single-Shell Tank Leak Volumes*, 8901832B R1, Westinghouse Hanford Company, Richland, Washington.
- (h) WHC, 1990a, Occurrence Report, *Surface Level Measurement Decrease in Single-Shell Tank 241-AX-102*, WHC-UO-89-023-TF-05, Westinghouse Hanford Company, Richland, Washington.
- (i) Groth, D. R., July 1, 1987, Internal Memorandum to R. J. Baumhardt, *Liquid Level Losses in Tanks 241-C-201, -202 and -204*, 65950-87-517, Westinghouse Hanford Company, Richland, Washington.
- (j) Groth, D. R., and G. C. Owens, May 15, 1987, Internal Memorandum to J. H. Roecker, *Tank 103-A Integrity Evaluation*, Rockwell Hanford Operations, Richland, Washington.
- (k) Dunford, G. L., July 8, 1988, Internal Memorandum to R. K. Welty, *Engineering Investigation: Interstitial Liquid Level Decrease in Tank 241-SX-104*, 13331-88-416, Westinghouse Hanford Company, Richland, Washington.
- (l) WHC, 1992a, *Tank 241-SX-108 Leak Assessment*, WHC-MR-0300, Westinghouse Hanford Company, Richland, Washington.
- (m) WHC, 1992b, *Tank 241-SX-109 Leak Assessment*, WHC-MR-0301, Westinghouse Hanford Company, Richland, Washington.
- (n) WHC, 1992c, *Tank 241-SX-115 Leak Assessment*, WHC-MR-0302, Westinghouse Hanford Company, Richland, Washington.
- (o) WHC, 1992d, Occurrence Report, *Apparent Decrease in Liquid Level in Single Shell Underground Storage Tank 241-T-101, Leak Suspected; Investigation Continuing*, RL-WHC-TANKFARM-1992-0073, Westinghouse Hanford Company, Richland, Washington.
- (p) WHC, 1990b, *A History of the 200 Area Tank Farms*, WHC-MR-0132, Westinghouse Hanford Company, Richland, Washington.
- (q) WHC, 1993, *Assessment of Unsaturated Zone Radionuclide Contamination Around Single-Shell Tanks 241-C-105 and 241-C-106*, WHC-SD-EN-TI-185, REV OA, Westinghouse Hanford Company, Richland, Washington.
- (r) WHC, 1994, Occurrence Report, *Apparent Liquid Level Decrease in Single Shell Underground Storage Tank 241-T-111; Declared an Assumed Re-Leaker*, RL-WHC-TANKFARM-1994-0009, Westinghouse Hanford Company, Richland, Washington.
- (s) HNF, 1998, Agnew, S. F., and R. A. Corbin, August 1998, *Analysis of SX Farm Leak Histories - Historical Leak Model (HLM)*, HNF-3233, Rev. 0, Los Alamos National Laboratory, Los Alamos, New Mexico.

**5.0 MISCELLANEOUS UNDERGROUND STORAGE TANKS AND SPECIAL SURVEILLANCE FACILITIES**

**Table 5-1. East and West Area Miscellaneous Underground Storage Tanks and Special Surveillance Facilities.**

ACTIVE - still running transfers through the associated diversion boxes or pipeline encasements					
Facility	Location	Receives Waste From:	Waste (Gallons)	Monitored By:	Remarks
<b>EAST AREA</b>					
241-A-302-A	A Farm	A-151 DB	662	SACS/ENRAF/TMACS	
241-ER-311	B Plant	ER-151, ER-152 DB	1827	SACS/ENRAF/Manual	
241-AZ-151	AZ Farm	AZ-702 Condensate	9404	SACS/ENRAF/TMACS	Volume changes daily - pumped to AZ-101 or AY-102 as needed
241-AZ-154	AZ Farm		25	SACS/MT	
244-BX-TK-SMP	BX Complex	DCRT - Receives from several farms	9654	SACS/MT	Receives transfers and is pumped as needed
244-A-TK/SMP	A Complex	DCRT - Receives from several farms	2875	MCS/SACS/WTF	WTF - Receives transfers and is pumped as needed
A-350	A Farm	Collects drainage	293	MCS/SACS/WTF	WTF (uncorrected), pumped as needed
AR-204	AY Farm	Tanker trucks from various facilities	150	DIP TUBE	
A-417	A Farm		1176	SACS/WTF	WTF
CR-003-TK-SMP	C Farm	DCRT	2193	ZIP CORD	Zip cord installed; MT removed; more accurate conversion table used
<b>WEST AREA</b>					
241-TX-302-C	T Plant	TX-154 DB	180	SACS/ENRAF/TMACS	
241-U-301-B	U Farm	U-151, 152, 153, 252 DB	1448	SACS/ENRAF/Manual	Pumped to SY-101, 12/03
241-UX-302-A	U Plant	UX-154	1719	SACS/ENRAF/Manual	Rain intrusion 2/03; recalibration caused decrease 6/03
241-S-304	S Farm	S-151 DB	135	SACS/ENRAF/Manual	Sump not alarming
244-S-TK/SMP	S Farm	From SSTs for transfer to SY-102	2093	SACS/Manual	WTF
244-TX-TK/SMP	TX Farm	From SSTs and PFP for transfer to SY-102	5018	SACS/Manual	Received from 241-Z, tank D-5, 11/04
Vent Station Catch Tank		Cross Site Transfer Line	507	SACS/Manual	MT. Rain intrusion, 1/03
<b>Total Active Facilities - 17</b>					

LEGEND:	
DB	Diversion Box
DCRT	Double-Contained Receiver Tank
ENRAF, MT, Zip Cord	Surface Level Measurement Devices
MCS	Monitor and Control System
Manual	Not connected to any automated system
O/S	Out of Service
PFP	Plutonium Finishing Plant
SACS	Surveillance Automated Control System
SST	Single-Shell Tank
TMACS	Tank Monitor and Control System
WTF	Weight Factor (can be recorded as WTF, WTF [uncorrected] or CWF [uncorrected])

Table 5-2. East Area Inactive Miscellaneous Underground Storage Tanks and Special Surveillance Facilities.

INACTIVE - No longer receiving waste transfers - currently managed by Tank Farm Contractor					
Facility	Location	Received Waste From:	Waste (Gallons)	Monitored By:	Remarks
209-E-TK-111	209 E Bldg.	Decon Catch Tank	Unknown	NM	Removed from service 1988
241-A-302-B	A Farm	A-152 DB	6071	SACS/MT	Isolated 1985, Project B-138, Interim Stabilized 1990, rain intrusion
241-AX-151	N. of PUREX	PUREX	Unknown	NM	Isolated 1985
241-AX-152	AX Farm	AX-152 DB	0	SACS/MT	Declared Assumed Leaker, pumped to AY-102, 3/01, no longer being used
241-B-301-B	B Farm	B-151, 152, 153, 252 DB	22250	NM	Isolated 1985 (1)
241-B-302-B	B Farm	B-154 DB	4930	NM	Isolated 1985 (1)
241-BX-302-A	BX Farm	BR-152, BX-153, BXR-152, BYR-152 DB	840	NM	Isolated 1985 (1)
241-BX-302-B	BX Farm	BX-154 DB	1040	NM	Isolated 1985 (1)
241-BX-302-C	BX Farm	BX-155 DB	870	NM	Isolated 1985 (1)
241-BY-ITS2-TK 1	BY Farm	Vapor condenser	Unknown	NM	Isolated
241-BY-ITS2-TK 2	BY Farm	Heater Flush Tank	Unknown	NM	Stabilized 1977
241-C-301-C	C Farm	C-151, 152, 153, 252 DB	10470	NM	Isolated 1985 (1)
241-ER-311A	SW of B Plant	ER-151 DB	Empty	NM	Abandoned in place 1954
241-AR Vault	A Complex	Between farms and B Plant	Unknown	NM	Stabilized 8/03, RPP-12051
241-BXR-TK/SMP-001	BX Farm	Transfer lines	7200	NM	Interim Stabilization 1985 (1)
241-BXR-TK/SMP-002	BX Farm	Transfer Lines	2180	NM	Interim Stabilization 1985 (1)
241-BXR-TK/SMP-003	BX Farm	Transfer Lines	1810	NM	Interim Stabilization 1985 (1)
241-BXR-TK/SMP-004	BX Farm	Transfer Lines	7100	NM	Interim Stabilization 1985 (1)
Total East Area Inactive Facilities - 18					

LEGEND:	
DB	Diversion Box
MT	Surface Level measurement Device
NM	Not Monitored
SACS	Surveillance Automated Control System
TK, SMP	Tank, Sump

(1) WHC-SD-WM-TI-356, Waste Storage Tank Status and Leak Detection Criteria, Rev. 0, September 30, 1988

Table 5-3. West Area Inactive Miscellaneous Underground Storage Tanks and Special Surveillance Facilities.

INACTIVE - No longer receiving waste transfers - currently managed by Tank Farm Contractor					
Facility	Location	Received Waste From:	Waste (Gallons)	Monitored By:	Remarks
213-W-TK-1	E. of 213-W Compactor Facility	Water Retention Tank	Unknown	NM	Contains only water
231-W-151-001	N. of Z Plant	231-Z Floor drains	Unknown	NM	Inactive, last data 1974
231-W-151-002	N. of Z Plant	231-Z Floor drains	Unknown	NM	Inactive, last data 1974
240-S-302	S Plant	240-S-151-DB	8086		Assumed Leaker, EPDA 85-04
241-S-302-A	S Farm	241-S-151-DB	0		Assumed Leaker TF-EFS-90-042
	Partially filled with grout 2/91, determined to be an Assumed Leaker after leak test. No surface level or intrusion readings obtainable. S-304 (active) replaced S-302				
241-S-302-B	SX Farm	S Encasements	Empty	NM	Isolated 1985 (1)
241-SX-302 (SX-304)	SX Farm	SX-151 DB, 151 TB	Unknown	NM	Isolated 1987
241-T-301	T Farm	DB T-151, 151, 153, 252	Unknown	NM	Isolated 1985 (T-301-B)
241-TX-302	TX Farm	TX-153 DB	Unknown	NM	Isolated 1985 (1)
241-TX-302-X-B	TX Farm	TX Encasements	Unknown	NM	Isolated 1985 (1)
241-TX-302-B	E. of TX Farm	TX-155 DB	3253	SACS/ENRAF	New ENRAF installed 9/02
241-TX-302-B(R)	E. of TX Farm	TX-155 DB	Unknown	NM	Isolated, replaced TX-302-B
241-TY-302-A	TY Farm	TX-153 DB	Unknown	NM	Isolated 1985 (1)
241-TY-302-B	TY Farm	TY Encasements	Empty	NM	Isolated 1985 (1)
241-Z-8	E. of Z Plant	Recuplex waste	Unknown	NM	Isolated, 1974, 1975
242-T-135	T Evaporator	T Evaporator	Unknown	NM	Isolated
242-TA-R1	T Evaporator	Z Plant waste	Unknown	NM	Isolated
243-S-TK-1	NW of S Farm	Personnel Decon. Facility	Empty	NM	Isolated
244-TXR-TK/SMP-001	TX Farm	Transfer lines	Unknown	NM	Interim Stabilized, MT removed 1984 (1)
244-TXR-TK/SMP-002	TX Farm	Transfer lines	Unknown	NM	Interim Stabilized, MT removed 1984 (1)
244-TXR-TK/SMP-003	TX Farm	Transfer lines	Unknown	NM	Interim Stabilized, MT removed 1984 (1)
244-UR-001 Vault TK	U Farm	Tank, Sump and Cell	4220	NM	Stabilized 1985
244-UR-002 Vault TK	U Farm	Tank, Sump and Cell	1400	NM	Stabilized 1985
244-UR-003 Vault TK	U Farm	Tank, Sump and Cell	5996	NM	Stabilized 1985
244-UR-004 Vault TK	U Farm	Tank, Sump and Cell	Empty	NM	Stabilized 1985
Total East Area Inactive Facilities - 25					

LEGEND:	
DB, TD	Diversion Box, Transfer Box
FIC, ENRAF	Surface Level Measurement Devices
MT	Manual Tape - Surface Level measurement Device
NM	Not Monitored
SACS	Surveillance Automated Control System
TK, SMP	Tank, Sump
SACS	Surveillance Automated Control System
TK, SMP	Tank, Sump

(1) WHC-SD-WM-TI-356, Waste Storage Tank Status and Leak Detection Criteria, Rev. 0, September 30, 1988

APPENDIX A - TANK CONFIGURATION AND FACILITIES CHARTS

Figure A-1. High Level Waste Tank Configurations

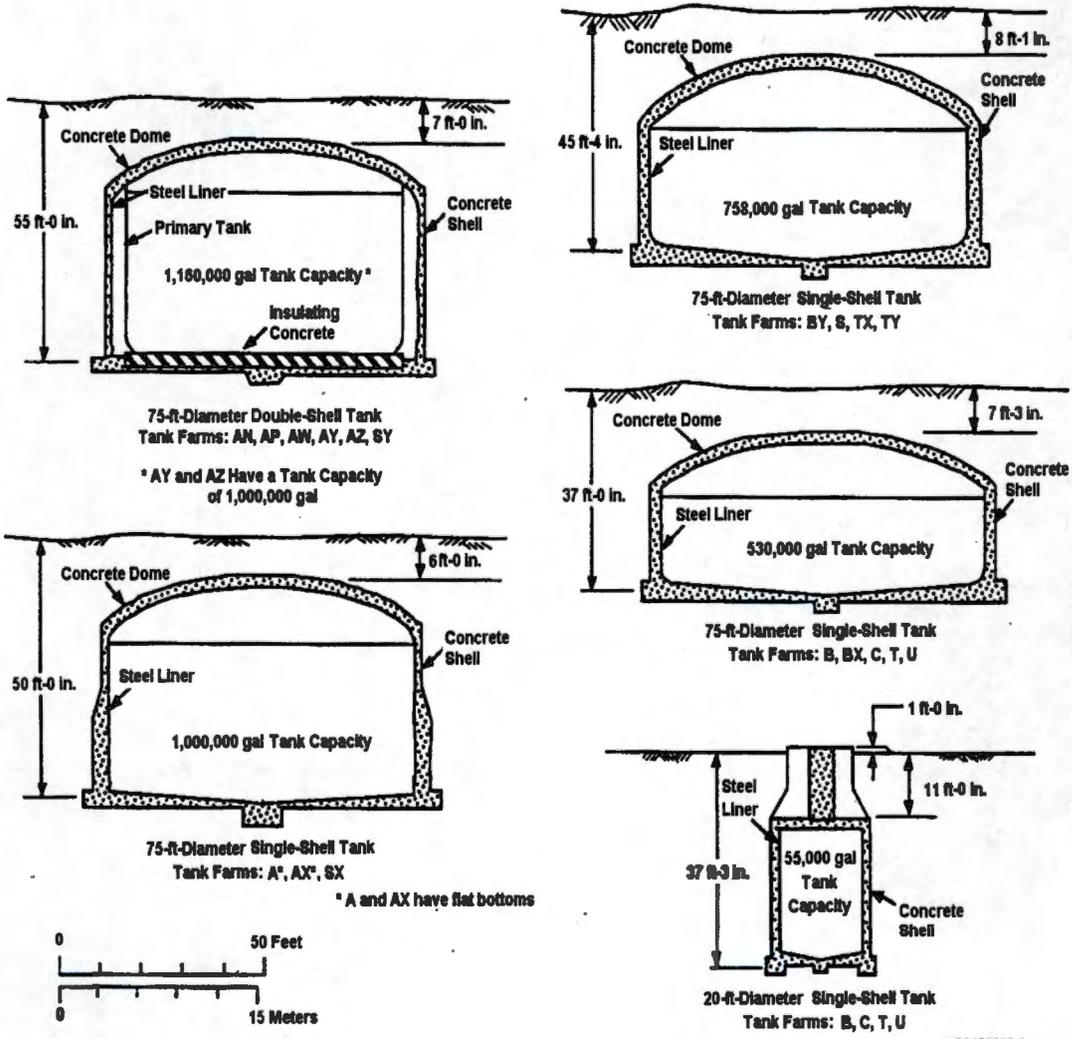


Figure A-2. Double-Shell Tank Instrumentation Configuration


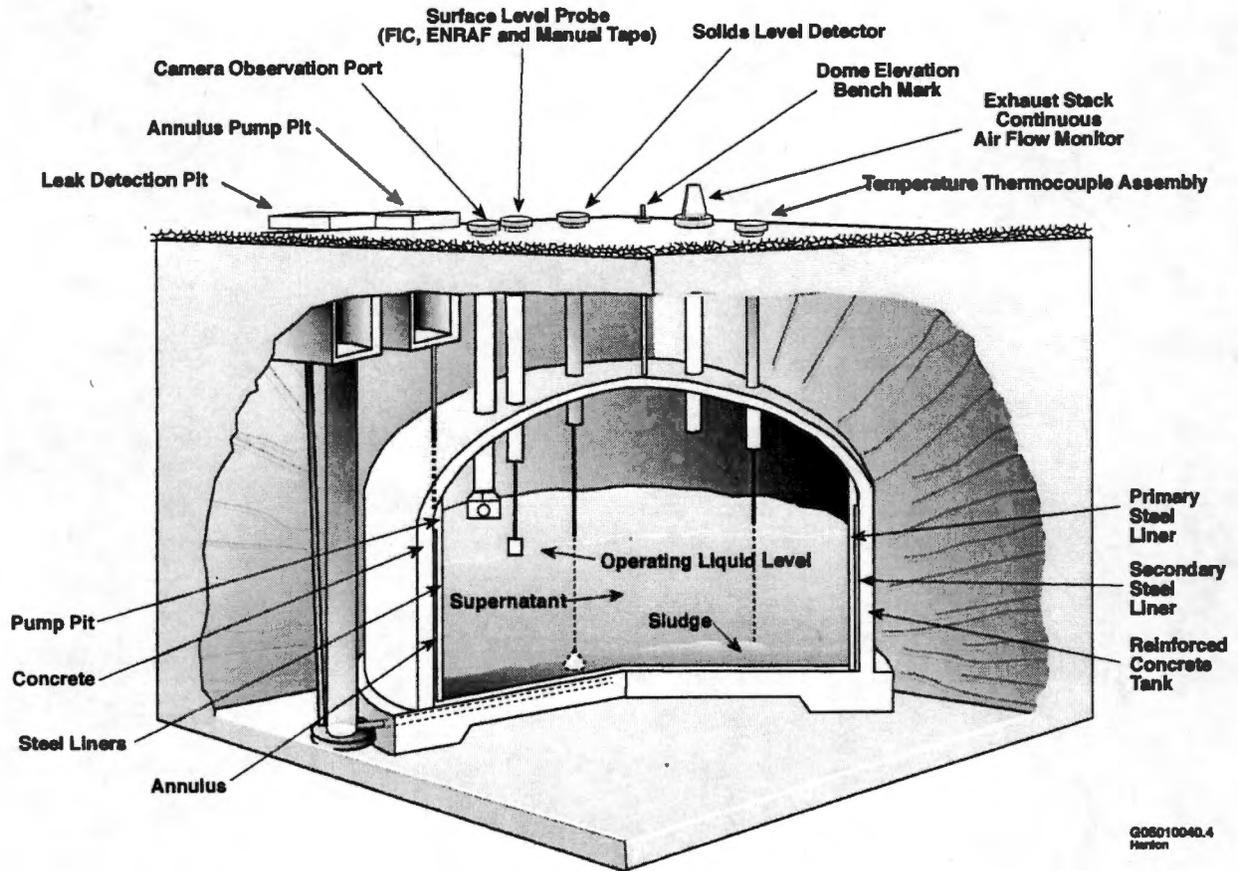


Figure A-3. Single-Shell Tank Instrumentation Configuration

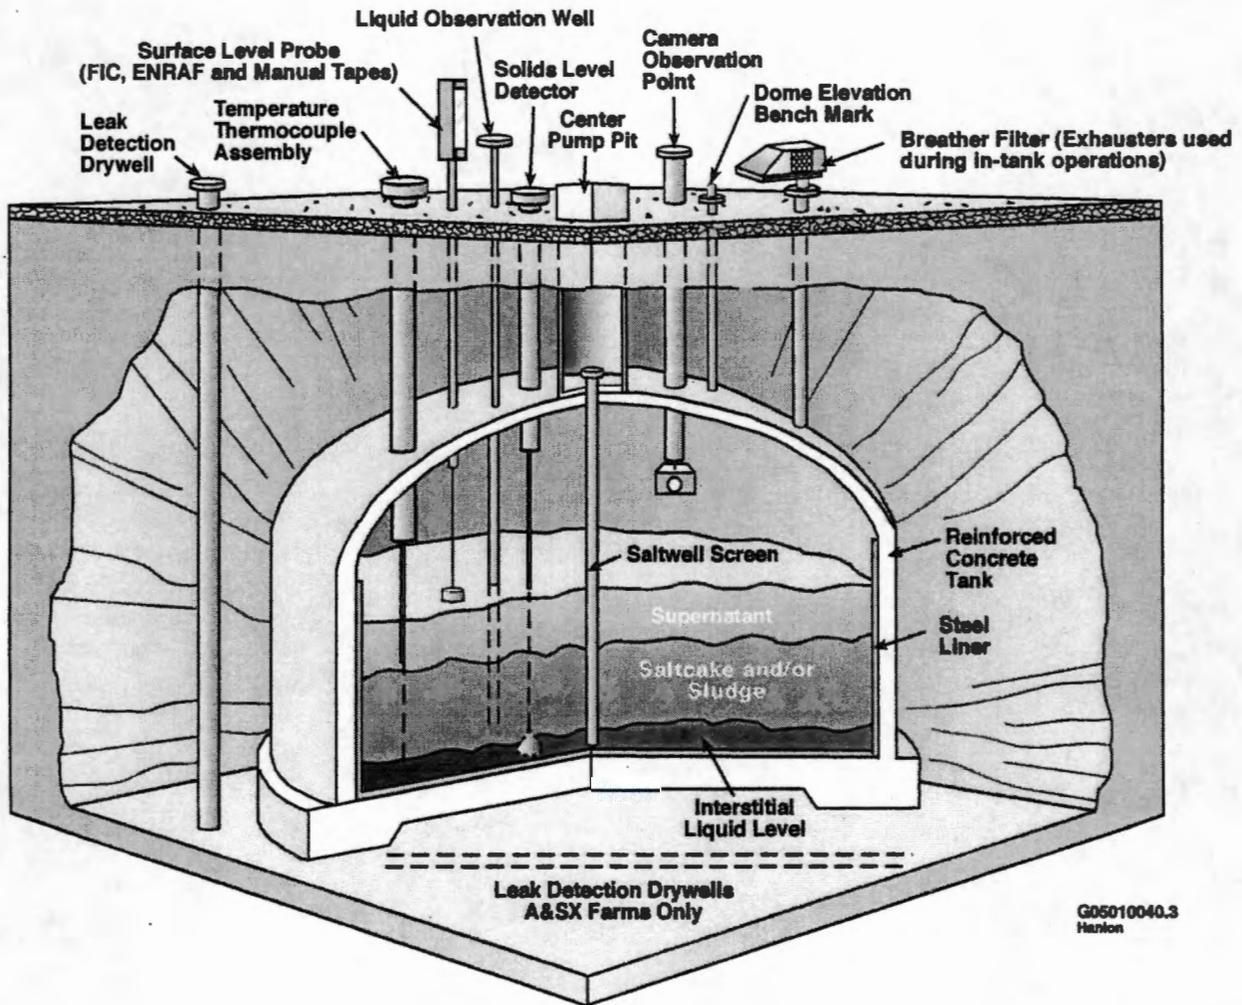


# 200 East Tank Waste Contents

## A-Tank Farm- 1954-55

6 @ 1,000 Kgal Tank Capacity, Single-Shell


Tank	Sludge	Saltcake	Supernatant
241-A-101	3	317	0
241-A-102	0	37	3
241-A-103	2	364	4
241-A-104	28	0	0
241-A-105	37	0	0
241-A-106	50	29	0

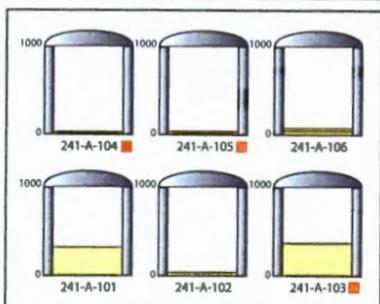

## AZ-Tank Farm- 1975-76

2 @ 1,000 Kgal Tank Capacity, Double-Shell


Tank	Sludge	Saltcake	Supernatant
241-AZ-101	52	0	829
241-AZ-102	105	0	871

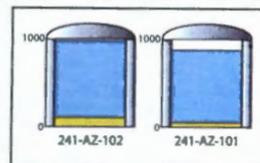

## AN-Tank Farm- 1981

7 @ 1,160 Kgal Tank Capacity, Double-Shell


Tank	Sludge	Saltcake	Supernatant
241-AN-101	0	31	926
241-AN-102	0	154	914
241-AN-103	0	459	500
241-AN-104	0	445	608
241-AN-105	0	538	588
241-AN-106	32	17	883
241-AN-107	0	230	871

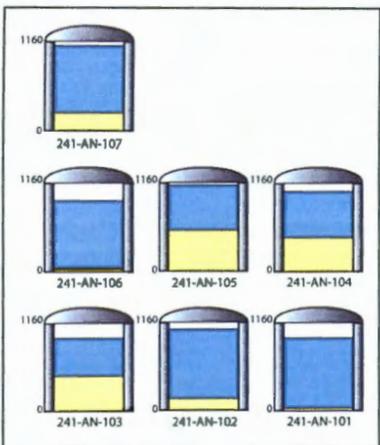

## B-Tank Farm- 1945-47

12 @ 530 Kgal Tank Capacity, Single-Shell  
4 @ 55 Kgal Tank Capacity, Single-Shell


Tank	Sludge	Saltcake	Supernatant
241-B-101	28	81	0
241-B-102	0	28	4
241-B-103	1	55	0
241-B-104	309	65	0
241-B-105	28	262	0
241-B-106	122	0	1
241-B-107	86	75	0
241-B-108	27	65	0
241-B-109	50	75	0
241-B-110	244	0	1
241-B-111	241	0	1
241-B-112	15	17	3
241-B-201	29	0	0
241-B-202	28	0	0
241-B-203	49	0	1
241-B-204	48	0	1

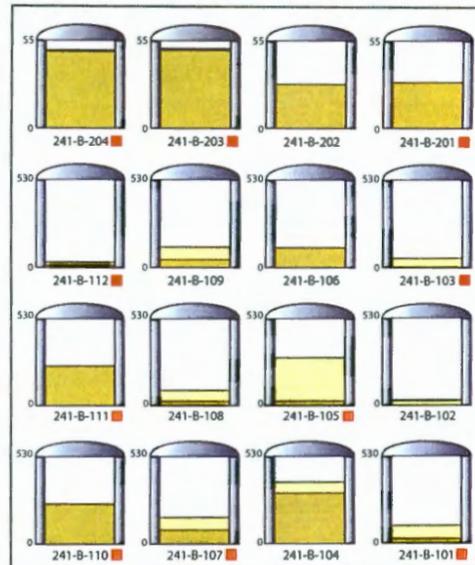

## AP-Tank Farm- 1986

8 @ 1,160 Kgal Tank Capacity, Double-Shell


Tank	Sludge	Saltcake	Supernatant
241-AP-101	0	0	1115
241-AP-102	23	0	1074
241-AP-103	0	0	893
241-AP-104	0	0	1098
241-AP-105	0	89	1049
241-AP-106	0	0	1134
241-AP-107	0	0	345
241-AP-108	0	0	1031

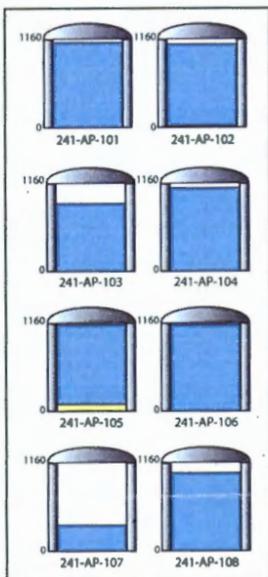

## BX-Tank Farm- 1948-50

12 @ 530 Kgal Tank Capacity, Single-Shell


Tank	Sludge	Saltcake	Supernatant
241-BX-101	48	0	0
241-BX-102	79	0	0
241-BX-103	62	0	13
241-BX-104	97	0	3
241-BX-105	42	25	5
241-BX-106	10	28	0
241-BX-107	347	0	0
241-BX-108	31	0	0
241-BX-109	193	0	0
241-BX-110	65	139	1
241-BX-111	32	157	0
241-BX-112	163	0	1

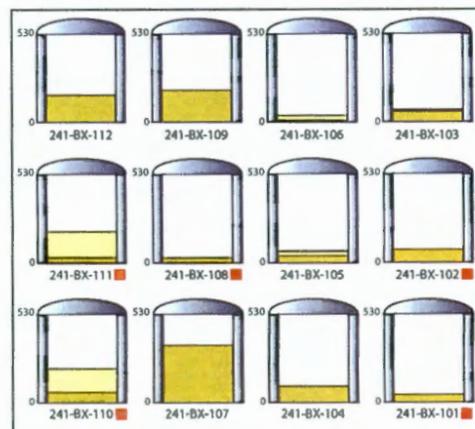

## AW-Tank Farm- 1980

6 @ 1,160 Kgal Tank Capacity, Double-Shell


Tank	Sludge	Saltcake	Supernatant
241-AW-101	0	396	731
241-AW-102	7	0	548
241-AW-103	273	40	785
241-AW-104	66	157	849
241-AW-105	263	0	156
241-AW-106	0	283	617

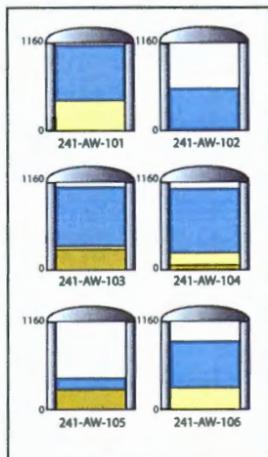

## BY-Tank Farm- 1950-51

12 @ 758 Kgal Tank Capacity, Single-Shell


Tank	Sludge	Saltcake	Supernatant
241-BY-101	37	333	0
241-BY-102	0	279	0
241-BY-103	9	408	0
241-BY-104	45	313	0
241-BY-105	48	433	0
241-BY-106	32	430	0
241-BY-107	16	256	0
241-BY-108	40	182	0
241-BY-109	24	263	0
241-BY-110	43	323	0
241-BY-111	0	301	0
241-BY-112	2	284	0

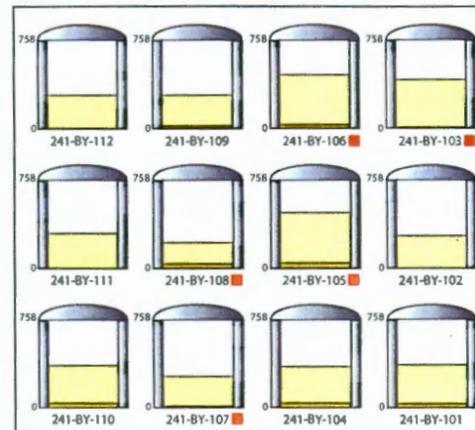

## AX-Tank Farm- 1965-66

4 @ 1,000 Kgal Tank Capacity, Single-Shell


Tank	Sludge	Saltcake	Supernatant
241-AX-101	3	355	0
241-AX-102	6	24	0
241-AX-103	8	99	0
241-AX-104	7	0	0

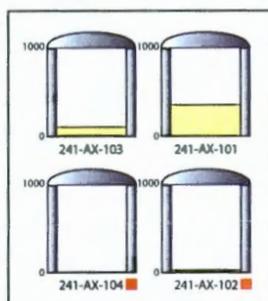

## C-Tank Farm- 1946-53

12 @ 530 Kgal Tank Capacity, Single-Shell  
4 @ 55 Kgal Tank Capacity, Single-Shell


Tank	Sludge	Saltcake	Supernatant
241-C-101	88	0	0
241-C-102	316	0	0
241-C-103	71	0	4
241-C-104	259	0	0
241-C-105	132	0	0
241-C-106	3	0	0
241-C-107	247	0	0
241-C-108	66	0	0
241-C-109	63	0	0
241-C-110	177	0	1
241-C-111	57	0	0
241-C-112	104	0	0
241-C-201	1	0	0
241-C-202	1	0	0
241-C-203	0*	0	0
241-C-204	2	0	0

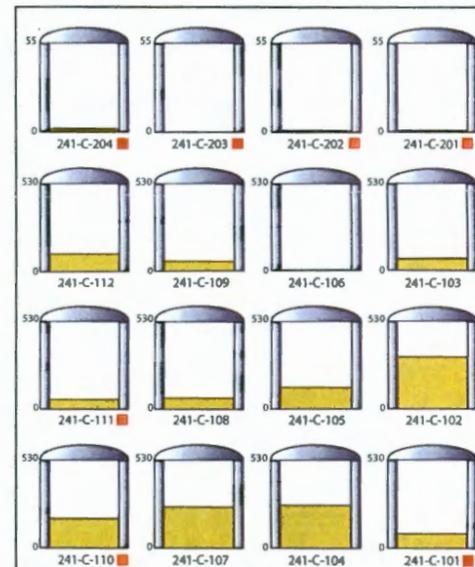

## AY-Tank Farm- 1971-76

2 @ 1,000 Kgal Tank Capacity, Double-Shell


Tank	Sludge	Saltcake	Supernatant
241-AY-101	96	0	83
241-AY-102	151	0	787

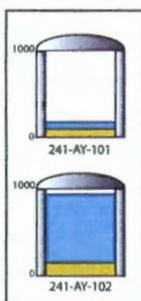

### LEGEND

Sludge (Yellow) Saltcake (Light Yellow) Supernatant (Blue) Available Space (White) Assumed/Confirmed Leaker (Red Square)

Data Derived From Waste Tank Summary Report Dated 06/30/05



VAPO12\CHARDOCS\All By Staff Member\Naiknimbalkar\Tank Figures\200 East Tank Profile 063005.pdf


Figure A-4

# 200 West Tank Waste Contents

## S-Tank Farm- 1950-51

12 @ 758 Kgal Tank Capacity, Single-Shell  
Kgal


Tank	Sludge	Saltcake	Supernatant
241-S-101	235	117	0
241-S-102	0	341	0
241-S-103	9	227	1
241-S-104	132	156	0
241-S-105	2	404	0
241-S-106	0	455	0
241-S-107	320	38	0
241-S-108	5	545	0
241-S-109	13	520	0
241-S-110	96	293	0
241-S-111	76	335	0
241-S-112	0	31	0

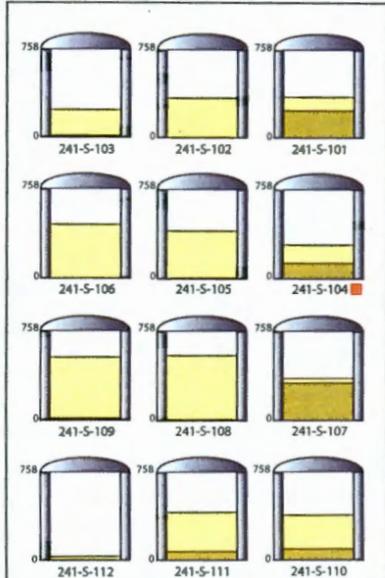

## TX-Tank Farm- 1947-48

18 @ 758 Kgal Tank Capacity, Single-Shell  
Kgal


Tank	Sludge	Saltcake	Supernatant
241-TX-101	74	17	0
241-TX-102	2	215	0
241-TX-103	0	145	0
241-TX-104	34	33	2
241-TX-105	8	568	0
241-TX-106	5	343	0
241-TX-107	0	29	0
241-TX-108	6	121	0
241-TX-109	363	0	0
241-TX-110	37	430	0
241-TX-111	43	321	0
241-TX-112	0	634	0
241-TX-113	93	545	0
241-TX-114	4	528	0
241-TX-115	8	545	0
241-TX-116	66	533	0
241-TX-117	29	451	0
241-TX-118	0	247	0

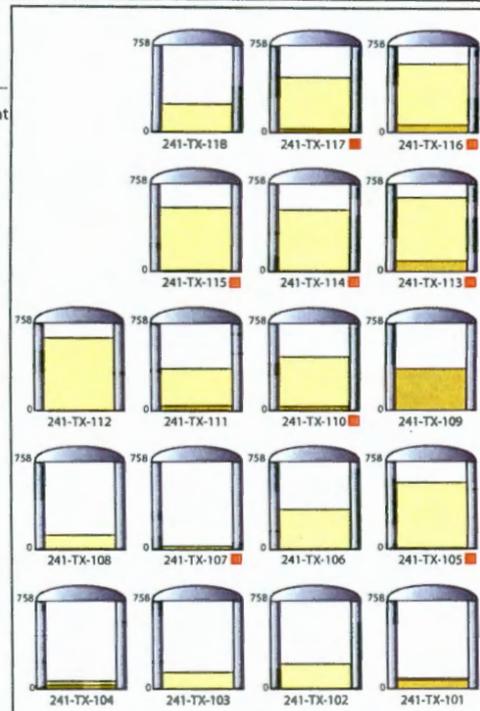

## SX-Tank Farm- 1953-54

15 @ 1,000 Kgal Tank Capacity, Single-Shell  
Kgal


Tank	Sludge	Saltcake	Supernatant
241-SX-101	144	275	0
241-SX-102	55	286	0
241-SX-103	78	431	0
241-SX-104	136	310	0
241-SX-105	63	312	0
241-SX-106	0	396	0
241-SX-107	94	0	0
241-SX-108	74	0	0
241-SX-109	66	175	0
241-SX-110	49	7	0
241-SX-111	98	17	0
241-SX-112	75	0	0
241-SX-113	19	0	0
241-SX-114	126	29	0
241-SX-115	4	0	0

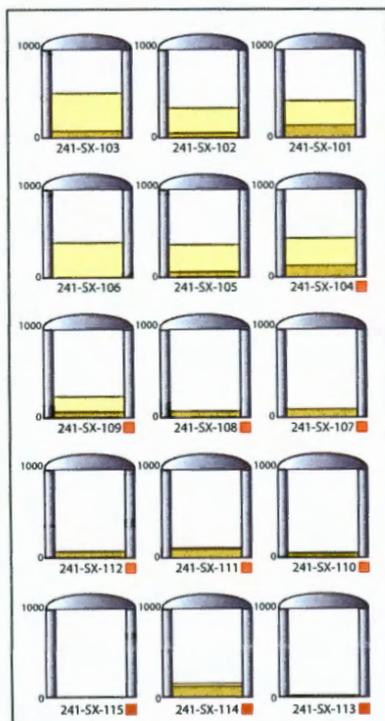

## TY-Tank Farm- 1951-52

6 @ 758 Kgal Tank Capacity, Single-Shell  
Kgal


Tank	Sludge	Saltcake	Supernatant
241-TY-101	72	47	0
241-TY-102	0	69	0
241-TY-103	103	51	0
241-TY-104	43	0	1
241-TY-105	231	0	0
241-TY-106	16	0	0

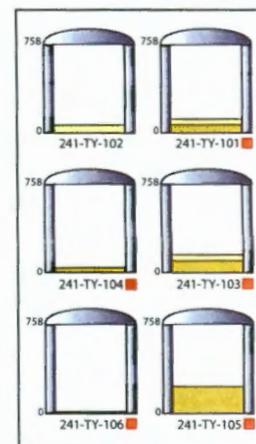

## SY-Tank Farm- 1977

3 @ 1,160 Kgal Tank Capacity, Double-Shell  
Kgal


Tank	Sludge	Saltcake	Supernatant
241-SY-101	0	275	854
241-SY-102	145	0	460
241-SY-103	0	342	395

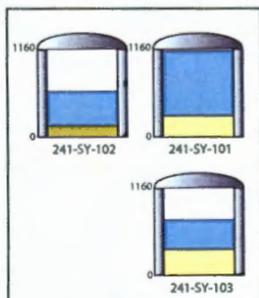

## T-Tank Farm- 1943-44

12 @ 530 Kgal Tank Capacity, Single-Shell  
4 @ 55 Kgal Tank Capacity, Single-Shell  
Kgal


Tank	Sludge	Saltcake	Supernatant
241-T-101	37	62	0
241-T-102	19	0	13
241-T-103	23	0	4
241-T-104	317	0	0
241-T-105	98	0	0
241-T-106	22	0	0
241-T-107	173	0	0
241-T-108	5	11	0
241-T-109	0	62	0
241-T-110	369	0	1
241-T-111	447	0	0
241-T-112	60	0	7
241-T-201	28	0	2
241-T-202	20	0	0
241-T-203	36	0	0
241-T-204	36	0	0

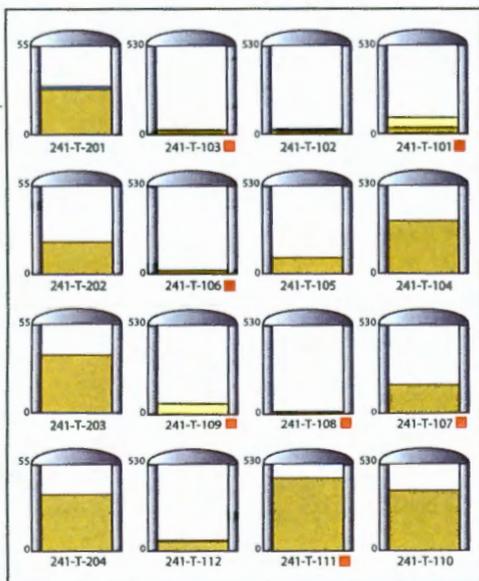

## U-Tank Farm- 1946-49

12 @ 530 Kgal Tank Capacity, Single-Shell  
4 @ 55 Kgal Tank Capacity, Single-Shell  
Kgal

Tank	Sludge	Saltcake	Supernatant
241-U-101	23	0	0
241-U-102	43	283	1
241-U-103	11	405	1
241-U-104	122	0	0
241-U-105	32	321	0
241-U-106	0	168	2
241-U-107	15	279	0
241-U-108	29	405	0
241-U-109	35	366	0
241-U-110	176	0	0
241-U-111	26	196	0
241-U-112	45	0	0
241-U-201	3	0	1
241-U-202	3	0	1
241-U-203	2	0	1
241-U-204	2	0	1

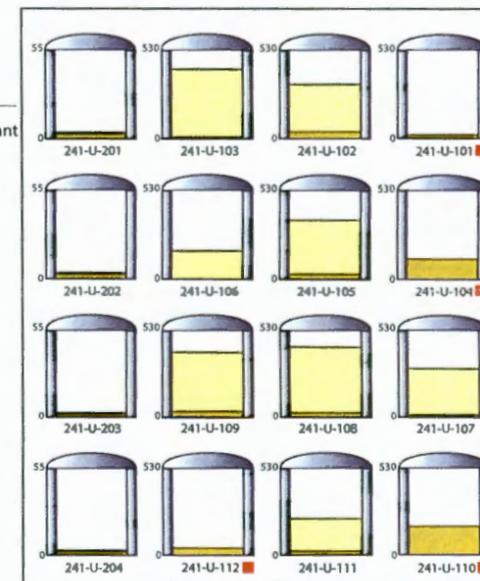

### LEGEND



Sludge Saltcake Supernatant Available Space Assumed/Confirmed Leaker Data Derived From Waste Tank Summary Report Dated 06/30/05

\\APO12\CHARDOCS\All By Staff Member\Nalnimbalkar\Tank Figures\200 West Tank Profile 063005.pdf

Figure A-5

# Hanford Tank Farm Facilities 200 East

**Note:**  
All single-shell tanks were removed from service (not allowed to receive waste) on or before November 21, 1980

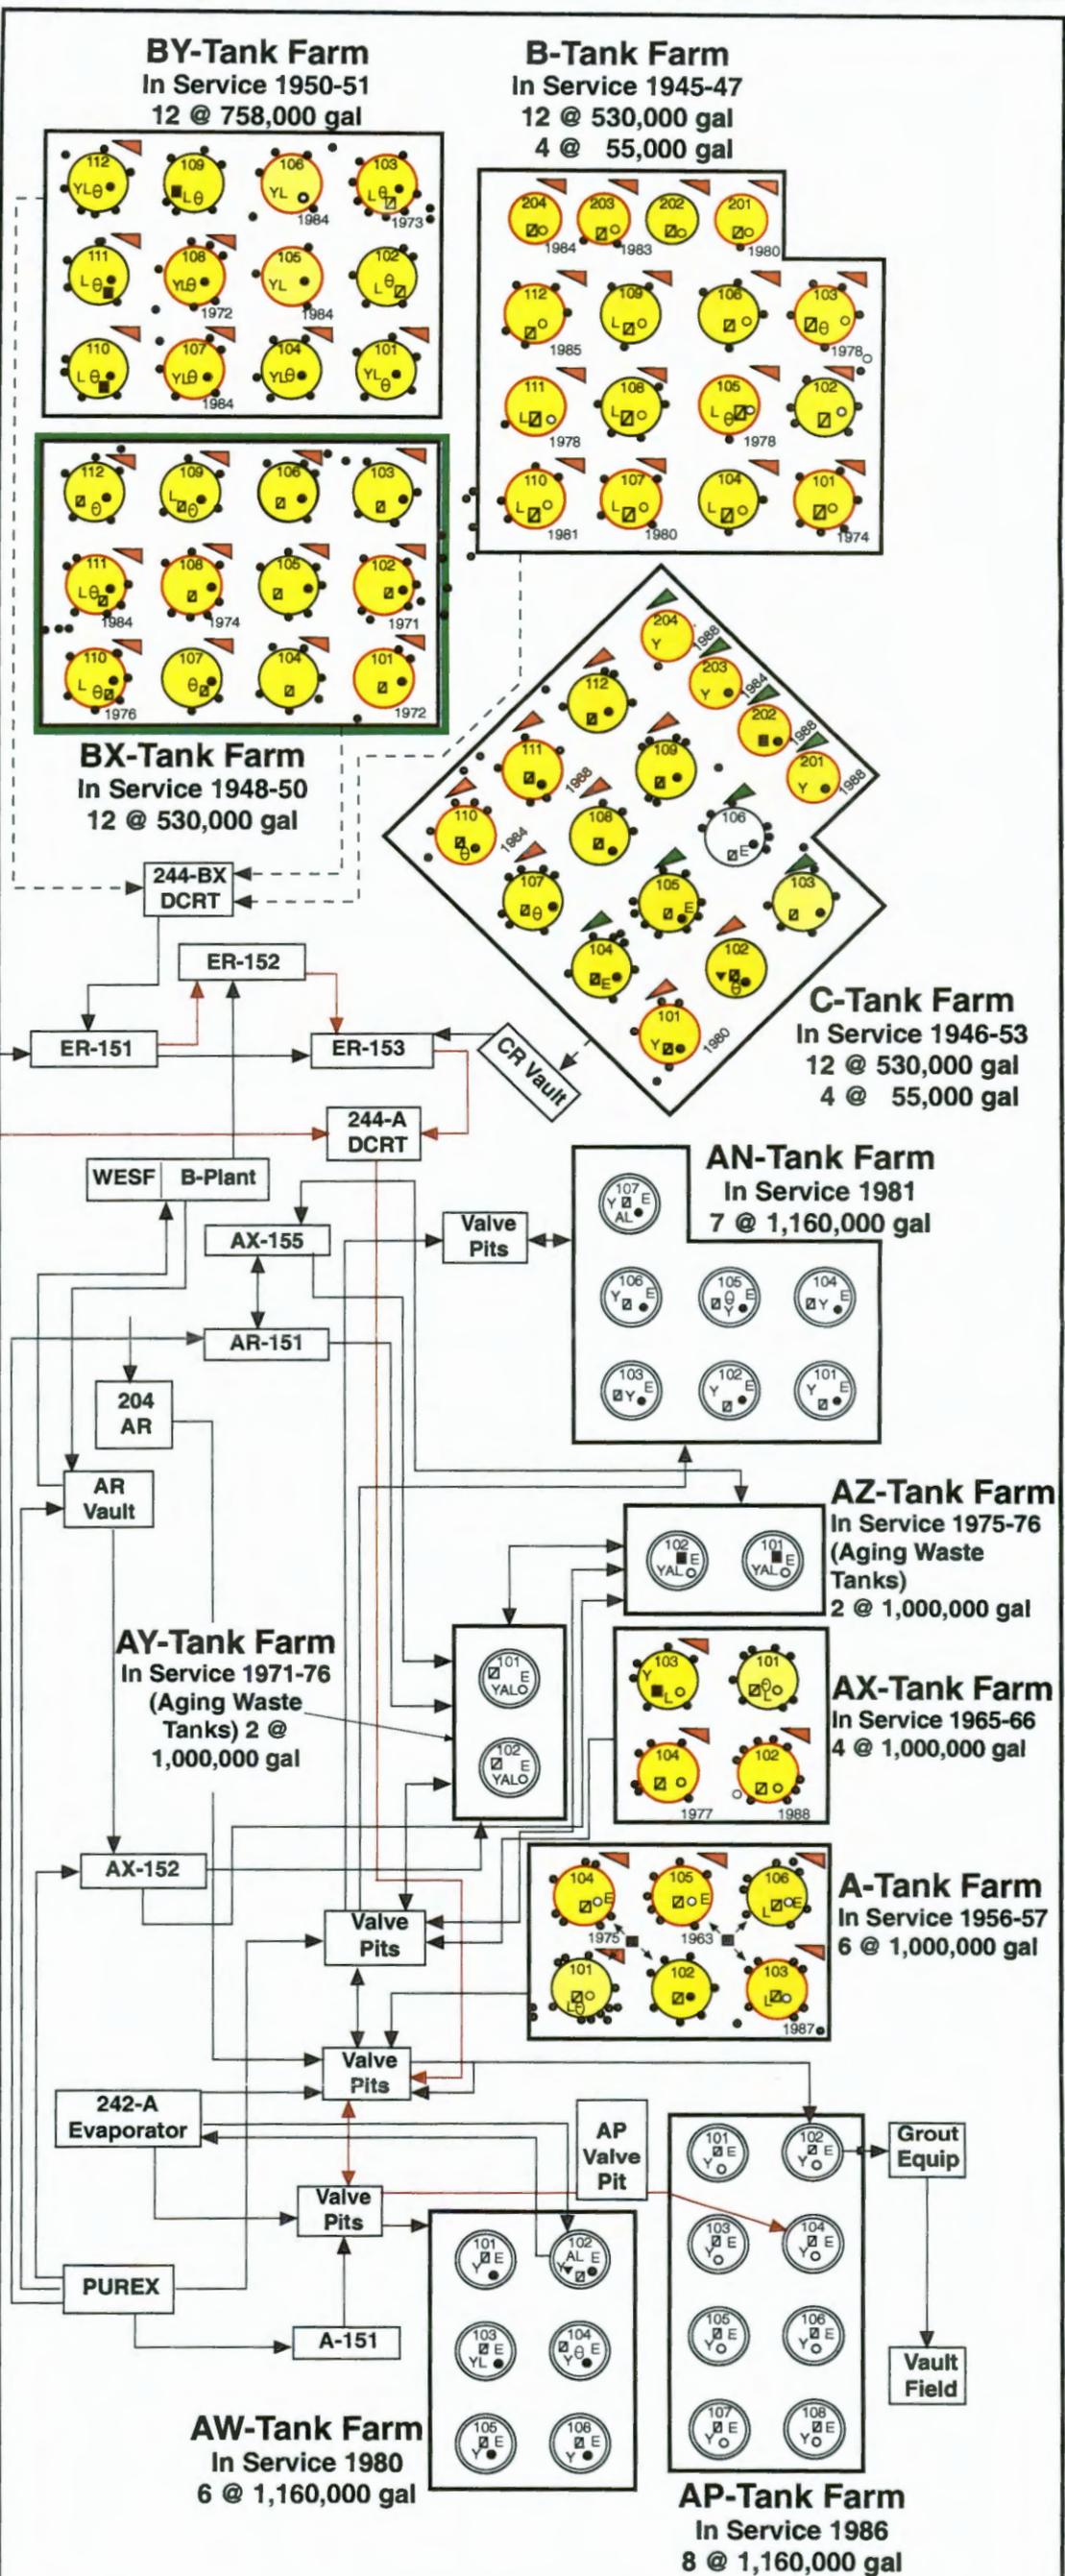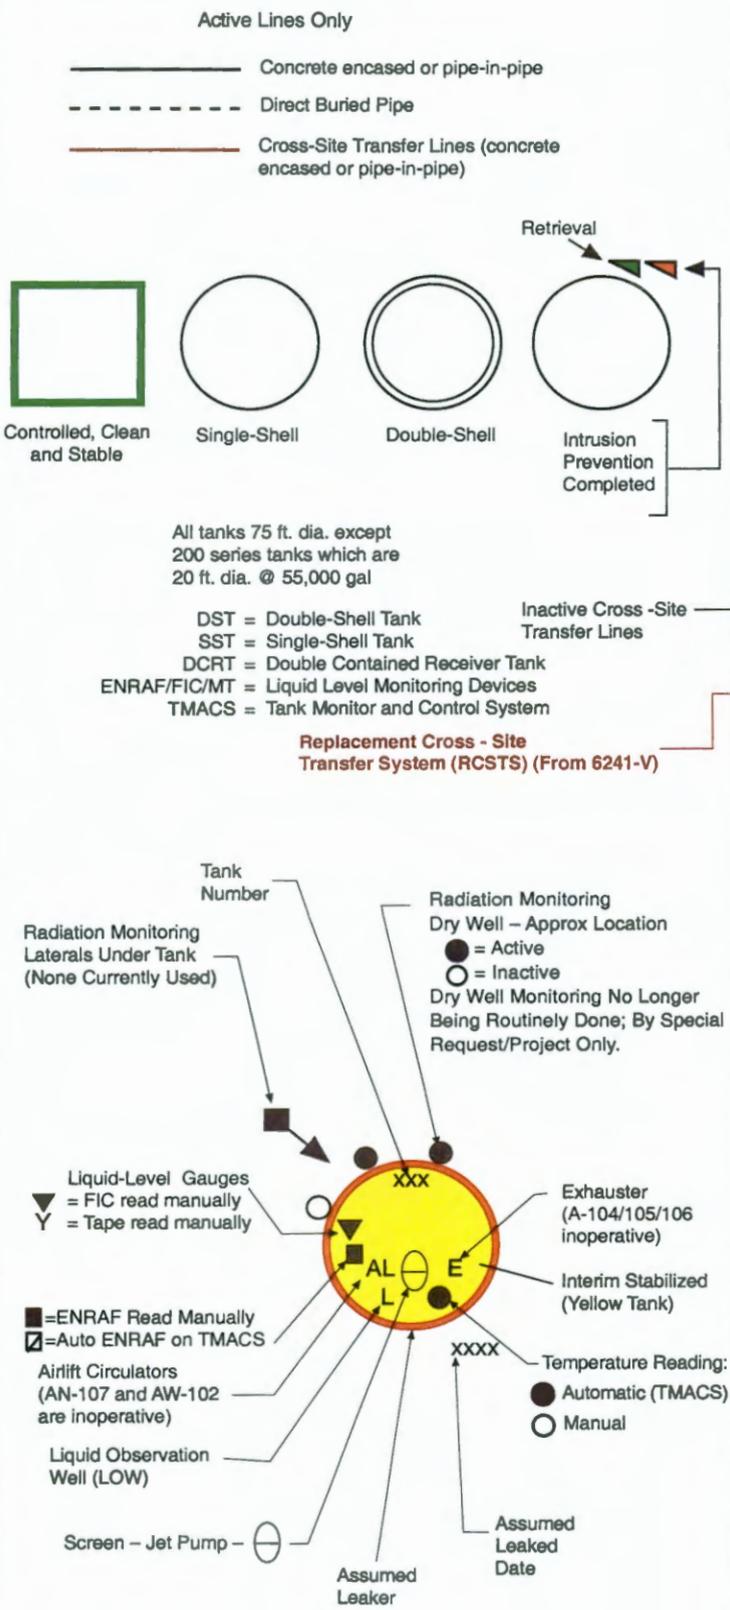

Status as of June 30, 2005  
Updated Quarterly  
Issued by River Protection Project

Figure A-6  
(Schematic)

G05080008.E  
6/30/05

HNF-EP-0182, Rev. 207

A-8/9

# Hanford Tank Farm Facilities 200 West

**Note:**  
All single-shell tanks were removed from service (not allowed to receive waste) on or before November 21, 1980


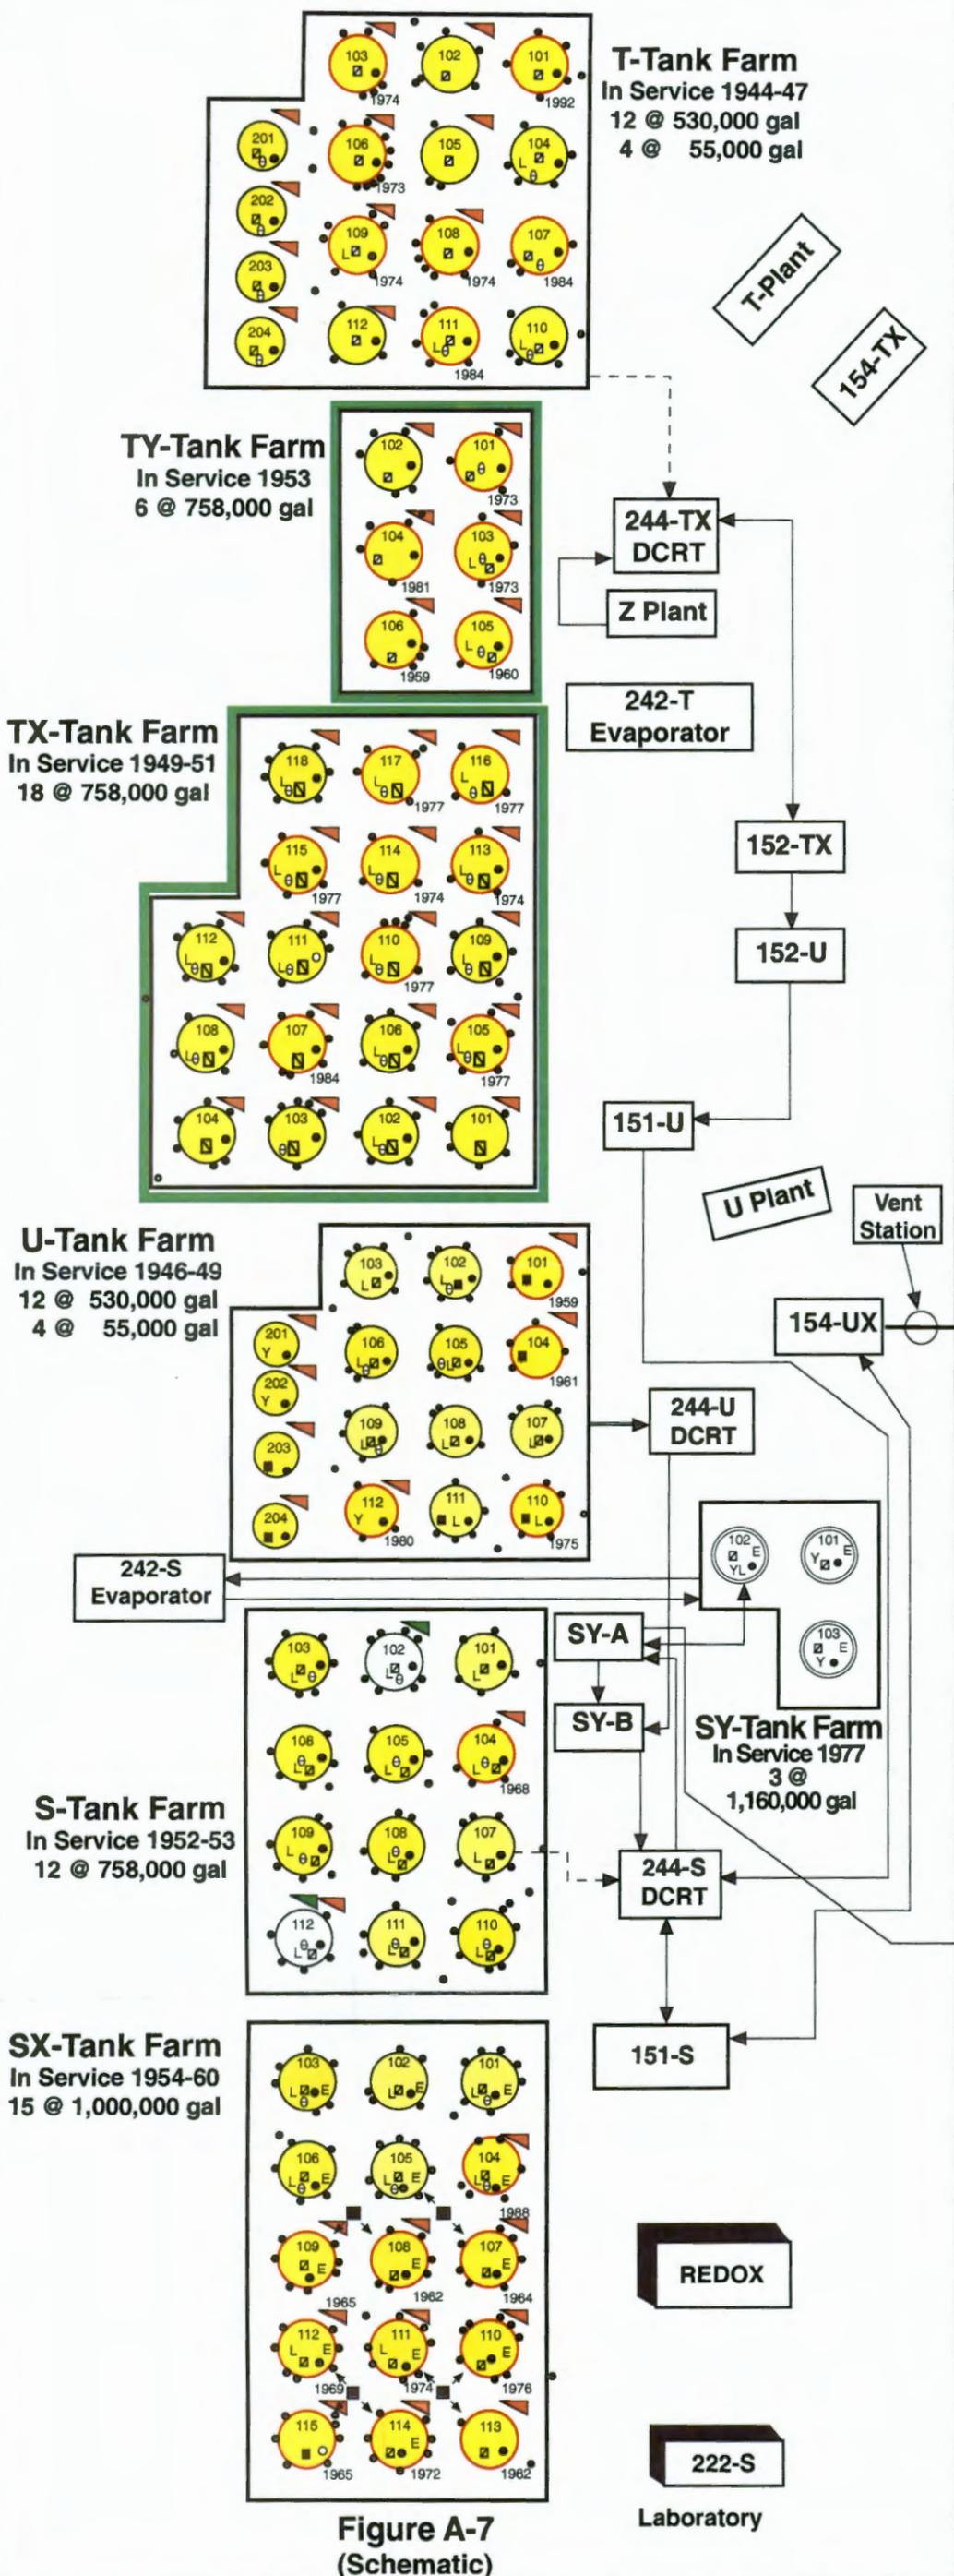


Figure A-7 (Schematic)

Active Lines Only


- Concrete encased or pipe-in-pipe
- - - Direct Buried Pipe
- Cross-Site Transfer Lines (concrete encased or pipe-in-pipe)

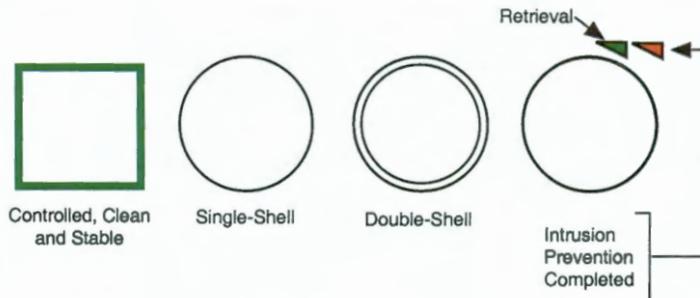

All tanks 75 ft. dia. except 200 series tanks which are 20 ft. dia. @ 55,000 gal

- DST = Double-Shell Tank
- SST = Single-Shell Tank
- DCRT = Double Contained Receiver Tank
- ENRAF/FIC/MT = Liquid Level Monitoring Devices
- TMACS = Tank Monitor and Control System

High Heat Load Tanks = West Area - SX-107/108/109/110/111/112/114

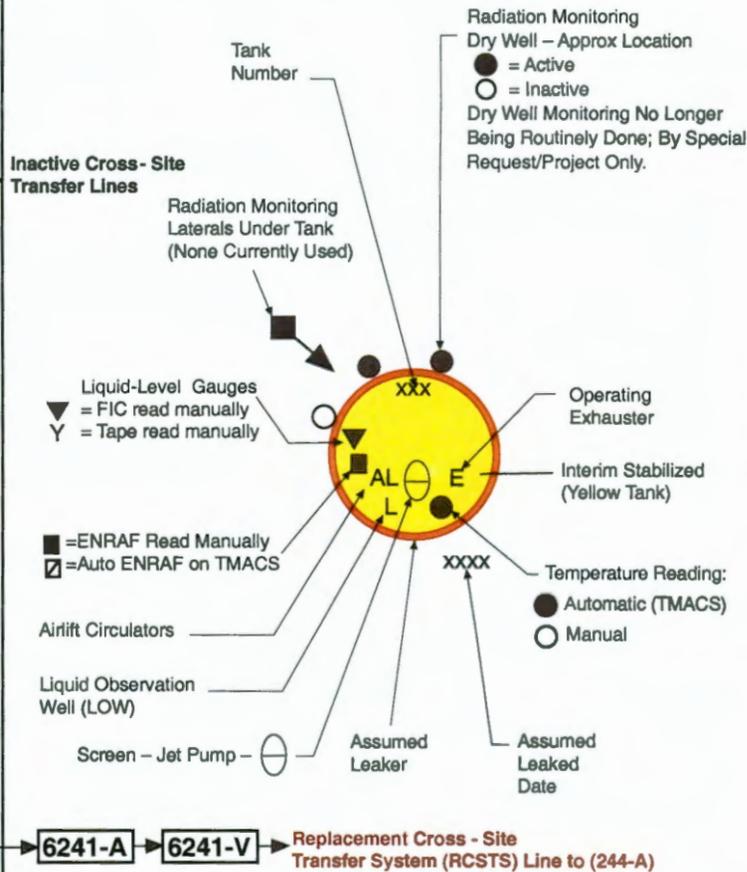

Status as of June 30, 2005  
Updated Quarterly  
Issued by River Protection Project

**DISTRIBUTION LIST**

Number of copies

OFFSITE - USA

2

**Congress of the United States**

U.S. Senate  
717 Hart Senate Building  
Washington D.C. 20510

Senator Ron Wyden

U.S. House of Representatives  
1323 Longworth House Office Building  
Washington D. C. 20515

Congressman Richard "Doc" Hastings, 4th District  
Atten: Jeff Markey

2

**U.S. Department of Energy-Headquarters**

1000 Independence Avenue, SW  
Washington, D. C. 20585

Harry Calley

EM-44 Cloverleaf Bldg.

**U.S. Department of Energy-Headquarters**

19901 Germantown Rd  
Germantown, MD 20874

Kurt Juroff

EM-22 Cloverleaf Bldg.

1

**Washington State Department of Ecology**

Nuclear Waste Program  
3100 Port of Benton Blvd  
Richland, WA 99354-1670

Laura Cusack

1

**Washington State Department of Health**

Radiation Protection  
7171 Cleanwater Lane  
P. O. Box 47827  
Olympia, WA 98504-7827

Allen W. Conklin

1            **Oregon Department of Energy**  
Nuclear Safety Division  
625 Marion St. NE  
Salem, OR 97301

Dirk Dunning, P.E.  
**Do not remove from distribution without permission from ODOE**

1            **MACTEC**  
8310 Centerbrook Place  
Alexandra, VA 22308

Stanley Blacker, Vice President  
**Do not remove from distribution without permission from addressee**

1            **CH2M HILL**  
9191 S. Jamaica St.  
Englewood, CO 80112

Dr. Bob Iotti, President and General Manager  
**Do not remove from distribution without permission from addressee**

**TRI-CITIES:**

2            **Washington State Department of Ecology**  
1315 W. 4<sup>th</sup> Avenue  
Kennewick, WA 99336-6018

Jeff Lyon  
Nancy Uziemblo

1            **Tri-City Herald**  
P.O. Box 2608  
Tri-Cities, WA 99302

John Stang

1            Robert J. Cash  
114 Somerset  
Richland, WA 99352-1966

1            Kenneth A. Gasper  
162 Bradely Blvd  
Richland, WA 99352

1            Richard Welty  
409 S. 41<sup>st</sup> Ave  
W. Richland, WA 99353  
**Do not remove from distribution without permission from addressee**

ONSITE

1	<b><u>S. M. Stoller Corporation</u></b> P. D. Henwood	B2-62
1	<b><u>General Accounting Office</u></b> C. R. Abraham	A1-80
3	<b><u>Washington State Department of Ecology</u></b> B. K. Jentzen L. Fort Library	H0-57 H0-57 H0-57
1	<b><u>U.S. Environmental Protection Agency</u></b> David Bartus	H0-57
10	<b><u>U.S. Department of Energy</u></b>  C. J. Bosted D. C. Bryson M. E. Burandt W. Hewitt (YAHS GS) D. H. Irby D. L. Noyes Wen-Shou Liou R. A. Quintero M. J. Royack Reading Room (P.H. McCormick)	H6-60 H6-60 H6-60 H6-60 H6-60 H6-60 H6-60 H6-60 H6-60 H6-60 H2-53
1	<b><u>Bechtel National, Inc.</u></b> P. J. Brackenbury	H4-02/MS5-L
6	<b><u>CH2M HILL Hanford Group, Inc.</u></b>  K. L. Hennesay A. N. Naiknimbalkar  Central Files 200 East Shift Office WFO Shift Office Environmental Data Mgmt Center	R1-10 R2-12  B1-07 S7-02 S5-15 H6-08