

S

ECN - 10  
DOCUMENT CHANGE REQUEST FORM  
(Direct Revision Only)


<i>Document Number</i>	HNF-EP-0182	<i>Rev.</i>	188
<i>Electronic File Name (Optional):</i>	HNF-EP-0182-188.doc		
<i>Document Title</i>	Waste Tank Summary Report for Month Ending November 30, 2003		
<i>Change Description</i>	Complete revision of HNF-EP-0182, Waste Tank Summary Report  Tables and text updated to reflect status as of November 30, 2003		
<i>Change Justification</i>	DOE-ORP requires this document to revised and issued monthly		

**Approvals:**

<i>Author (Print/Sign)</i> B. M. Hanlon <i>B.M. Hanlon</i>	<i>Date:</i> 12/23/03
<i>Responsible Manager (Print/Sign)</i> N. W. Kirch <i>NW Kirch</i>	<i>Date:</i> 1/14/04 <sup>nwk</sup>
<i>Reviewer (Optional, Print/Sign)</i> M. A. Knight <i>M.A. Knight</i>	<i>Date:</i> 1/15/04

**Distribution**

Name	MSIN	Name	MSIN
Distribution list follows doc.			

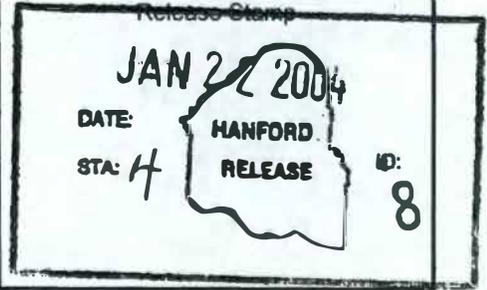

*Italicized text items need to be addressed. Standard text items need to be addressed as applicable to the condition/issue described.*

# Waste Tank Summary Report for Month Ending NOVEMBER 30, 2003

RECEIVED  
FEB 04 2004  
EDMC

Prepared for the U.S. Department of Energy  
Assistant Secretary for Environmental Management

**CH2MHILL**  
*Hanford Group, Inc.*

Richland, Washington

Contractor for the U.S. Department of Energy  
Office of River Protection under Contract DE-AC27-99RL14047

Approved for Public Release; Further Dissemination Unlimited

**LEGAL DISCLAIMER** \_\_\_\_\_

This report was prepared as an account of work sponsored by an agency of the United States Government. Neither the United States Government nor any agency thereof, nor any of their employees, nor any of their contractors, subcontractors or their employees, makes any warranty, express or implied, or assumes any legal liability or responsibility for the accuracy, completeness, or any third party's use or the results of such use of any information, apparatus, product, or process disclosed, or represents that its use would not infringe privately owned rights. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof or its contractors or subcontractors. The views and opinions of authors expressed herein do not necessarily state or reflect those of the United States Government or any agency thereof.

This report has been reproduced from the best available copy.

Printed in the United States of America

# WASTE TANK SUMMARY REPORT FOR MONTH ENDING NOVEMBER 30, 2003

BM HANLON

CH2M HILL Hanford Group, Inc.

Richland, WA 99352

U.S. Department of Energy Contract DE-AC27-99RL14047

EDT/ECN: ~~ECN-729-005-RT~~ UC: *AA 9.22.03*

Cost Center: Charge Code:

B&R Code: Total Pages: 44

Key Words: REPORT, WASTE TANK SUMMARY


Abstract: See page iii of document

TRADEMARK DISCLAIMER. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof or its contractors or subcontractors.

Printed in the United States of America. To obtain copies of this document, contact: Document Control Services, P.O. Box 950, Mailstop H6-08, Richland WA 99352. Phone (509) 372-2420; Fax (509) 376-4989.

  
Release Approval

*1/14/04*  
Date

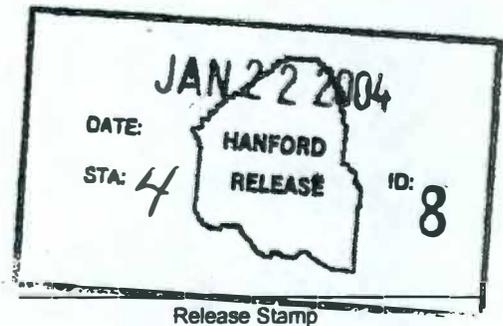

Approved For Public Release



# **Waste Tank Summary Report for Month Ending NOVEMBER 30, 2003**

**Prepared for the U.S. Department of Energy  
Assistant Secretary for Environmental Management**

**CH2MHILL**  
*Hanford Group, Inc.*

**Richland, Washington**

**Contractor for the U.S. Department of Energy  
Office of River Protection under Contract DE-AC27-99RL14047**

**Approved for Public Release; Further Dissemination Unlimited**

**LEGAL DISCLAIMER**

This report was prepared as an account of work sponsored by an agency of the United States Government. Neither the United States Government nor any agency thereof, nor any of their employees, nor any of their contractors, subcontractors or their employees, makes any warranty, express or implied, or assumes any legal liability or responsibility for the accuracy, completeness, or any third party's use or the results of such use of any information, apparatus, product, or process disclosed, or represents that its use would not infringe privately owned rights. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof or its contractors or subcontractors. The views and opinions of authors expressed herein do not necessarily state or reflect those of the United States Government or any agency thereof.

This report has been reproduced from the best available copy.

Printed in the United States of America

# **Waste Tank Summary Report for Month Ending NOVEMBER 30, 2003**

B. M. Hanlon  
CH2M HILL Hanford Group, Inc.

Date Published  
January 2004

Prepared for the U.S. Department of Energy  
Assistant Secretary for Environmental Management

**CH2MHILL**  
*Hanford Group, Inc.*

Richland, Washington

Contractor for the U.S. Department of Energy  
Office of River Protection under Contract DE-AC27-99RL14047

Approved for Public Release; Further Dissemination Unlimited

**This page intentionally left blank.**

**CONTENTS**

1.0	PURPOSE AND SCOPE.....	9
2.0	WASTE TANK STATUS .....	10
2.1	Waste Tank Status <b>Highlights</b> .....	10
	Table 2-1. Single-Shell Tanks Saltwell Pumping .....	11
	Table 2-2. Single-Shell Tanks In Evaluation for Interim Stabilization.....	11
	Table 2-3. Single-Shell Tanks in Retrieval and Closure.....	11
3.0	DOUBLE-SHELL TANKS MONTHLY SUMMARY TABLES .....	12
	Table 3-1. Inventory and Status by Tank - Double-Shell Tanks.....	12
	Table 3-2. Double-Shell Tank Space Allocation, Inventory, and Waste Receipts.....	13
4.0	SINGLE-SHELL TANKS MONTHLY SUMMARY TABLES .....	14
	Table 4-1. Inventory and Status by Tank - Single-Shell Tanks .....	14
	Table 4-2. Single-Shell Tanks Interim Stabilization Status .....	18
	Table 4-3. Single-Shell Tanks Interim Stabilization Milestones .....	22
	Table 4-4. Single-Shell Tanks Leak Volume Estimates .....	24
5.0	MISCELLANEOUS UNDERGROUND STORAGE TANKS AND SPECIAL SURVEILLANCE FACILITIES .....	30
	Table 5-1. East and West Area Miscellaneous Underground Storage Tanks and Special Surveillance Facilities .....	30
	Table 5-2. East Area Inactive Miscellaneous Underground Storage Tanks and Special Surveillance Facilities .....	31
	Table 5-3. West Area Inactive Miscellaneous Underground Storage Tanks and Special Surveillance Facilities .....	32

**APPENDICES**

APPENDIX A - TANK CONFIGURATION AND FACILITIES CHARTS.....	A-1
Figure A-1. High Level Waste Tank Configuration .....	A-1
Figure A-2. Double-Shell Tank Instrumentation Configuration.....	A-2
Figure A-3. Single-Shell Tank Instrumentation Configuration .....	A-3

**ACRONYMS**

BBI	Best Basis Inventory
CCS	Controlled, Clean, and Stable (tank farms)
CH2M HILL	CH2M HILL Hanford Group, Inc.
DCRT	Double-Contained Receiver Tank
DIL	Drainable Interstitial Liquid
DLR	Drainable Liquid Remaining
DST	Double-Shell Tank
FSAR	Final Safety Analysis Report effective October 18, 1999
Gal	Gallon
GPM	Gallons Per Minute
II	Interim Isolated
ILL	Interstitial Liquid
IP	Intrusion Prevention Completed
Kgal	Kilogallons
IS	Interim Stabilized
MT/FIC/ ENRAF	Manual Tape, Food Instrument Corporation, ENRAF Corporation (surface level measurement devices)
OSD	Operating Specifications Document
PI	Partial Interim Isolated
PER	Problem Evaluation Request
PFP	Plutonium Finishing Plant
SHMS	Standard Hydrogen Monitoring System
SST	Single-Shell Tank
SWL	Salt Well Liquid
TFXR	Tank Transfer Database
TMACS	Tank Monitor and Control System
TPA	Hanford Federal Facility Consent and Compliance Order, "Washington State Department of Ecology, U.S. Environmental Protection Agency, and U.S. Department of Energy," as amended (Tri-Party Agreement)
TSR	Technical Safety Requirement
TWINS	Tank Waste Information Network System
USQ	Unreviewed Safety Question

## GLOSSARY

### General

Characterization - Characterization is understanding the Hanford tank waste chemical, physical, and radiological properties to the extent necessary to ensure safe storage and interim operation, and ultimate disposition of the waste.

Drainable Interstitial Liquid (DIL) - Drainable Interstitial Liquid is calculated based on saltcake and sludge volumes, calculated porosity values. Interstitial liquid is the liquid that fills the interstitial spaces of the solids waste. The sum of the interstitial liquid contained in saltcake and sludge minus an adjustment for capillary height is the initial volume of DIL. Interstitial liquid that is not held in place by capillary forces will, therefore, migrate or move with gravity.

Drainable Liquid Remaining (DLR) - The total Drainable Liquid Remaining is the sum of drainable interstitial liquid and supernatant.

Supernatant Liquid - The liquid above the solids or in large liquid pools covered by floating solids in waste storage tanks.

Total Waste - For purposes of this document, solids volume (sludge and saltcake including liquids) plus supernatant liquid.

Waste Tank Safety Issue - A potentially unsafe condition in the handling of waste material in underground storage tanks that requires corrective action to reduce or eliminate the unsafe condition. There are currently no waste tank safety issues.

### Interim Stabilization (Single-Shell Tanks only)

Interim Stabilized (IS) - A tank which contains less than 50 Kgallons of drainable interstitial liquid and less than 5 Kgallons of supernatant. If the tank was jet pumped to achieve interim stabilization, then the jet pump flow or saltwell screen inflow must also have been at or below 0.05 gpm before interim stabilization criteria are met.

Jet Pump - The centrifugal pump and jet assembly are needed to pump the interstitial liquid from the saltwell screen into the pump pit, nominally a 40-foot elevation rise. Pumping rates vary from 0.05 to about 4 gpm.

Saltwell Screen - The saltwell system is a 10-inch diameter saltwell casing consisting of a stainless steel saltwell screen welded to a Schedule 40 carbon steel pipe. The casing and screen are to be inserted into the 12-inch tank riser located in the pump pit. The stainless steel screen portion of the system will extend through the tank waste to near the bottom of the tank.

### Intrusion Prevention (Isolation)-(Single-Shell Tanks only)

Closure (C) - Final closure of the operable units (tank farms) shall be defined as regulatory approval of completion of closure actions and commencement of post-closure actions. For the purposes of this agreement (Hanford Federal Facility Agreement and Consent Order Change Control Form, Change Number M-45-02-03), all units located within the boundary of each tank farm will be closed in accordance with Washington Administrative Code 173-303-610.

Controlled, Clean, and Stable (CCS) - Controlled, Clean, and Stable reflects the completion of several objectives: "Controlled" - provide remote monitoring for required instrumentation and implement controls required in the TWRS Authorization Basis; "Clean" - remove surface soil contamination and downpost the Tank Farms to specific radiological control status, remove abandoned equipment, and place reusable

equipment in compliant storage; and "Stable" - remove pumpable liquids from the SSTs and IMUSTs and isolate the tanks.

Interim Isolated (II) - The administrative designation reflecting the completion of the physical effort required to minimize the addition of liquids into an inactive storage tank, process vault, sump, catch tank, or diversion box. In June 1993 the term "Interim Isolation" was replaced by "Intrusion Prevention."

Intrusion Prevention (IP) - Intrusion Prevention is the administrative designation reflecting the completion of the physical effort required to minimize the addition of liquids into an inactive storage tank, process vault, sump, catch tank, or diversion box. Under no circumstances are electrical or instrumentation devices disconnected or disabled during the intrusion prevention process (with the exception of the electrical pump).

Partially Interim Isolated (PI) - The administrative designation reflecting the completion of the physical effort required for Interim Isolation except for isolation of risers and piping that is required for jet pumping or for other methods of stabilization.

Retrieval (R) - The process of removing, to the maximum extent practical, all the waste from a given underground storage tank. The retrieval process is selected specific to each tank and accounts for the waste type stored and the access and support systems available. Generally, retrieval is focused on removal of solids from the tank.

## **Tank Integrity**

Assumed Leaker - The integrity classification of a waste storage tank for which surveillance data indicate a loss of liquid attributed to a breach of integrity.

Assumed Re-Leaker - A condition that exists after a tank has been declared as an "assumed leaker" and then the surveillance data indicate a new loss of liquid attributed to a breach of integrity.

Sound - The integrity classification of a waste storage tank for which surveillance data indicate no loss of liquid attributed to a breach of integrity.

## **Surveillance Instrumentation**

Annulus - The annulus is the space between the inner and outer shells on DSTs only. Drain channels in the insulating and/or supporting concrete carry any leakage to the annulus space where conductivity probes are installed. The annulus conductivity probes and radiation detectors are the primary means of leak detection for all DSTs.

Automatic FIC - An automatic waste surface level measurement device is manufactured by the Food Instrument Corporation (FIC). The instrument consists of a conductivity electrode (plummet) connected to a calibrated steel tape, a steel tape reel housing and a controller that automatically raises and lowers the plummet to obtain a waste surface level reading. All FIC gauges are read manually. FICs are being replaced by ENRAF detectors (see below).

Drywells - Historically, the drywells were monitored with gross logging tools as part of a secondary leak monitoring system. In some cases, neutron-moisture sensors were used to monitor moisture in the soil as a function of well depth, which could be indicative of tank leakage. The routine gross gamma logging data were stored electronically from 1974 through 1994; a program was initiated in 1995 to log each of the available drywells in each tank farm with a spectral gamma logging system. The spectral gamma logging system provides quantitative values for gamma-emitting radionuclides. The baseline spectral gamma logging database is available electronically.

Spectral drywell scans can be run by special request. A select subset of drywells is routinely monitored by the Vadose Zone Characterization Project to assess movement of gamma-emitting radionuclides in the subsurface.

ENRAF 854 ATG Level Detector - FICs and some manual tapes are in the process of being replaced by the ENRAF ATG 854 level detector. The ENRAF gauge, fabricated by ENRAF Incorporated, determines waste level by detecting variations in the weight of a displacer suspended in the tank waste. ENRAFs and future installations will transmit digital level data to TMACS via an ENRAF Computer Interface Unit (CIU). The CIU allows fully remote communication with the gauge, minimizing tank farm entry.

Laterals - Laterals are horizontal drywells positioned 8 to 10 feet under single-shell waste storage tanks, 3 per tank, to detect radionuclides in the soil which could be indicative of tank leakage. These drywells can be monitored by radiation detection probes. Laterals are located only in A and SX farms. There are currently no functioning laterals and no plan to prepare them for use.

Liquid Observation Well (LOW) - In-tank liquid observation wells are used for monitoring the ILL in single-shell tanks. The wells are usually constructed of fiberglass or TEFZEL-reinforced epoxy-polyester resin (TEFZEL is a trademark of E. I. du Pont de Nemours & Company). A few LOWs constructed of steel. Gamma and neutron probes are used to monitor changes in the ILL, and can indicate intrusions or leakage by increases or decreases in the ILL. There are 70 LOWs installed in SSTs that contain or are capable of containing greater than 50 Kgallons of drainable interstitial liquid. All of the LOWs are monitored weekly with the exception of TX-108 which is monitored by request only. Two LOWs installed in DSTs SY-102 and AW-103 are used for special, rather than routine, surveillance purposes only.

Surface Levels - The surface level measurements in all waste storage tanks are monitored by manual or automatic conductivity probes, and recorded and transmitted or entered into the Surveillance Analysis Computer System.

Thermocouple (TC) - A thermocouple is a thermoelectric device used to measure temperature. More than one thermocouple element on a device (probe) is called a thermocouple tree.

**METRIC CONVERSION CHART**

<b>METRIC CONVERSION CHART</b>		
<b>1 inch</b>	<b>=</b>	<b>2.54 centimeters</b>
<b>1 foot</b>	<b>=</b>	<b>30.48 centimeters</b>
<b>1 gallon</b>	<b>=</b>	<b>3.79 liters</b>
<b>1 ton</b>	<b>=</b>	<b>0.91 metric tons</b>
$^{\circ}\text{F} = \left(\frac{9}{5}^{\circ}\text{C}\right) + 32$		
<b>1 Btu/h = 0.2931 watts (International Table)</b>		

## **1.0 PURPOSE AND SCOPE**

This report is the official inventory for radioactive waste stored in underground tanks in the 200 Areas at the Hanford Site. Data that depict the status of stored radioactive waste and tank vessel integrity are contained within the report. This report provides data on each of the existing 177 large underground waste storage tanks and 60 smaller miscellaneous underground storage tanks and special surveillance facilities, and supplemental information regarding tank surveillance anomalies and ongoing investigations. This report is intended to meet the requirement of U.S. Department of Energy Order 435.1 (DOE-HQ, August 28, 2001, Radioactive Waste Management, U.S. Department of Energy-Washington, D.C.) requiring the reporting of waste inventories and space utilization for the Hanford Site Tank Farm tanks.

## 2.0 WASTE TANK STATUS

Note: Changes from the previous month are in **bold print**.

Double-Shell Tanks (DST)	28 double-shell	10/86 - date last DST tank was completed
Single-Shell Tanks (SST)	149 single-shell	1966 - date last SST tank was completed
Assumed Leaker Tanks	67 single-shell	07/93 - date last Assumed Leaker was identified
Sound Tanks	28 double-shell 82 single-shell	1986 - date DSTs determined sound 07/93 - date last SST determined Sound
Interim Stabilized Tanks <sup>a</sup> (IS)	<b>142 single-shell</b>	<b>11/03 - date last IS occurred</b>
Not Interim Stabilized <sup>b</sup>	<b>7 single-shell</b>	Tanks not Interim Stabilized
Isolated-Intrusion Prevention Completed (IP) <sup>c</sup>	99 single-shell	09/96 - date last IP occurred
Retrieval <sup>c</sup>	9 single-shell	10/02 - date effective
Misc. Underground Storage Tanks (MUST) and Special Surveillance Facilities (Active)	10 Tanks East Area 7 Tanks West Area	03/01 - last date a tank was added or removed from MUST list
Misc. Underground Storage Tanks (IMUST) and Special Surveillance Facilities (Inactive) <sup>d</sup>	18 Tanks East Area 25 Tanks West Area	11/01 - last date a tank was added or removed from IMUST list

## Footnotes:

<sup>a</sup> Of the 142 tanks classified as Interim Stabilized, 65 are listed as Assumed Leakers. Tanks AX-101, S-107, SX-102, and U-107 are being evaluated to confirm their Interim Stabilization status. As of November 10, 2003, Tank A-101 is in evaluation to confirm that it has met the Interim Stabilization criteria.

<sup>b</sup> Tank BY-106 is an Assumed Leaker. (See Table 4.1) The total of 7 tanks not Interim Stabilized includes 6 tanks (BY-106, S-101, S-102, S-111, S-112, and U-108) covered by the Consent Decree which have not been Interim Stabilized (S-102 and S-112 are in the Retrieval process); and C-106, which is not included in the Consent Decree and which is not Interim Stabilized but is being pumped for Retrieval.

<sup>c</sup> Tank status for C-104, C-201, C-202, C-203, C-204, S-102, S-103, S-105 and S-106 was changed from Isolated-Intrusion Prevention Completed (IP) to "Retrieval," effective October 2002. Tank status for C-103, C-105, C-106, and S-112 was changed to "Retrieval" in October 2003.

<sup>d</sup> Tables 5-2 and 5-3, the Inactive Miscellaneous Underground Storage Tanks (IMUST) now reflect only those tanks managed by CH2M HILL Hanford Group, Inc. (CH2M HILL).

## 2.1 WASTE TANK STATUS HIGHLIGHTS

Table 2-1. Single-Shell Tanks Saltwell Pumping (all pumping in Kgallons)

Tank Number	Pumping Began	Initial Estimated Pumpable Liquid (HNF-2978, Rev. 5)	Pumped this Month	Total Pumped
241-BY-106	July 11, 2001	86	4	94
241-S-101	July 27, 2002	82	0	68
241-S-111	December 18, 2002	109	1	99
241-U-108	December 2, 2001	113	0	112

Table 2-2. Single-Shell Tanks In Evaluation for Interim Stabilization

Tank Number	Placed in Evaluation to Document Completion of Pumping and Satisfaction of Interim Stabilization Criteria
241-A-101	November 10, 2003
241-AX-101	June 2, 2003
241-S-107	August 20, 2003
241-SX-102	August 28, 2003
241-U-107	October 7, 2003

Table 2-3. Single-Shell Tanks in Retrieval and Closure

Tank Number	Status
241-C-103	Status changed from "PI" to "Retrieval"
241-C-104	In preparation for retrieval
241-C-105	Status changed from "PI" to "Retrieval"
241-C-106	Being pumped
241-C-200 series	In preparation for retrieval
241-S-102	In preparation for retrieval
241-S-103	In retrieval status
241-S-105	In retrieval status
241-S-106	In preparation for retrieval
241-S-112	Being pumped

## 3.0 DOUBLE-SHELL TANKS MONTHLY SUMMARY TABLES

Table 3-1. Inventory and Status by Tanks - Double-Shell Tanks.

All volume data obtained from Tank Waste Information Network System (TWINS)								
Tank	Tank Integrity	Tank Level (inches)	Total Waste (Kgal)	Available Space (Kgal)	Waste Volumes			Solids Volume Update
					Supernatant Liquid (Kgal)	Sludge (Kgal)	Saltcake (Kgal)	
<b>241-AN TANK FARM STATUS</b>								
AN-101	SOUND	349	960	184	960	0	0	06/30/99
AN-102	SOUND	391	1075	69	941	0	134	12/31/02
AN-103	SOUND	349	959	185	500	0	459	06/30/99
AN-104	SOUND	383	1053	91	608	0	445	06/30/99
AN-105	SOUND	410	1127	17	589	0	538	01/31/03
AN-106	SOUND	224	617	527	600	0	17	06/30/99
AN-107	SOUND	401	1104	40	869	0	235	09/30/03
7 TANKS - TOTAL			6895	1113	5067	0	1828	
<b>241-AP TANK FARM STATUS</b>								
AP-101	SOUND	404	1111	33	1111	0	0	05/01/89
AP-102	SOUND	100	276	868	253	23	0	05/31/02
AP-103	SOUND	325	895	249	895	0	0	05/31/96
AP-104	SOUND	401	1102	42	1102	0	0	10/13/88
AP-105	SOUND	211	580	564	491	0	89	06/30/99
AP-106	SOUND	414	1138	6	1138	0	0	10/13/88
AP-107	SOUND	412	1133	11	1133	0	0	10/13/88
AP-108	SOUND	70	192	952	192	0	0	10/13/88
8 TANKS - TOTAL			6427	2725	6315	23	89	
<b>241-AW TANK FARM STATUS</b>								
AW-101	SOUND	409	1126	18	730	0	396	01/31/03
AW-102	SOUND	384	1056	69	1026	30	0	01/31/01
AW-103	SOUND	400	1100	44	787	273	40	06/30/99
AW-104	SOUND	391	1075	69	852	66	157	06/30/99
AW-105	SOUND	153	422	722	159	263	0	06/30/99
AW-106	SOUND	404	1110	34	871	0	239	06/30/99
6 TANKS - TOTAL			5889	956	4425	632	832	
<b>241-AY TANK FARM STATUS</b>								
AY-101	SOUND	65	178	823	82	96	0	06/30/99
AY-102	SOUND	302	830	171	660	170	0	09/30/03
2 TANKS - TOTAL			1008	994	742	266	0	
<b>241-AZ TANK FARM STATUS</b>								
AZ-101	SOUND	344	946	55	894	52	0	06/30/98
AZ-102	SOUND	358	984	17	879	105	0	06/30/99
2 TANKS - TOTAL			1930	72	1773	157		
<b>241-SY TANK FARM STATUS</b>								
SY-101	SOUND	135	372	772	97	0	275	06/30/99
SY-102	SOUND	253	695	463	550	145	0	09/30/03
SY-103	SOUND	268	738	406	396	0	342	06/30/99
3 TANKS - TOTAL			1805	1641	1043	145	617	

Notes: 1 Kgal differences are the result of computer rounding  
 Supernatant + Sludge (includes liquid) + Saltcake (includes liquid) = Total Waste  
 Available Space Volumes include restricted space  
 SY-102 - Maximum operating liquid level increased to 1,157,750 gallons effective 7/23/03,  
 Process Memo #2E-03-025

Table 3-2. Double-Shell Tank Space Allocation, Inventory and Waste Receipts (all volumes in Kgallons)

<b>TOTAL DST CAPACITY</b>		<b>TOTAL DST WASTE INVENTORY</b>			
(*)TOTAL=	31,455	INVENTORY ON 11/30/03			23,954
		INVENTORY ON 10/31/03			23,648
		CHANGE =			306

ALLOCATION OF REMAINING DST SPACE	
(*)TOTAL DST CAPACITY =	31,455
WASTE INVENTORY =	-23,954
(**) DEDICATED OPERATIONAL SPACE =	-2,000
(***) RESTRICTED USAGE SPACE =	-2,011
(****) EMERGENCY SPACE ALLOCATION =	-1,200
REMAINING AVAILABLE SPACE =	2,290

(\*) SY-102 maximum operating limit increased to 1,158 kgal on July 23, 2003 per Process Memo #2E-03-029.  
(\*\*) Dedicated Operational Space is assumed to equal 2 Mgal for SST retrieval, cross-site transfer receiver, and evaporator feed and slurry.  
(\*\*\*) Restricted Usage Space in accordance with 00-ORP-79/0003897 (9/8/00)  
(\*\*\*\*) Emergency Space Allocation adjusted in July 2003 per HNF-3484 Rev. 4, includes space for WTP returns.

NOVEMBER DST WASTE RECEIPTS					
FACILITY GENERATIONS		OTHER GAINS ASSOCIATED WITH		OTHER LOSSES ASSOCIATED WITH	
SALTWELL LIQUID (WEST)	0	SLURRY	0	SLURRY	7
SALTWELL LIQUID (EAST)	0	CONDENSATE	7	CONDENSATE	12
TANK FARMS	42	INSTRUMENTATION	0	INSTRUMENTATION	0
242-A	0	MISCELLANEOUS GAINS	2	MISCELLANEOUS LOSSES	8
C-106	0				
S-112	282				
<b>TOTAL =</b>	<b>324</b>	<b>TOTAL =</b>	<b>9</b>	<b>TOTAL =</b>	<b>27</b>

WASTE RECEIPT AND EVAPORATOR METRIC					
DATE	DST WASTE RECEIPTS	MISC. DST CHANGES (+/-)	WVR (1)	NET DST CHANGE	TOTAL DST VOLUME
10/03	324	-18	0	306	23,954

(1) WVR is total (before flush) waste volume reduction for 242-A Evaporator

IMPLEMENTATION OF DST SPACE OPTIONS METRIC (TPA MILESTONE M-46-21)			
DATE	INITIATIVES	GAINS TO DATE (1)	GAINS DURING MONTH
10/03	INCREASE DST FILL HEIGHT	0	0
	NET EVAPORATOR WVR (2)	1510	0
	RESERVE EMERGENCY SPACE COMPLIANT WITH DOE0435.1	1100	0
	USE RESTRICTED HEADSPACE	0	0
	<b>TOTAL</b>		<b>2610</b>

(1) DST tank space gains since 10/1/02.  
(2) WVR is net (after flush) waste volume reduction for 242-A Evaporator

## 4.0 SINGLE-SHELL TANKS MONTHLY SUMMARY TABLES

Table 4-1. Inventory and Status by Tanks - Single-Shell Tanks (sheet 1 of 4).

All volume data obtained from Tank Waste Information Network System (TWINS)

Tank Number	Tank Integrity	Tank Status	Total Waste (Kgal)	Waste Volumes						Sludge (Kgal)	Salt-cake (Kgal)	Solds Volume Update
				Super-natant Liquid (Kgal)	Drainable Interstitial Liquid (Kgal)	Pumped this Month (Kgal)	Total Pumped (Kgal)	Drinable Liquid Remaining (Kgal)				
<b>241-A TANK FARM STATUS</b>												
A-101	SOUND	IS/PI	395	-	-	0	542	-	3	392	09/30/03	
A-102	SOUND	IS/PI	40	3	9	0	40	12	0	37	01/31/03	
A-103	ASMD LKR	IS/IP	371	5	87	0	111	92	2	364	01/01/02	
A-104	ASMD LKR	IS/IP	28	0	0	0	0	0	28	0	01/27/78	
A-105	ASMD LKR	IS/IP	37	0	0	0	0	0	37	0	10/31/00	
A-106	SOUND	IS/IP	79	0	9	0	0	9	50	29	01/01/02	
6 TANKS - TOTAL			950						120	822		
<b>241-AX TANK FARM STATUS</b>												
AX-101	SOUND	IS/PI	319	-	-	0	369	-	3	316	04/30/03	
AX-102	ASMD LKR	IS/IP	30	0	0	0	13	0	6	24	01/01/02	
AX-103	SOUND	IS/IP	107	0	22	0	0	22	8	99	09/30/03	
AX-104	ASMD LKR	IS/IP	7	0	0	0	0	0	7	0	01/01/02	
4 TANKS - TOTAL			463						24	439		
<b>241-B TANK FARM STATUS</b>												
B-101	ASMD LKR	IS/IP	109	0	20	0	0	20	28	81	01/01/02	
B-102	SOUND	IS/IP	32	4	7	0	0	11	0	28	06/30/99	
B-103	ASMD LKR	IS/IP	56	0	10	0	0	10	1	55	01/01/02	
B-104	SOUND	IS/IP	374	0	45	0	0	45	309	65	01/01/02	
B-105	ASMD LKR	IS/IP	290	0	20	0	0	20	28	262	01/01/02	
B-106	SOUND	IS/IP	122	1	8	0	0	9	121	0	01/01/02	
B-107	ASMD LKR	IS/IP	161	0	23	0	0	23	86	75	01/01/02	
B-108	SOUND	IS/IP	91	0	19	0	0	19	27	64	01/31/03	
B-109	SOUND	IS/IP	125	0	23	0	0	23	50	75	01/01/02	
B-110	ASMD LKR	IS/IP	245	1	27	0	0	28	244	0	01/01/02	
B-111	ASMD LKR	IS/IP	242	1	23	0	0	24	241	0	01/01/02	
B-112	ASMD LKR	IS/IP	35	3	2	0	0	5	15	17	01/01/02	
B-201	ASMD LKR	IS/IP	30	0	5	0	0	5	30	0	01/01/02	
B-202	SOUND	IS/IP	29	0	4	0	0	4	29	0	01/01/02	
B-203	ASMD LKR	IS/IP	52	1	5	0	0	6	51	0	01/01/02	
B-204	ASMD LKR	IS/IP	51	1	5	0	0	6	50	0	01/01/02	
16 TANKS - TOTAL			2044						1310	722		
<b>241-BX TANK FARM STATUS</b>												
BX-101	ASMD LKR	IS/IP/CCS	48	0	4	0	0	4	48	0	01/01/02	
BX-102	ASMD LKR	IS/IP/CCS	112	0	0	0	0	0	112	0	04/28/02	
BX-103	SOUND	IS/IP/CCS	73	11	4	0	0	15	62	0	11/29/83	
BX-104	SOUND	IS/IP/CCS	100	3	4	0	17	7	97	0	01/01/02	
BX-105	SOUND	IS/IP/CCS	72	5	4	0	15	9	67	0	01/01/02	
BX-106	SOUND	IS/IP/CCS	38	0	4	0	14	4	38	0	01/01/95	
BX-107	SOUND	IS/IP/CCS	347	0	37	0	23	37	347	0	09/18/90	
BX-108	ASMD LKR	IS/IP/CCS	31	0	4	0	0	4	31	0	01/31/01	
BX-109	SOUND	IS/IP/CCS	193	0	25	0	8	25	193	0	09/17/90	
BX-110	ASMD LKR	IS/IP/CCS	205	1	35	0	2	36	65	139	01/01/01	
BX-111	ASMD LKR	IS/IP/CCS	189	0	6	0	117	6	32	157	01/01/02	
BX-112	SOUND	IS/IP/CCS	164	1	9	0	4	10	163	0	01/01/02	
12 TANKS - TOTAL			1572						1255	296		

Table 4-1. Inventory and Status by Tank - Single-Shell Tanks (sheet 2 of 4).

All volume data obtained from Tank Waste Information Network System (TWINS)												
				Waste Volumes								
Tank Number	Tank Integrity	Tank Status	Total Waste (Kgal)	Super-natant Liquid (Kgal)	Drainable Interstitial Liquid (Kgal)	Pumped this Month (Kgal)	Total Pumped (Kgal)	Drainable Liquid Remaining (Kgal)	Sludge (Kgal)	Salt-cake (Kgal)	Solids Volume Update	
<b>241-BY TANK FARM STATUS</b>												
BY-101	SOUND	IS/IP	370	0	24	0	36	24	37	333	01/01/02	
BY-102	SOUND	IS/PI	277	0	40	0	159	40	0	277	05/01/95	
BY-103	ASMD LKR	IS/PI	417	0	58	0	96	58	9	408	01/31/03	
BY-104	SOUND	IS/IP	358	0	51	0	330	51	45	313	01/01/02	
BY-105	ASMD LKR	IS/PI	481	0	47	0	45	47	48	433	03/31/03	
BY-106	ASMD LKR	/PI	467	-	-	4	94	-	32	435	11/30/03	
BY-107	ASMD LKR	IS/IP	271	0	42	0	56	42	15	256	01/31/03	
BY-108	ASMD LKR	IS/IP	222	0	33	0	28	33	40	182	01/01/02	
BY-109	SOUND	IS/PI	277	0	37	0	157	37	24	253	01/01/02	
BY-110	SOUND	IS/IP	366	0	20	0	213	20	43	323	01/01/02	
BY-111	SOUND	IS/IP	302	0	14	0	313	14	0	302	01/01/02	
BY-112	SOUND	IS/IP	286	0	24	0	116	24	2	284	03/31/02	
<b>12 TANKS - TOTAL</b>			<b>4094</b>							<b>295</b>	<b>3799</b>	
<b>241-C TANK FARM STATUS</b>												
C-101	ASND LKR	IS/IP	88	0	4	0	0	4	88	0	11/29/83	
C-102	SOUND	IS/IP	316	0	62	0	47	62	316	0	09/30/95	
C-103	SOUND	IS/R	73	1	10	0	114	11	72	0	08/31/03	
C-104	SOUND	IS/R	259	0	29	0	0	29	259	0	01/01/02	
C-105	SOUND	IS/R	132	0	10	0	0	10	132	0	02/29/00	
C-106	SOUND	/R	23	Retrieval in progress		146	287	-	7	0	10/31/03	
C-107	SOUND	IS/IP	248	0	30	0	41	30	248	0	01/01/02	
C-108	SOUND	IS/IP	66	0	4	0	0	4	66	0	02/24/84	
C-109	SOUND	IS/IP	64	0	4	0	0	4	64	0	01/31/03	
C-110	ASND LKR	IS/IP	178	1	37	0	16	38	177	0	06/14/95	
C-111	ASND LKR	IS/IP	58	0	4	0	0	4	58	0	01/31/03	
C-112	SOUND	IS/IP	104	0	6	0	0	6	104	0	09/18/90	
C-201	ASND LKR	IS/R	1	0	0	0	0	0	1	0	01/01/02	
C-202	ASND LKR	IS/R	1	0	0	0	0	0	1	0	01/19/79	
C-203	ASND LKR	IS/R	3	0	0	0	0	0	3	0	01/31/03	
C-204	ASND LKR	IS/R	2	0	0	0	0	0	2	0	01/31/03	
<b>16 TANKS - TOTAL</b>			<b>1616</b>							<b>1598</b>	<b>0</b>	
<b>241-S TANK FARM STATUS</b>												
S-101	SOUND	/PI	351	-	-	0	68	-	122	229	09/30/03	
S-102	SOUND	/R	438	Retrieval in progress		0	62	-	22	416	06/30/03	
S-103	SOUND	IS/R	238	1	45	0	24	46	9	228	01/31/03	
S-104	ASMD LKR	IS/IP	288	0	49	0	0	49	132	156	12/20/84	
S-105	SOUND	IS/R	406	0	42	0	114	42	2	404	01/01/02	
S-106	SOUND	IS/R	455	0	26	0	204	26	0	455	02/28/01	
S-107	SOUND	IS/PI	311	-	-	0	82	-	292	19	09/30/03	
S-108	SOUND	IS/PI	550	0	4	0	200	4	5	545	01/01/02	
S-109	SOUND	IS/PI	533	0	16	0	34	16	13	520	06/30/01	
S-110	SOUND	IS/PI	389	0	30	0	203	30	96	293	01/01/02	
S-111	SOUND	/PI	414	-	-	0	99	-	75	339	10/31/03	
S-112	SOUND	/R	493	Retrieval in progress		282	631	-	6	487	11/30/03	
<b>12 TANKS - TOTAL</b>			<b>4866</b>							<b>774</b>	<b>4091</b>	

Table 4-1. Inventory and Status by Tank - Single-Shell Tanks (sheet 3 of 4).

All volume data obtained from Tank Waste Information Network System (TWINS)											
Waste Volumes											
Tank Number	Tank Integrity	Tank Status	Total Waste (Kgal)	Super-natant Liquid (Kgal)	Drainable Interstitial Liquid (Kgal)	Pumped this Month (Kgal)	Total Pumped (Kgal)	Drainable Liquid Remaining (Kgal)	Sludge (Kgal)	Salt-cake (Kgal)	Solids Volume Update
<b>241-SX TANK FARM STATUS</b>											
SX-101	SOUND	IS/PI	418	0	43	0	33	44	144	274	08/31/03
SX-102	SOUND	IS/PI	409	-	-	0	98	-	55	354	08/31/03
SX-103	SOUND	IS/PI	509	0	40	0	134	40	78	431	09/30/03
SX-104	ASMD LKR	IS/PI	446	0	48	0	231	48	136	310	04/30/00
SX-105	SOUND	IS/PI	375	0	39	0	153	39	63	312	12/31/02
SX-106	SOUND	IS/PI	396	0	37	0	148	37	0	396	01/31/03
SX-107	ASMD LKR	IS/IP	95	0	7	0	0	7	79	16	01/01/02
SX-108	ASMD LKR	IS/IP	73	0	0	0	0	0	73	0	01/01/02
SX-109	ASMD LKR	IS/IP	241	0	0	0	0	0	58	183	01/01/02
SX-110	ASMD LKR	IS/IP	56	0	0	0	0	0	29	27	01/01/02
SX-111	ASMD LKR	IS/IP	115	0	11	0	0	11	76	39	01/01/02
SX-112	ASMD LKR	IS/IP	75	0	6	0	0	6	56	19	01/01/02
SX-113	ASMD LKR	IS/IP	19	0	0	0	0	0	19	0	01/01/02
SX-114	ASMD LKR	IS/IP	155	0	30	0	0	30	41	114	01/31/02
SX-115	ASMD LKR	IS/IP	4	0	0	0	0	0	4	0	01/01/02
<b>15 TANKS - TOTAL</b>			<b>3386</b>						<b>911</b>	<b>2475</b>	
<b>241-T TANK FARM STATUS</b>											
T-101	ASMD LKR	IS/PI	100	0	16	0	25	16	37	63	01/01/02
T-102	SOUND	IS/IP	32	13	3	0	0	16	19	0	08/31/84
T-103	ASMD LKR	IS/IP	27	4	3	0	0	7	23	0	11/29/83
T-104	SOUND	IS/PI	317	0	31	0	150	31	317	0	11/30/99
T-105	SOUND	IS/IP	98	0	5	0	0	5	98	0	05/29/87
T-106	ASMD LKR	IS/IP	22	0	0	0	0	0	22	0	01/01/01
T-107	ASMD LKR	IS/PI	173	0	34	0	11	34	173	0	05/31/96
T-108	ASMD LKR	IS/IP	16	0	4	0	0	4	5	11	01/01/01
T-109	ASMD LKR	IS/TP	62	0	11	0	0	11	0	62	01/01/02
T-110	SOUND	IS/IP	370	1	48	0	50	49	369	0	03/31/02
T-111	ASMD LKR	IS/PI	447	0	38	0	10	38	447	0	01/01/02
T-112	SOUND	IS/IP	67	7	4	0	0	11	60	0	04/28/82
T-201	SOUND	IS/IP	31	2	4	0	0	6	29	0	01/01/02
T-202	SOUND	IS/IP	21	0	3	0	0	3	21	0	07/12/81
T-203	SOUND	IS/IP	37	0	5	0	0	5	37	0	01/01/02
T-204	SOUND	IS/IP	37	0	5	0	0	5	37	0	01/01/02
<b>16 TANKS - TOTAL</b>			<b>1857</b>						<b>1694</b>	<b>136</b>	
<b>241-TX TANK FARM STATUS</b>											
TX-101	SOUND	IS/IP/CCS	91	0	7	0	0	7	74	17	01/01/02
TX-102	SOUND	IS/IP/CCS	217	0	27	0	94	27	2	215	03/31/03
TX-103	SOUND	IS/IP/CCS	145	0	18	0	68	18	0	145	01/01/02
TX-104	SOUND	IS/IP/CCS	68	2	9	0	4	11	34	32	01/01/02
TX-105	ASMD LKR	IS/IP/CCS	576	0	25	0	122	25	8	568	01/01/02
TX-106	SOUND	IS/IP/CCS	348	0	37	0	135	37	5	343	03/31/02
TX-107	ASMD LKR	IS/IP/CCS	29	0	7	0	0	7	0	29	01/31/03
TX-108	SOUND	IS/IP/CCS	129	0	8	0	14	8	6	123	01/01/02
TX-109	SOUND	IS/IP/CCS	363	0	6	0	72	6	363	0	01/01/02
TX-110	ASMD LKR	IS/IP/CCS	467	0	14	0	115	14	37	430	01/01/02
TX-111	SOUND	IS/IP/CCS	365	0	10	0	98	10	43	322	01/01/02
TX-112	SOUND	IS/IP/CCS	634	0	26	0	94	26	0	634	01/01/02
TX-113	ASMD LKR	IS/IP/CCS	639	0	18	0	19	18	93	546	01/01/02
TX-114	ASMD LKR	IS/IP/CCS	532	0	17	0	104	17	4	528	01/01/02
TX-115	ASMD LKR	IS/IP/CCS	554	0	25	0	99	25	9	545	01/31/03
TX-116	ASMD LKR	IS/IP/CCS	599	0	21	0	24	21	66	533	04/30/03
TX-117	ASMD LKR	IS/IP/CCS	481	0	10	0	54	10	29	452	01/01/02
TX-118	SOUND	IS/IP/CCS	256	0	31	0	89	31	0	256	01/01/02
<b>18 TANKS - TOTAL</b>			<b>6493</b>						<b>773</b>	<b>5718</b>	

HNF-EP-0182, REV. 188

Table 4-1. Inventory and Status by Tank - Single-Shell Tanks (sheet 4 of 4).

All volume data obtained from Tank Waste Information Network System (TWINS)											
				Waste Volumes							
Tank Number	Tank Integrity	Tank Status	Total Waste (Kgal)	Super-natant Liquid (Kgal)	Drainable Interstitial Liquid (Kgal)	Pumped this Month (Kgal)	Total Pumped (Kgal)	Drainable Liquid Remaining (Kgal)	Sludge (Kgal)	Salt-cake (Kgal)	Solids Volume Update
<u>241-TY TANK FARM STATUS</u>											
TY-101	ASMD LKR	IS/IP/CCS	119	0	2	0	8	2	72	47	01/31/03
TY-102	SOUND	IS/IP/CCS	69	0	13	0	7	13	0	69	01/01/02
TY-103	ASMD LKR	IS/IP/CCS	155	0	23	0	12	23	103	52	01/01/02
TY-104	ASMD LKR	IS/IP/CCS	44	1	4	0	0	5	43	0	03/31/02
TY-105	ASMD LKR	IS/IP/CCS	231	0	12	0	4	12	231	0	04/28/82
TY-106	ASMD LKR	IS/IP/CCS	16	0	1	0	0	1	16	0	01/01/02
<b>6 TANKS - TOTALS</b>			<b>634</b>						<b>465</b>	<b>168</b>	
<u>241-U TANK FARM STATUS</u>											
U-101	ASMD LKR	IS/IP	24	0	4	0	0	4	24	0	01/01/02
U-102	SOUND	IS/PI	327	1	37	0	87	38	43	283	12/31/02
U-103	SOUND	IS/PI	417	1	33	0	99	34	11	405	12/31/02
U-104	ASMD LKR	IS/IP	122	0	0	0	0	0	122	0	01/01/02
U-105	SOUND	IS/PI	353	0	44	0	88	44	32	321	03/30/01
U-106	SOUND	IS/PI	172	3	36	0	39	39	0	169	01/31/03
U-107	SOUND	IS/PI	287	-	-	0	119	-	15	272	09/30/03
U-108	SOUND	/PI	356	-	-	0	112	-	29	327	10/31/03
U-109	SOUND	IS/PI	401	0	47	0	78	47	35	366	04/30/02
U-110	ASMD LKR	IS/PI	176	0	16	0	0	16	176	0	01/01/02
U-111	SOUND	IS/PI	222	0	31	0	85	31	26	196	08/31/03
U-112	ASMD LKR	IS/IP	45	0	4	0	0	4	45	0	02/10/84
U-201	SOUND	IS/IP	4	1	1	0	0	2	3	0	06/30/03
U-202	SOUND	IS/IP	4	1	0	0	0	1	3	0	06/30/03
U-203	SOUND	IS/IP	3	1	0	0	0	1	2	0	06/30/03
U-204	SOUND	IS/IP	3	1	0	0	0	1	2	0	06/30/03
<b>16 TANKS - TOTALS</b>			<b>2916</b>						<b>568</b>	<b>2339</b>	

Note: +/- 1 Kgal difference in volumes is due to rounding.

Table 4-2. Single-Shell Tanks Interim Stabilization Status (Sheet 1 of 2).

Tank Number	Tank Integrity	Interim Stabilization Date (1)	Interim Stabilization Method	Tank Number	Tank Integrity	Interim Stabilization Date (1)	Interim Stabilization Method
A-101	SOUND	11/30	JET (16)	BY-107	ASMD LKR	07/79	JET
A-102	SOUND	08/89	SN	BY-108	ASMD LKR	02/85	JET
A-103	ASMD LKR	06/88	AR	BY-109	SOUND	07/97	JET
A-104	ASMD LKR	09/78	AR (3)	BY-110	SOUND	01/85	JET
A-105	ASMD LKR	07/79	AR	BY-111	SOUND	01/85	JET
A-106	SOUND	08/82	AR	BY-112	SOUND	06/84	JET
AX-101	SOUND	06/03	JET (9)	C-101	ASMD LKR	11/83	AR
AX-102	ASMD LKR	09/88	SN	C-102	SOUND	09/95	JET (2)
AX-103	SOUND	08/87	AR	C-103	SOUND	07/03	JET (11)
AX-104	ASMD LKR	08/81	AR	C-104	SOUND	09/89	SN
B-101	ASMD LKR	03/81	SN	C-105	SOUND	10/95	AR
B-102	SOUND	08/85	SN	C-106	SOUND	N/A	--
B-103	ASMD LKR	02/85	SN	C-107	SOUND	09/95	JET
B-104	SOUND	06/85	SN	C-108	SOUND	03/84	AR
B-105	ASMD LKR	12/84	AR	C-109	SOUND	11/83	AR
B-106	SOUND	03/85	SN	C-110	ASMD LKR	05/95	JET
B-107	ASMD LKR	03/85	SN	C-111	ASMD LKR	03/84	SN
B-108	SOUND	05/85	SN	C-112	SOUND	09/90	AR
B-109	SOUND	04/85	SN	C-201	ASMD LKR	03/82	AR
B-110	ASMD LKR	12/84	AR	C-202	ASMD LKR	08/81	AR
B-111	ASMD LKR	06/85	SN	C-203	ASMD LKR	03/82	AR
B-112	ASMD LKR	05/85	SN	C-204	ASMD LKR	09/82	AR
B-201	ASMD LKR	08/81	AR (3)	S-101	SOUND	N/A	--
B-202	SOUND	05/85	AR (2)	S-102	SOUND	Retrieval	--
B-203	ASMD LKR	06/84	AR	S-103	SOUND	04/00	JET
B-204	ASMD LKR	06/84	AR	S-104	ASMD LKR	12/84	AR
BX-101	ASMD LKR	09/78	AR (3)	S-105	SOUND	09/88	JET
BX-102	ASMD LKR	11/78	AR	S-106	SOUND	02/01	JET
BX-103	SOUND	11/83	AR (2) (3)	S-107	SOUND	08/03	JET (13)
BX-104	SOUND	09/89	SN	S-108	SOUND	12/96	JET
BX-105	SOUND	03/81	SN	S-109	SOUND	06/01	JET
BX-106	SOUND	07/95	SN	S-110	SOUND	01/97	JET
BX-107	SOUND	09/90	JET	S-111	SOUND	N/A	--
BX-108	ASMD LKR	07/79	SN	S-112	SOUND	Retrieval	--
BX-109	SOUND	08/90	JET	SX-101	SOUND	08/03	JET (12)
BX-110	ASMD LKR	08/85	SN	SX-102	SOUND	08/03	JET (14)
BX-111	ASMD LKR	03/95	JET	SX-103	SOUND	05/03	JET (8)
BX-112	SOUND	09/90	JET	SX-104	ASMD LKR	04/00	JET
BY-101	SOUND	05/84	JET	SX-105	SOUND	08/02	JET (6)
BY-102	SOUND	04/95	JET	SX-106	SOUND	05/00	JET
BY-103	ASMD LKR	11/97	JET (2)	SX-107	ASMD LKR	10/79	AR
BY-104	SOUND	01/85	JET	SX-108	ASMD LKR	08/79	AR
BY-105	ASMD LKR	03/03	JET	SX-109	ASMD LKR	05/81	AR
BY-106	ASMD LKR	N/A	--	SX-110	ASMD LKR	08/79	AR

Table 4-2. Single-Shell Tanks Interim Stabilization Status (Sheet 2 of 2).

Tank Number	Tank Integrity	Interim Stabilization Date (1)	Interim Stabilization Method	Tank Number	Tank Integrity	Interim Stabilization Date (1)	Interim Stabilization Method
SX-111	ASMD LKR	07/79	SN	TX-111	SOUND	04/83	JET
SX-112	ASMD LKR	07/79	AR	TX-112	SOUND	04/83	JET
SX-113	ASMD LKR	11/78	AR	TX-113	ASMD LKR	04/83	JET
SX-114	ASMD LKR	07/79	AR	TX-114	ASMD LKR	04/83	JET
SX-115	ASMD LKR	09/78	AR (3)	TX-115	ASMD LKR	09/83	JET
T-101	ASMD LKR	04/93	SN	TX-116	ASMD LKR	04/83	JET
T-102	SOUND	03/81	AR (2)(3)	TX-117	ASMD LKR	03/83	JET
T-103	ASMD LKR	11/83	AR	TX-118	SOUND	04/83	JET
T-104	SOUND	11/99	JET	TY-101	ASMD LKR	04/83	JET
T-105	SOUND	06/87	AR	TY-102	SOUND	09/79	AR
T-106	ASMD LKR	08/81	AR	TY-103	ASMD LKR	02/83	JET
T-107	ASMD LKR	05/96	AR	TY-104	ASND KJR	11/83	AR
T-108	ASMD LKR	11/78	AR	TY-105	ASMD LKR	02/83	JET
T-109	ASMD LKR	12/84	AR	TY-106	ASMD LKR	11/78	AR
T-110	SOUND	01/00	JET	U-101	ASMD LKR	09/79	AR
T-111	ASMD LKR	02/95	JET	U-102	SOUND	06/02	JET (5)
T-112	SOUND	03/81	AR (2)(3)	U-103	SOUND	09/00	JET
T-201	SOUND	04/81	AR (3)	U-104	ASMD LKR	10/78	AR
T-202	SOUND	08/81	AR	U-105	SOUND	03/01	JET
T-203	SOUND	04/81	AR	U-106	SOUND	03/01	JET
T-204	SOUND	08/81	AR	U-107	SOUND	10/03	JET (15)
TX-101	SOUND	02/84	AR	U-108	SOUND	N/A	--
TX-102	SOUND	04/83	JET	U-109	SOUND	04/02	JET (4)
TX-103	SOUND	08/83	JET	U-110	ASMD LKR	12/84	AR
TX-104	SOUND	09/79	SN	U-111	SOUND	06/03	JET (10)
TX-105	ASMD LKR	04/83	JET	U-112	ASMD LKR	09/79	AR
TX-106	SOUND	06/83	JET	U-201	SOUND	08/79	AR
TX-107	ASMD LKR	10/79	AR	U-202	SOUND	08/79	SN
TX-108	SOUND	03/83	JET	U-203	SOUND	08/79	AR
TX-109	SOUND	04/83	JET	U-204	SOUND	08/79	SN
TX-110	ASMD LKR	04/83	JET				

<b>LEGEND:</b>		
AR	Administratively Interim Stabilized	Interim Stabilized Tanks 142
JET	Saltwell Jet Pumped to Remove Drainable Interstitial Liquid	Not yet Interim Stabilized 7
SN	Supernatant Pumped (Non-Jet Pumped)	
ASMD LKR	Assumed Leaker	Total Single-Shell Tanks 149
N/A	Not yet Interim Stabilized	

Table 4-2. - Footnotes: (in chronological order)

- (1) These dates indicate when the tanks were actually interim stabilized. In some cases, the official interim stabilization documents were issued at a later date.
- (2) Although tanks 241-BX-103, T-102, and T-112 met the interim stabilization administrative procedure at the time they were stabilized, they no longer meet the updated administrative procedure. The tanks were re-evaluated in 1996 and a letter was issued to DOE-RL recommending that no further pumping be performed on these tanks, based on an economic evaluation. In February 2000, it was determined that five tanks no longer met the stabilization criteria (241-

Table 4-2. – Footnotes continued

BX-103, T-102, and T-112 exceed the supernatant criteria, and BY-103 and C-102 exceed the Drainable Interstitial Liquid [DIL] criteria).

An intrusion investigation was completed on tank 241-B-202 in 1996 and it was determined that this tank no longer meets the recently updated administrative procedure for 200 series tanks.

- (3) Original interim stabilization data are missing on four tanks: 241-B-201, T-102, T-112, and T-201. In February 2001, three additional tanks were added to those missing stabilization data: 241-A-104, BX-101, and SX-115.
- (4) Tank 241-U-109 was declared Interim Stabilized on April 5, 2002. The declaration letter to DOE was issued on June 20, 2002. The surface is primarily a brown colored waste with irregular patches of white salt crystal. Approximately 70% of the waste surface is covered by the salt formations. The waste surface appears dry and shows signs of cracking due to saltwell pumping. There is no visible liquid within the tank.
- (5) Tank 241-U-102 was declared Interim Stabilized on June 19, 2002. The declaration letter to DOE was issued June 28, 2002. The surface is primarily a gray-brown colored cracked waste with irregular patches of white salt crystal. Approximately 50% of the waste surface is covered by the salt formations. The waste surface appears dry and shows signs of cracking due to saltwell pumping. There is approximately a 5-foot wide pool of visible liquid within the saltwell screen depression.
- (6) Tank 241-SX-105 was declared Interim Stabilized on August 1, 2002; the declaration letter to DOE was issued August 20, 2002. The surface is a rough, yellowish-gray saltcake waste with an irregular surface of visible cracks and shelves due to saltwell pumping. The waste surface appears to be dry and shows no standing water within the tank.
- (7) Tank 241-BY-105 was declared Interim Stabilized on March 7, 2003; the declaration letter to DOE was issued March 25, 2003. An in-tank video was taken January 5, 2003. The surface is a rough, yellowish brown saltcake waste with an irregular surface of visible lumps and shelves that were created as the surface was dried out by saltwell pumping. The waste surface appears to be dry and shows no standing water within the tank. A large hole around the saltwell screen shows no evidence of supernatant liquid.
- (8) Tank 241-SX-103 was declared Interim Stabilized on May 31, 2003; the declaration letter to DOE was issued June 13, 2003. An in-tank video was taken December 31, 2001. The upper waste surface is uneven and rough, with many cracks and shelves due to surface drying caused by saltwell pumping. All estimations regarding waste dimensions were obtained by comparison with known dimensions of installed in-tank equipment.
- (9) Tank 241-AX-101 was declared Interim Stabilized on June 2, 2003. This tank is in evaluation to confirm interim stabilization criteria have been met.
- (10) Tank 241-U-111 was declared Interim Stabilized on June 25, 2003, due to major equipment failure; the declaration letter to DOE was issued July 14, 2003. An in-tank video was taken March 25, 2003. The surface is a dry, crusty, flat surface saltcake waste with a fairly uniform surface of large cracks and pocked holes that were created as the surface was dried out by saltwell pumping. The waste surface is dry and shows no standing water.
- (11) Tank 241-C-103 was declared Interim Stabilized on July 11, 2003, due to major equipment failure; the declaration letter to DOE was issued August 13, 2003. An in-tank video was taken March 3, 2003. The surface is a dry-cracked brown sludge type waste, which appears to be relatively level and to have more cracking near the tank walls. There is a roughly 3-foot diameter supernatant pool around the saltwell screen. There are also small supernatant pools around two risers and many liquid pockets across the center waste surface. The ENRAF is out of service and there is no liquid observation well (LOW) installed in the tank.
- (12) Tank 241-SX-101 was declared Interim Stabilized on August 14, 2003; the declaration letter to DOE was issued August 22, 2003. An in-tank video was taken August 6, 2003. The surface is a rough, yellowish gray saltcake waste with an irregular surface of visible cracks and shelves that were created as the waste was dried out by saltwell pumping. The waste surface appears to be dry and shows no standing water. A cylindrical pool (approximately 5 foot diameter) around the saltwell screen shows evidence of apparent supernatant liquid, but upon closer examination, was determined to be interstitial liquid.
- (13) Tank 241-S-107 was declared Interim Stabilized on August 28, 2003, due to major equipment failure. This tank is in evaluation to confirm interim stabilization criteria have been met.

Table 4-2. – Footnotes continued

- (14) Tank 241-SX-102 was declared Interim Stabilized on August 28, 2003, due to major equipment failure. This tank is in evaluation to confirm interim stabilization criteria have been met.
- (15) Tank 241-U-107 was declared Interim Stabilized on October 7, 2003. This tank is in evaluation to confirm interim stabilization criteria have been met.
- (16) **Tank 241-A-101 was declared Interim Stabilized on November 10, 2003. This tank is in evaluation to confirm interim stabilization criteria have been met.**

Table 4-3. Single-Shell Tank Interim Stabilization Milestones - Consent Decree.

New single-shell interim stabilization milestones were negotiated in 1999 and are identified in the "Consent Decree." The Consent Decree was approved on August 16, 1999.				
The following is the schedule for pumping liquid waste from the remaining 29 single-shell tanks; this schedule is enforceable pursuant to the Decree except for the "Projected Pumping Completion Dates," which are estimates only. This schedule does not include tank 241-C-106.				
Tank Designation	Projected Pumping Start Date	Actual Pumping Start Date	Projected Pumping Completion Date	Interim Stabilization Date
1. 241-T-104	Already initiated	March 24, 1996	May 30, 1999	November 19, 1999
2. 241-T-110	Already initiated	May 12, 1997	May 30, 1999	January 5, 2000
3. 241-SX-104	Already initiated	September 26, 1997	December 30, 2000	April 26, 2000
4. 241-SX-106	Already initiated	October 6, 1998	December 30, 2000	May 5, 2000
5. 241-S-102	Already initiated	March 18, 1999	March 30, 2001	(Retrieval)
6. 241-S-106	Already initiated	April 16, 1999	March 30, 2001	February 1, 2001
7. 241-S-103	Already initiated	June 4, 1999	March 30, 2001	April 18, 2000
8. 241-U-103 *	June 15, 2000	September 26, 1999	April 15, 2002	September 11, 2000
9. 241-U-105 *	June 15, 2000	December 10, 1999	April 15, 2002	March 29, 2001
10. 241-U-102 *	June 15, 2000	January 20, 2000	April 15, 2002	June 19, 2002
11. 241-U-109 *	June 15, 2000	March 11, 2000	April 15, 2002	April 5, 2002
12. 241-A-101	October 30, 2000	May 6, 2000	September 30, 2003	<b>November 10, 2003</b>
13. 241-AX-101	October 30, 2000	July 29, 2000	September 30, 2003	June 2, 2003
14. 241-SX-105	March 15, 2001	August 8, 2000	February 28, 2003	August 1, 2002
15. 241-SX-103	March 15, 2001	October 26, 2000	February 28, 2003	May 31, 2003
16. 241-SX-101	March 15, 2001	November 22, 2000	February 28, 2003	August 14, 2003
17. 241-U-106 *	March 15, 2001	August 24, 2000	February 28, 2003	March 9, 2001
18. 241-BY-106	July 15, 2001	July 11, 2001	June 30, 2003	---
19. 241-BY-105	July 15, 2001	July 11, 2001	June 30, 2003	March 7, 2003
20. 241-U-108	December 30, 2001	December 2, 2001	August 30, 2003	---
21. 241-U-107	December 30, 2001	September 29, 2001	August 30, 2003	October 7, 2003
22. 241-S-111	December 30, 2001	December 18, 2001	August 30, 2003	---
23. 241-SX-102	December 30, 2001	December 15, 2001	August 30, 2003	August 28, 2003
24. 241-U-111	November 30, 2002	June 14, 2002	September 30, 2003	June 25, 2003
25. 241-S-109	November 30, 2002	September 23, 2000	September 30, 2003	June 11, 2001
26. 241-S-112	November 30, 2002	September 21, 2002	September 30, 2003	(Retrieval)
27. 241-S-101	November 30, 2002	July 27, 2002	September 30, 2003	---
28. 241-S-107	November 30, 2002	September 4, 2002	September 30, 2003	August 28, 2003
29. 241-C-103	Pumping operations began in this tank on November 29, 2002, approximately five months ahead of the scheduled start date of April 2003. It is the final tank to begin pumping operations specified in this Decree. Pumping was completed in this tank on March 3, 2003, and a declaration memo that the tank has met interim stabilization criteria was issued on March 7, 2003. This tank was declared Interim Stabilized on July 11, 2003.			

\* Tanks containing organic complexants.

Completion of Interim Stabilization. DOE will complete interim stabilization of all 29 single-shell tanks listed above by September 30, 2004.

Percentage of Pumpable Liquid Remaining to be Removed:

93% of Total Liquid	9/30/1999 (1)
38% of Organic Complexed Pumpable Liquids	9/30/2000 (2)
5% of Organic Complexed Pumpable Liquids	9/30/2001 (3)
18% of Total Liquid	9/30/2002 (4)
2% of Total Liquid	9/30/2003 (5)

The “percentage of pumpable liquid remaining to be removed” is calculated by dividing the volume of pumpable liquid remaining to be removed from tanks not yet interim stabilized by the sum of the total amount of liquid that has been pumped and the pumpable liquid that remains to be pumped from all tanks.

**Footnotes:**

- (1) The Pumpable Liquid Remaining was reduced to 88% by September 30, 1999. Reference LMHC-9957926 R1, D. I. Allen, LHMC, to D. C. Bryson, DOE-ORP, dated October 26, 1999.
- (2) The Complexed Pumpable Liquid Remaining was reduced to 38% by September 15, 2000. Reference CHG-0004752, R. F. Wood, CHG, to J. J. Short, DOE-ORP, dated September 13, 2000.
- (3) Reference CHG-0104859, R. F. Wood, CHG, to J. S. O’Connor, DOE-ORP, dated September 20, 2001: this reference states that tanks U-102 and U-109 appear to have met the interim stabilization criteria, thereby reducing the Complexed Pumpable Liquid Remaining to zero. Reference CHG-0202630, dated June 20, 2002, declared tank U-109 Interim Stabilized and confirmed the completion of Consent Decree milestone, Attachment A, Item 11, as well as the partial completion of milestone D-001-004-T01. Reference CHG-0202901, dated June 28, declared tank U-102 Interim Stabilized and confirmed the completion of Consent Decree milestone, Attachment A, Item 10, as well as the partial completion of milestone D-001-004-T01.
- (4) The Pumpable Liquid Remaining was reduced to less than 18% of the total liquid by September 30, 2003. Reference CHG-204636, R. F. Wood, CHG, to J. S. O’Connor, DOE-ORP, dated September 30, 2002. The percentage of pumpable liquid remaining was 17.94% or less than 550 Kgallons.
- (5) The Pumpable Liquid Remaining was reduced to 2% of the total liquid by August 31, 2003, approximately 30 days ahead of the required completion date of September 30, 2003. The confirmation letter to DOE-ORP will be issued in September 2003. The volume of pumpable liquid remaining in the non-stabilized tanks is slightly less than 2% of the original total pumpable volume.

Table 4-4. Single-Shell Tank Leak Volume Estimates (Sheet 1 of 2)

Tank Number	Confirmed or Assumed Leaker (3)	Volume Gallons (2)	Associated KiloCuries 137 Cs (9)	Interim Stabilized (11)	Leak Estimate	
					Updated	Reference
241-A-103	1987	5500 (8)		06/88	1987	(j)
241-A-104	1975	500 to 2500	0.8 to 1.8 (q)	09/78	1983	(a)(q)
241-A-105 (1)	1963	10000 to 270000	85 to 760 (b)	07/79	1991	(b)(c)
241-AX-102	1988	3000 (8)		09/88	1989	(h)
241-AX-104	1977	-- (6)		08/81	1989	(g)
241-B-101	1974	-- (6)		03/81	1989	(g)
241-B-103	1978	-- (6)		02/85	1989	(g)
241-B-105	1978	-- (6)		12/84	1989	(g)
241-B-107	1980	8000 (8)		03/85	1986	(d)(f)
241-B-110	1981	1000 (8)		03/85	1986	(d)
241-B-111	1978	-- (6)		06/85	1989	(g)
241-B-112	1978	2000		05/85	1989	(g)
241-B-201	1980	1200 (8)		08/81	1984	(e)(f)
241-B-203	1983	300 (8)		06/84	1986	(d)
241-B-204	1984	400 (8)		06/84	1989	(g)
241-BX-101	1972	-- (6)		09/78	1989	(g)
241-BX-102	1971	70000	50 (l)	11/78	1986	(d)
241-BX-108	1974	2500	0.5 (l)	07/79	1986	(d)
241-BX-110	1976	-- (6)		08/85	1989	(g)
241-BX-111	1984 (13)	-- (6)		03/95	1993	(g)
241-BY-103	1973	<5000		11/97	1983	(a)
241-BY-105	1984	-- (6)		N/A	1989	(g)
241-BY-106	1984	-- (6)		N/A	1989	(g)
241-BY-107	1984	15100 (8)		07/79	1989	(g)
241-BY-108	1972	<5000		02/85	1983	(a)
241-C-101	1980	20000 (8)(10)		11/83	1986	(d)
241-C-110	1984	2000		05/95	1989	(g)
241-C-111	1968	5500 (8)		03/84	1989	(g)
241-C-201 (4)	1988	550		03/82	1987	(i)
241-C-202 (4)	1988	450		08/81	1987	(i)
241-C-203	1984	400 (8)		03/82	1986	(d)
241-C-204 (4)	1988	350		09/82	1987	(i)
241-S-104	1968	24000 (8)		12/84	1989	(g)
241-SX-104	1988	6000 (8)		04/00	1988	(k)
241-SX-107	1964	<5000		10/79	1983	(a)
241-SX-108 (5)(14)	1962	2400 to 35000	17 to 140 (m)(q)(t)	08/79	1991	(m)(q)(t)
241-SX-109 (5)(14)	1965	<10000	<40 (n)(t)	05/81	1992	(n)(t)
241-SX-110	1976	5500 (8)		08/79	1989	(g)

Table 4-4. Single-Shell Tank Leak Volume Estimates (Sheet 2 of 2)

Tank Number	Confirmed or Assumed Leaker (3)	Volume Gallons (2)	Associated KiloCuries 137 Cs (9)	Interim Stabilized (11)	Leak Estimate	
					Updated	Reference
241-SX-111 (14)	1974	500 to 2000	0.6 to 2.4 (l)(q)(t)	07/79	1986	(d)(q)(t)
241-SX-112 (14)	1969	30000	40 (l)(t)	07/79	1986	(d)(t)
241-SX-113	1962	15000	8 (l)	11/78	1986	(d)
241-SX-114	1972	-- (6)		07/79	1989	(g)
241-SX-115	1965	50000	21 (o)	09/78	1992	(o)
241-T-101	1992	7500 (8)		04/93	1992	(p)
241-T-103	1974	<1000 (8)		11/83	1989	(g)
241-T-106	1973	115000 (8)	40 (l)	08/81	1986	(d)
241-T-107	1984	-- (6)		05/96	1989	(g)
241-T-108	1974	<1000 (8)		11/78	1980	(f)
241-T-109	1974	<1000 (8)		12/84	1989	(g)
241-T-111	1979, 1994 (12)	<1000 (8)		02/95	1994	(f)(r)
241-TX-105	1977	-- (6)		04/83	1989	(g)
241-TX-107 (5)	1984	2500		10/79	1986	(d)
241-TX-110	1977	-- (6)		04/83	1989	(g)
241-TX-113	1974	-- (6)		04/83	1989	(g)
241-TX-114	1974	-- (6)		04/83	1989	(g)
241-TX-115	1977	-- (6)		09/83	1989	(g)
241-TX-116	1977	-- (6)		04/83	1989	(g)
241-TX-117	1977	-- (6)		03/83	1989	(g)
241-TY-101	1973	<1000 (8)		04/83	1980	(f)
241-TY-103	1973	3000	0.7 (l)	02/83	1986	(d)
241-TY-104	1981	1400 (8)		11/83	1986	(d)
241-TY-105	1960	35000	4 (l)	02/83	1986	(d)
241-TY-106	1959	20000	2 (l)	11/78	1986	(d)
241-U-101	1959	30000	20 (l)	09/79	1986	(d)
241-U-104	1961	55000	0.09 (l)	10/78	1986	(d)
241-U-110	1975	5000 to 8100 (8)	0.05 (q)	12/84	1986	(d)(q)
241-U-112	1980	8500 (8)		09/79	1986	(d)
67 Tanks						

N/A = Not applicable (not yet interim stabilized)

Table 4-4. - Footnotes:

- (1) Current estimates [see Reference (b)] are that 610 Kgallons of cooling water was added to tank A-105 from November 1970 to December 1978 to aid in evaporative cooling. In accordance with Dangerous Waste Regulations [Washington Administrative Code 173-303-070 (2)(a)(ii), as amended, Washington State Department of Ecology, 1990, Olympia, Washington], any of this cooling water that has been added and subsequently leaked from the tank must be classified as a waste and should be included in the total leak volume. In August 1991, the leak volume estimate for this tank was updated in accordance with the WAC regulations. Previous estimates excluded the cooling water leaks from the total leak volume estimates because the waste content (concentration) in the cooling water which leaked should be much less

Table 4-4. - Footnotes continued

than the original liquid waste in the tank (the sludge is relatively insoluble). The total leak volume estimate in this report (10 to 277 Kgallons) is based on the following (see References):

- a. Reference (b) contains an estimate of 5 to 15 Kgallons for the initial leak prior to August 1968.  
  
Reference (b) contains an estimate of 5 to 30 Kgallons for the leak while the tank was being sluiced from August 1968 to November 1970.  
  
Reference (b) contains an estimate of 610 Kgallons of cooling water added to the tank from November 1970 to December 1978, but it was estimated that the leakage was small during this period. This reference contains the statement "Sufficient heat was generated in the tank to evaporate most, and perhaps nearly all, of this water." This results in a low estimate of zero gallons leakage from November 1970 to December 1978.
- b. Reference (c) contains an estimate that 378 to 410 Kgallons evaporated out of the tank from November 1970 to December 1978. Subtracting the minimum evaporation estimate from the cooling water added estimate provides a range from 0 to 232 Kgallons of cooling water leakage from November 1970 to December 1978.

	<u>Low Estimate</u>	<u>High Estimate</u>
Prior to August 1968	5,000	15,000
August 1968 to November 1970	5,000	30,000
November 1970 to December 1978	<u>0</u>	<u>232,000</u>
Totals	10,000	277,000

- (2) These leak volume estimates do not include (with some exceptions), such things as: (a) cooling/raw water leaks, (b) intrusions (rain infiltration) and subsequent leaks, (c) leaks inside the tank farm but not through the tank liner (surface leaks, pipeline leaks, leaks at the joint for the overflow or fill lines, etc.), and (d) leaks from catch tanks, diversion boxes, encasements, etc.
- (3) In many cases, a leak was suspected long before it was identified or confirmed. For example, Reference (d) shows that tank U-104 was suspected of leaking in 1956. The leak was confirmed in 1961. This report lists the "assumed leaker" date of 1961. Using present standards, tank U-104 would have been declared an assumed leaker in 1956. In 1984, the criteria designations of "suspected leaker," "questionable integrity," "confirmed leaker," "declared leaker," and "borderline and dormant" were merged into one category now reported as "assumed leaker." See Reference (f) for explanation of when, how long, and how fast some of the tanks leaked. It is highly likely that there have been undetected leaks from single-shell tanks because of the nature of their design and instrumentation.
- (4) The leak volume estimate date for these tanks is before the declared leaker date because the tank was in a suspected leaker or questionable integrity status; however, a leak volume had been estimated prior to the tank being reclassified.
- (5) The increasing radiation levels in drywells and laterals associated with these three tanks could be indicating continuing leak or movement of existing radionuclides in the soil. There is no conclusive way to confirm these observations. (Repeat spectral drywell scans are not part of the current Tank Farm leak detection program but can be run on request a special needs arise. A select subset of drywells is routinely monitored by the Vadose Zone Characterization Project to assess movement of gamma-emitting radionuclides in the subsurface. There are currently no functioning laterals and no plan to prepare them for use).
- (6) Methods were used to estimate the leak volumes from these 19 tanks based on the assumption that their cumulative leakage is approximately the same as for 18 of the 24 tanks identified in footnote (9). For more details see Reference (g). The total leak volume estimate for these tanks is 150 Kgallons (rounded to the nearest Kgallon), for an average of approximately 8 Kgallons for each of 19 tanks.
- (7) The total has been rounded to the nearest 50 Kgallons. Upper bound values were used in many cases in developing these estimates. It is likely that some of these tanks have not actually leaked.
- (8) Leak volume estimate is based solely on observed liquid level decreases in these tanks. This is considered to be the most accurate method for estimating leak volumes.
- (9) The curie content shown is as listed in the reference document and is not decayed to a consistent date: therefore, a cumulative total is inappropriate.

Table 4-4. - Footnotes continued

- (10) Tank C-101 experienced a liquid level decrease in the late 1960s and was taken out of service and pumped to a minimum heel in December 1969. In 1970, the tank was classified as a “questionable integrity” tank. Liquid level data show decreases in level throughout the 1970s and the tank was saltwell pumped during the 1970s, ending in April 1979. The tank was reclassified as a “confirmed leaker” in January 1980. See References (q) and (r); refer to Reference (s) for information on the potential for there to have been leaks from other C-farm tanks (specifically, C-102, C-103, and C-109).
- (11) These dates indicate when the tanks were declared to be interim stabilized. In some cases, the official interim stabilization documents were issued at a later date. Also, in some cases, the field work associated with interim stabilization was completed at an earlier date.
- (12) Tank T-111 was declared an “assumed re-leaker” on February 28, 1994, due to a decreasing trend in surface level measurement. This tank was pumped, and interim stabilization completed on February 22, 1995.
- (13) Tank BX-111 was declared an “assumed re-leaker” in April 1993. Preparations for pumping were delayed, following an administrative hold placed on all tank farm operations in August 1993. Pumping resumed and the tank was declared interim stabilized on March 15, 1995.
- (14) The leak volume and curie release estimates on tanks SX-108, SX-109, SX-111, and SX-112 have been re-evaluated using a Historical Leak Model [see Reference (t)]. In general, the model estimates are much higher than the values listed in the table, both for volume and curies released. The values listed in the table do not reflect this revised estimate because, “In particular, it is worth emphasizing that this report was never meant to be a definitive update for the leak baseline at the Hanford Site. It was rather meant to be an attempt to view the issue of leak inventories with a new and different methodology.” (This quote is from the first page of the referenced report).
- (15) Tri-Party Agreement milestones (M-45 series) were developed that establish a formalized approach for evaluating impacts on groundwater quality of loss of tank wastes to the vadose zone underlying these tank farms.

SST Vadose Zone Project drilling and testing activities near tank BX-102 were completed in March 2001. A borehole (299-E33-45) was drilled through the postulated uranium plume resulting from the 1951 tank BX-102 overfill event to confirm the presence of uranium, define its present depth, and survey other contaminants of interest such as Tc-99. Samples were collected for laboratory analyses.

Borehole W33-46, adjacent to tank B-110, was drilled to a depth of approximately 190 feet in July 2001. Soil samples were collected for analysis as part of the tank farm vadose zone characterization activities.

On July 31, 2002, the Washington State Department of Ecology issued a letter-directive which suggested a path forward in dealing with the high <sup>99</sup>Tc activity in groundwater at well 299-W23-19 near tank SX-115. No formal remediation is required, however, extensive purging of the well is to be done concurrent with quarterly sampling. In addition, an array of specific conductivity probes is to be placed in the well to monitor the electrical properties of the water (<sup>99</sup>Tc activity is directly proportional to electrical conductivity). A data logger with remote reading capability together with the specific conductivity probes was installed and fully operational on March 11, 2003.

Table 4-4. - References:

- (a) Murthy, K. S., et al., June 1983, *Assessment of Single-Shell Tank Residual Liquid Issues at Hanford Site, Washington*, PNL-4688, Pacific Northwest Laboratory, Richland, Washington.
- (b) WHC, 1991a, *Tank 241-A-105 Leak Assessment*, WHC-MR-0264, Westinghouse Hanford Company, Richland, Washington.
- (c) WHC, 1991b, *Tank 241-A-105 Evaporation Estimate 1970 Through 1978*, WHC-EP-0410, Westinghouse Hanford Company, Richland, Washington.
- (d) Smith, D. A., January 1986, *Single-Shell Tank Isolation Safety Analysis Report*, SD-WM-SAR-006, Rev. 1, Rockwell Hanford Operations, Richland, Washington.
- (e) McCann, D. C., and T. S. Vail, September 1984, *Waste Status Summary*, RHO-RE-SR-14, Rockwell Hanford Operations, Richland, Washington.
- (f) Catlin, R. J., March 1980, *Assessment of the Surveillance Program of the High-Level Waste Storage Tanks at Hanford*, Office of Environmental Compliance and Review, for the U.S. Department of Energy, Washington D.C.
- (g) Baumhardt, R. J., May 15, 1989, Letter to R. E. Gerton, U.S. Department of Energy-Richland Operations Office, *Single-Shell Tank Leak Volumes*, 8901832B R1, Westinghouse Hanford Company, Richland, Washington.
- (h) WHC, 1990a, Occurrence Report, *Surface Level Measurement Decrease in Single-Shell Tank 241-AX-102*, WHC-UO-89-023-TF-05, Westinghouse Hanford Company, Richland, Washington.
- (i) Groth, D. R., July 1, 1987, Internal Memorandum to R. J. Baumhardt, *Liquid Level Losses in Tanks 241-C-201, -202 and -204*, 65950-87-517, Westinghouse Hanford Company, Richland, Washington.
- (j) Groth, D. R., and G. C. Owens, May 15, 1987, Internal Memorandum to J. H. Roecker, *Tank 103-A Integrity Evaluation*, Rockwell Hanford Operations, Richland, Washington.
- (k) Dunford, G. L., July 8, 1988, Internal Memorandum to R. K. Welty, *Engineering Investigation: Interstitial Liquid Level Decrease in Tank 241-SX-104*, 13331-88-416, Westinghouse Hanford Company, Richland, Washington.
- (l) ERDA, 1975, *Final Environmental Statement Waste Management Operations, Hanford Reservation, Richland, Washington*, ERDA-1538, 2 vols., U.S. Energy Research and Development Administration, Washington, D.C.
- (m) WHC, 1992a, *Tank 241-SX-108 Leak Assessment*, WHC-MR-0300, Westinghouse Hanford Company, Richland, Washington.
- (n) WHC, 1992b, *Tank 241-SX-109 Leak Assessment*, WHC-MR-0301, Westinghouse Hanford Company, Richland, Washington.
- (o) WHC, 1992c, *Tank 241-SX-115 Leak Assessment*, WHC-MR-0302, Westinghouse Hanford Company, Richland, Washington.
- (p) WHC, 1992d, Occurrence Report, *Apparent Decrease in Liquid Level in Single Shell Underground Storage Tank 241-T-101, Leak Suspected; Investigation Continuing*, RL-WHC-TANKFARM-1992-0073, Westinghouse Hanford Company, Richland, Washington.
- (q) WHC, 1990b, *A History of the 200 Area Tank Farms*, WHC-MR-0132, Westinghouse Hanford Company, Richland, Washington.
- (r) WHC, 1993, *Assessment of Unsaturated Zone Radionuclide Contamination Around Single-Shell Tanks 241-C-105 and 241-C-106*, WHC-SD-EN-TI-185, REV OA, Westinghouse Hanford Company, Richland, Washington.
- (s) WHC, 1994, Occurrence Report, *Apparent Liquid Level Decrease in Single Shell Underground Storage Tank 241-T-111; Declared an Assumed Re-Leaker*, RL-WHC-TANKFARM-1994-0009, Westinghouse Hanford Company, Richland, Washington.

Table 4-4. - References continued

- (t) HNF, 1998, Agnew, S. F., and R. A. Corbin, August 1998, *Analysis of SX Farm Leak Histories - Historical Leak Model (HLM)*, HNF-3233, Rev. 0, Los Alamos National Laboratory, Los Alamos, New Mexico.

**5.0 MISCELLANEOUS UNDERGROUND STORAGE TANKS AND SPECIAL SURVEILLANCE FACILITIES**

**Table 5-1. East and West Area Miscellaneous Underground Storage Tanks and Special Surveillance Facilities.**

ACTIVE - still running transfers through the associated diversion boxes or pipeline encasements					
Facility	Location	Receives Waste From:	Waste (Gallons)	Monitored By:	Remarks
<b>EAST AREA</b>					
241-A-302-A	A Farm	A-151 DB	648	SACS/ENRAF/TMACS	
241-ER-311	B Plant	ER-151, ER-152 DB	3900	SACS/ENRAF/Manual	
241-AZ-151	AZ Farm	AZ-702 Condensate	8586	SACS/ENRAF/TMACS	Volume changes daily - pumped to AZ-101 or AY-102 as needed
241-AZ-154	AZ Farm		25	SACS/MT	
244-BX-TK-SMP	BX Complex	DCRT - Receives from several farms	18253	SACS/MT	Receives transfers and is pumped as needed
244-A-TK/SMP	A Complex	DCRT - Receives from several farms	3864	MCS/SACS/WTF	WTF - Receives transfers and is pumped as needed
A-350	A Farm	Collects drainage	401	MCS/SACS/WTF	WTF (uncorrected), pumped as needed
AR-204	AY Farm	Tanker trucks from various facilities	775	DIP TUBE	
A-417	A Farm		1176	SACS/WTF	WTF - Pumped to AP-102, 3/03
CR-003-TK-SMP	C Farm	DCRT	2936	MT/ZIP CORD	Zip cord in sump O/S; water intrusion, 1/98
<b>WEST AREA</b>					
241-TX-302-C	T Plant	TX-154 DB	174	SACS/ENRAF/TMACS	
241-U-301-B	U Farm	U-151, 152, 153, 252 DB	8191	SACS/ENRAF/Manual	
241-UX-302-A	U Plant	UX-154	1454	SACS/ENRAF/Manual	Rain intrusion 2/03; recalibration caused decrease 6/03
241-S-304	S Farm	S-151 DB	135	SACS/ENRAF/Manual	Sump not alarming
244-S-TK/SMP	S Farm	From SSTs for transfer to SY-102	6941	SACS/Manual	WTF (uncorrected)
244-TX-TK/SMP	TX Farm	From SSTs and PFP for transfer to SY-102	4848	SACS/Manual	Transferred to SY-102, 6/03
Vent Station Catch Tank		Cross Site Transfer Line	443	SACS/Manual	MT. Rain intrusion, 1/03
<b>Total Active Facilities - 17</b>					

LEGEND:	
DB	Diversion Box
DCRT	Double-Contained Receiver Tank
ENRAF, MT, Zip Cord	Surface Level Measurement Devices
MCS	Monitor and Control System
Manual	Not connected to any automated system
O/S	Out of Service
PFP	Plutonium Finishing Plant
SACS	Surveillance Automated Control System
SST	Single-Shell Tank
TMACS	Tank Monitor and Control System
WTF	Weight Factor (can be recorded as WTF, WTF [uncorrected] or CWF [uncorrected])

Table 5-2. East Area Inactive Miscellaneous Underground Storage Tanks and Special Surveillance Facilities.

INACTIVE - No longer receiving waste transfers - currently managed by Tank Farm Contractor					
Facility	Location	Received Waste From:	Waste (Gallons)	Monitored By:	Remarks
209-E-TK-111	209 E Bldg.	Decon Catch Tank	Unknown	NM	Removed from service 1988
241-A-302-B	A Farm	A-152 DB	5837	SACS/MT	Isolated 1985, Project B-138, Interim Stabilized 1990, rain intrusion
241-AX-151	N. of PUREX	PUREX	Unknown	NM	Isolated 1985
241-AX-152	AX Farm	AX-152 DB	0	SACS/MT	Declared Assumed Leaker, pumped to AY-102, 3/01, no longer being used
241-B-301-B	B Farm	B-151, 152, 153, 252 DB	22250	NM	Isolated 1985 (1)
241-B-302-B	B Farm	B-154 DB	4930	NM	Isolated 1985 (1)
241-BX-302-A	BX Farm	BR-152, BX-153, BXR-152, BYR-152 DB	840	NM	Isolated 1985 (1)
241-BX-302-B	BX Farm	BX-154 DB	1040	NM	Isolated 1985 (1)
241-BX-302-C	BX Farm	BX-155 DB	870	NM	Isolated 1985 (1)
241-BY-ITS2-TK 1	BY Farm	Vapor condenser	Unknown	NM	Isolated
241-BY-ITS2-TK 2	BY Farm	Heater Flush Tank	Unknown	NM	Stabilized 1977
241-C-301-C	C Farm	C-151, 152, 153, 252 DB	10470	NM	Isolated 1985 (1)
241-ER-311A	SW of B Plant	ER-151 DB	Empty	NM	Abandoned in place 1954
241-AR Vault	A Complex	Between farms and B Plant	Unknown	NM	Stabilized 8/03, RPP-12051
241-BXR-TK/SMP-001	BX Farm	Transfer lines	7200	NM	Interim Stabilization 1985 (1)
241-BXR-TK/SMP-002	BX Farm	Transfer Lines	2180	NM	Interim Stabilization 1985 (1)
241-BXR-TK/SMP-003	BX Farm	Transfer Lines	1810	NM	Interim Stabilization 1985 (1)
241-BXR-TK/SMP-004	BX Farm	Transfer Lines	7100	NM	Interim Stabilization 1985 (1)
Total East Area Inactive Facilities - 18					

LEGEND:	
DB	Diversion Box
MT	Surface Level measurement Device
NM	Not Monitored
SACS	Surveillance Automated Control System
TK, SMP	Tank, Sump

(1) WHC-SD-WM-TI-356, *Waste Storage Tank Status and Leak Detection Criteria*, Rev. 0, September 30, 1988

Table 5-3. West Area Inactive Miscellaneous Underground Storage Tanks and Special Surveillance Facilities.


INACTIVE - No longer receiving waste transfers - currently managed by Tank Farm Contractor					
Facility	Location	Received Waste From:	Waste (Gallons)	Monitored By:	Remarks
213-W-TK-1	E. of 213-W Compactor Facility	Water Retention Tank	Unknown	NM	Contains only water
231-W-151-001	N. of Z Plant	231-Z Floor drains	Unknown	NM	Inactive, last data 1974
231-W-151-002	N. of Z Plant	231-Z Floor drains	Unknown	NM	Inactive, last data 1974
240-S-302	S Plant	240-S-151-DB	8218		Assumed Leaker, EPDA 85-04
241-S-302-A	S Farm	241-S-151-DB	0		Assumed Leaker TF-EFS-90-042
	Partially filled with grout 2/91, determined to be an Assumed Leaker after intrusion readings obtainable. S-304 (active) replaced S-302				
241-S-302-B	SX Farm	S Encasements	Empty	NM	Isolated 1985 (1)
241-SX-302 (SX-304)	SX Farm	SX-151 DB, 151 TB	Unknown	NM	Isolated 1987
241-T-301	T Farm	DB T-151, 151, 153, 252	Unknown	NM	Isolated 1985 (T-301-B)
241-TX-302	TX Farm	TX-153 DB	Unknown	NM	Isolated 1985 (1)
241-TX-302-X-B	TX Farm	TX Encasements	Unknown	NM	Isolated 1985 (1)
241-TX-302-B	E. of TX Farm	TX-155 DB	3256	SACS/ENRAF	New ENRAF installed 9/02
241-TX-302-B(R)	E. of TX Farm	TX-155 DB	Unknown	NM	Isolated, replaced TX-302-B
241-TY-302-A	TY Farm	TX-153 DB	Unknown	NM	Isolated 1985 (1)
241-TY-302-B	TY Farm	TY Encasements	Empty	NM	Isolated 1985 (1)
241-Z-8	E. of Z Plant	Recuplex waste	Unknown	NM	Isolated, 1974, 1975
242-T-135	T Evaporator	T Evaporator	Unknown	NM	Isolated
242-TA-R1	T Evaporator	Z Plant waste	Unknown	NM	Isolated
243-S-TK-1	NW of S Farm	Personnel Decon. Facility	Empty	NM	Isolated
244-TXR-TK/SMP-001	TX Farm	Transfer lines	Unknown	NM	Interim Stabilized, MT removed 1984 (1)
244-TXR-TK/SMP-002	TX Farm	Transfer lines	Unknown	NM	Interim Stabilized, MT removed 1984 (1)
244-TXR-TK/SMP-003	TX Farm	Transfer lines	Unknown	NM	Interim Stabilized, MT removed 1984 (1)
244-UR-001 Vault TK	U Farm	Tank, Sump and Cell	4220	NM	Stabilized 1985
244-UR-002 Vault TK	U Farm	Tank, Sump and Cell	1400	NM	Stabilized 1985
244-UR-003 Vault TK	U Farm	Tank, Sump and Cell	5996	NM	Stabilized 1985
244-UR-004 Vault TK	U Farm	Tank, Sump and Cell	Empty	NM	Stabilized 1985
Total East Area Inactive Facilities - 25					

LEGEND:	
DB, TD	Diversion Box, Transfer Box
FIC, ENRAF	Surface Level Measurement Devices
MT	Manual Tape - Surface Level measurement Device
NM	Not Monitored
SACS	Surveillance Automated Control System
TK, SMP	Tank, Sump
SACS	Surveillance Automated Control System
TK, SMP	Tank, Sump

(1) WHC-SD-WM-TI-356, Waste Storage Tank Status and Leak Detection Criteria, Rev. 0, September 30, 1988

APPENDIX A - TANK CONFIGURATION AND FACILITIES CHARTS

Figure A-1. High Level Waste Tank Configurations

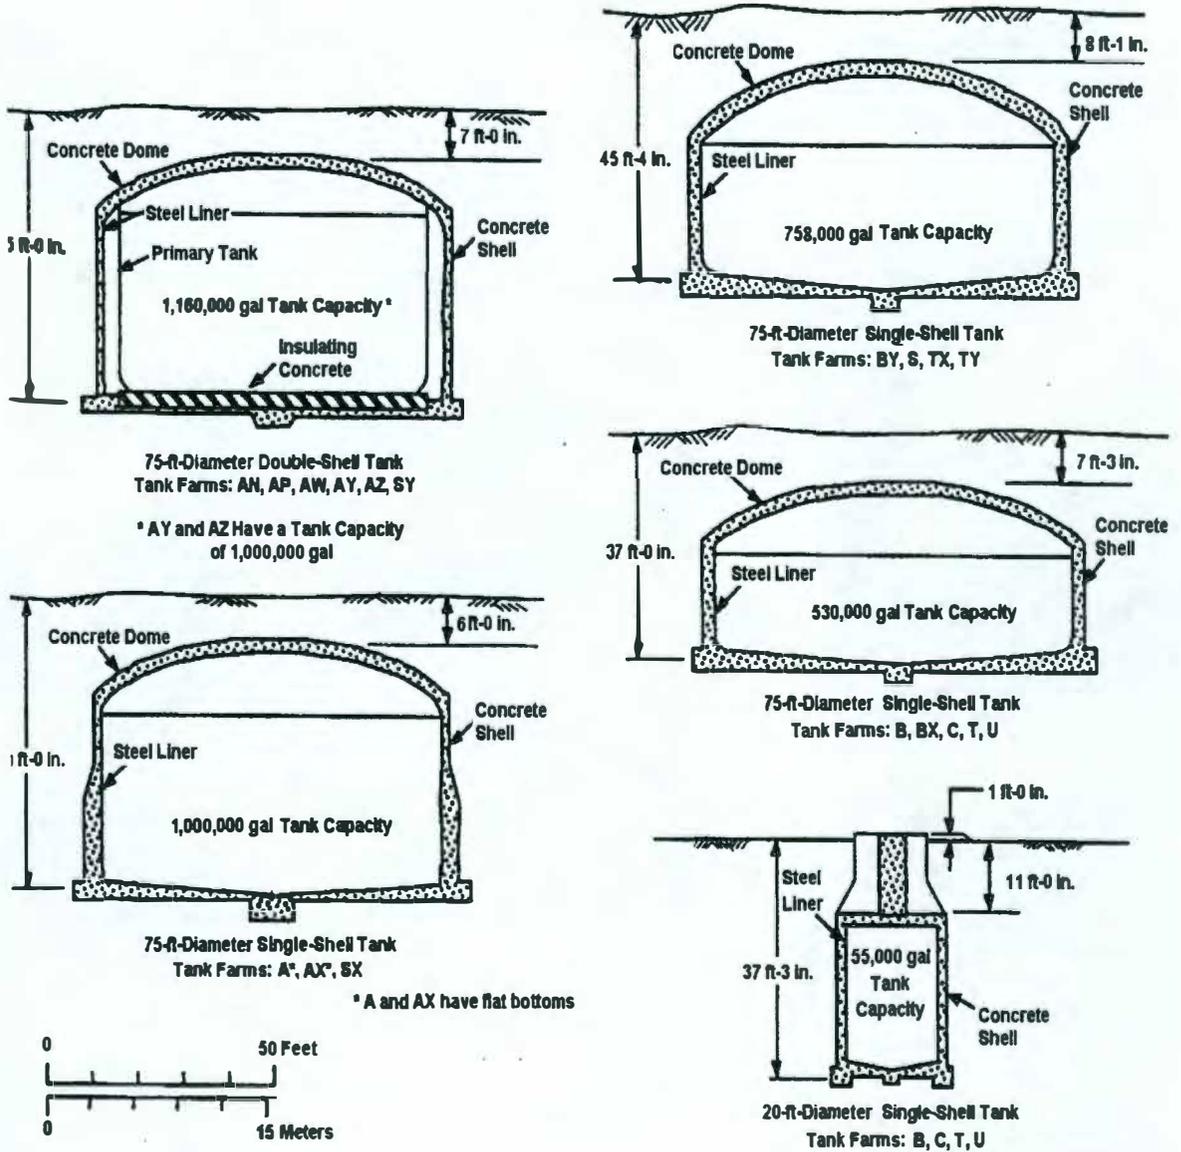

29103062.1a

Figure A-2. Double-Shell Tank Instrumentation Configuration


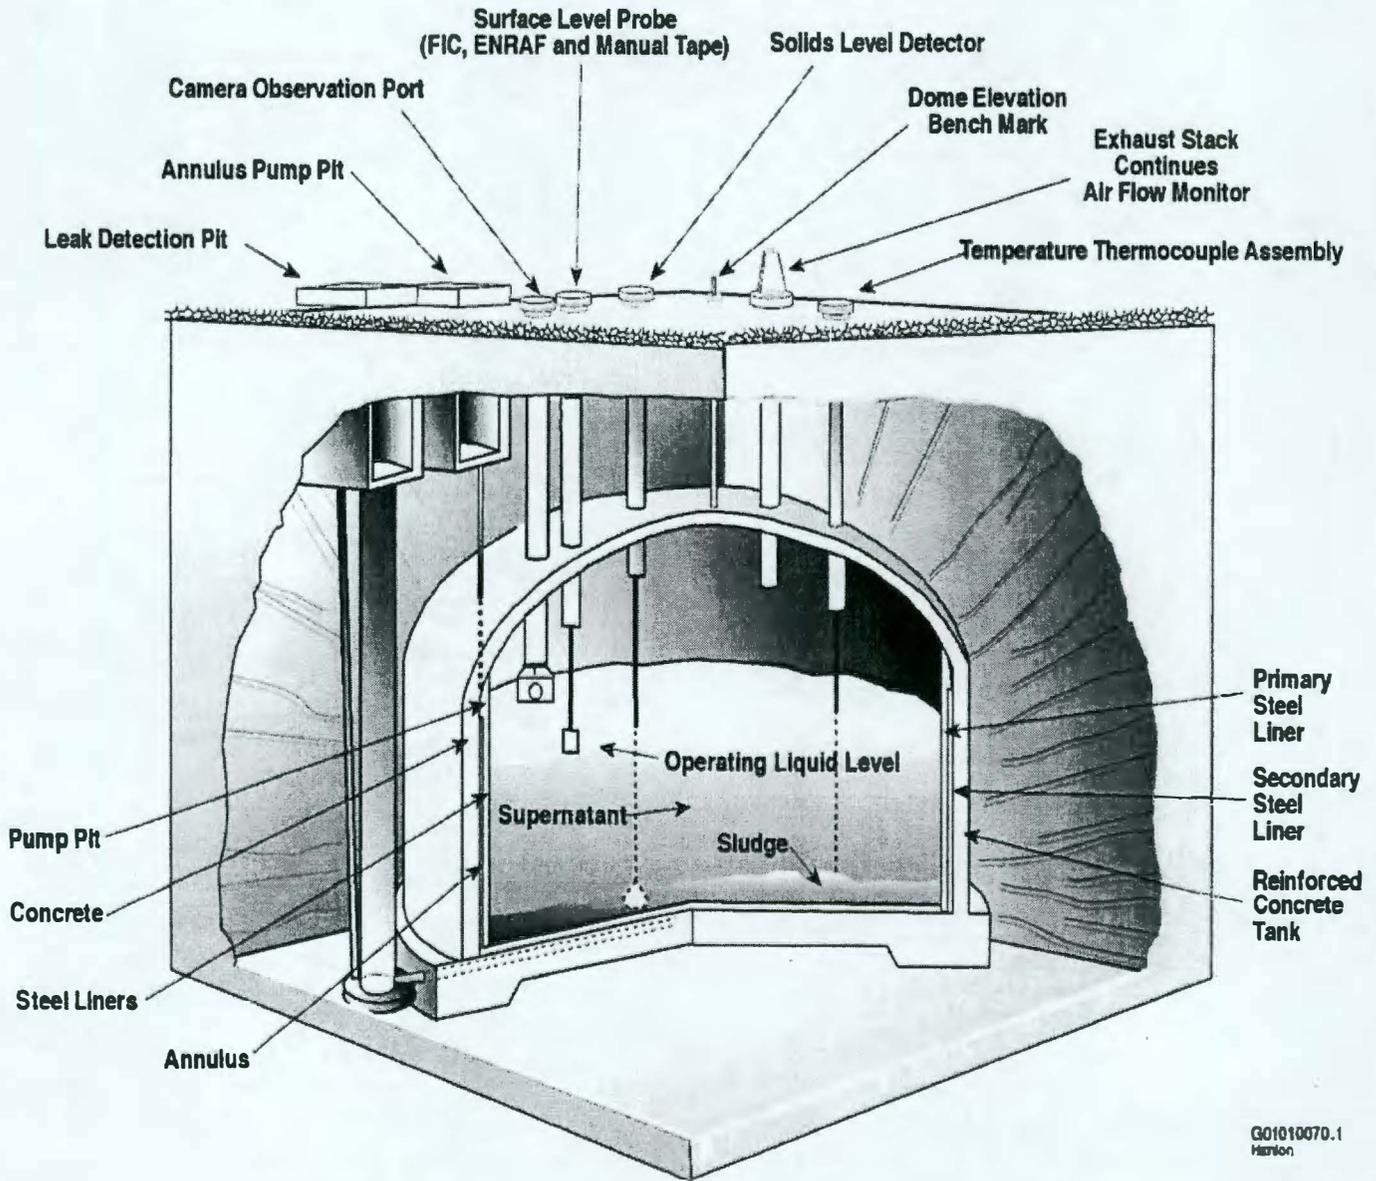


Figure A-3. Single-Shell Tank Instrumentation Configuration

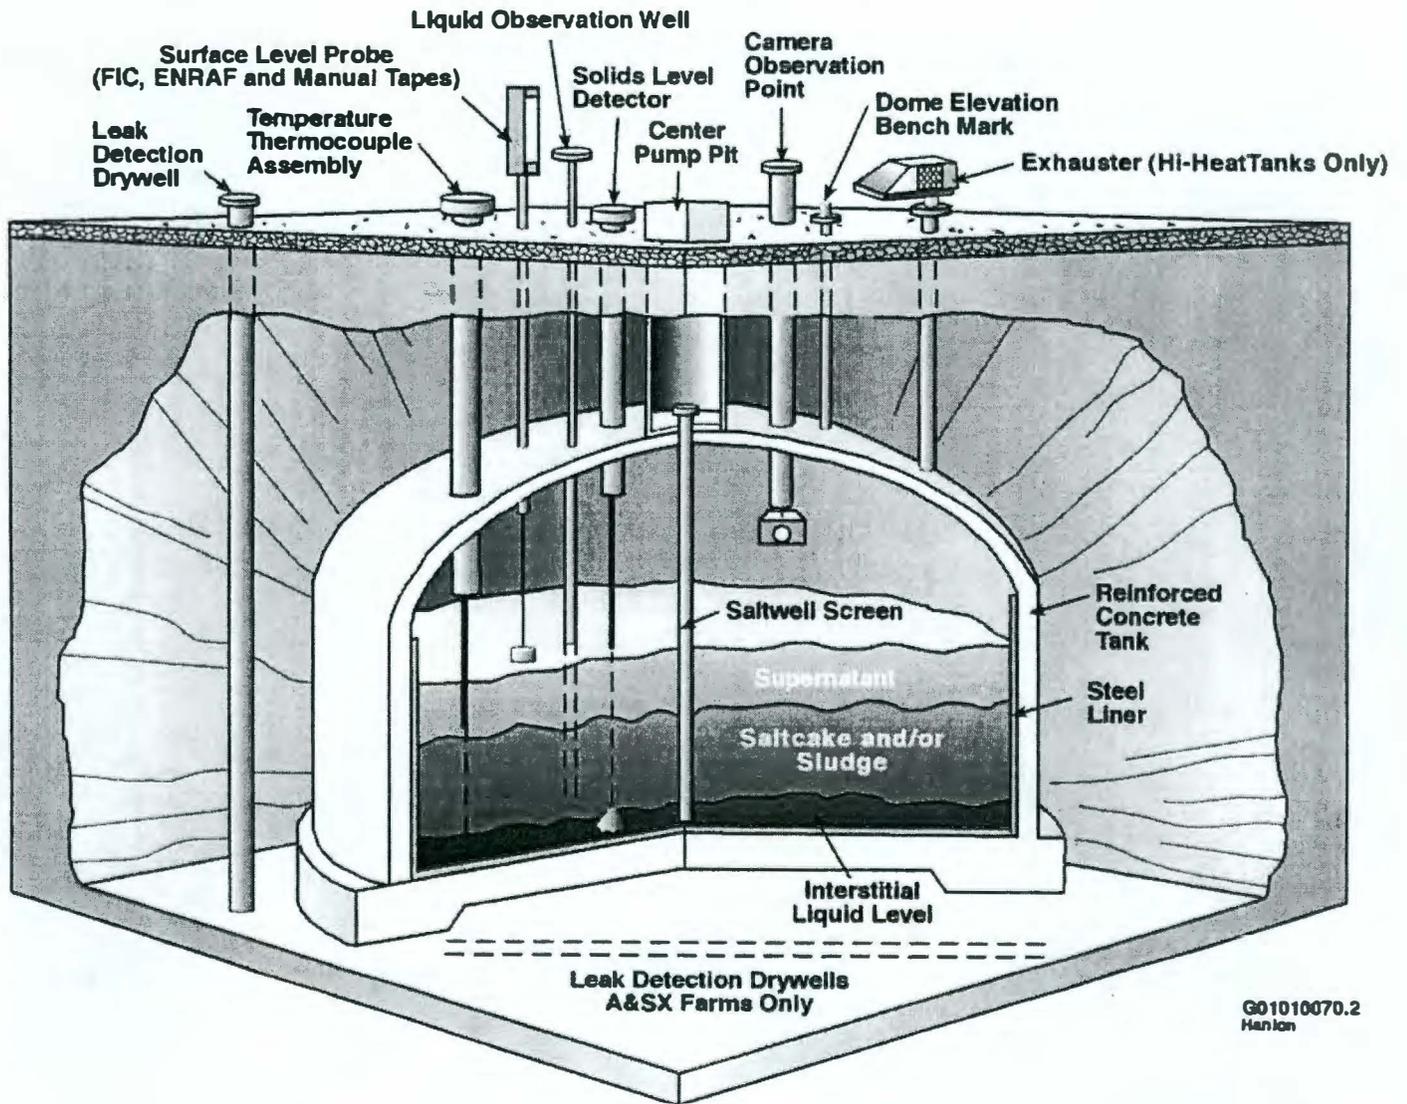

**DISTRIBUTION LIST**

Number of copies

OFFSITE - USA

2

**Congress of the United States**

U.S. Senate  
717 Hart Senate Building  
Washington D.C. 20510

Senator Ron Wyden

U.S. House of Representatives  
1323 Longworth House Office Building  
Washington D. C. 20515

Congressman Richard "Doc" Hastings, 4th District  
Atten: Jeff Markey

2

**U.S. Department of Energy-Headquarters**

1000 Independence Avenue, SW  
Washington, D. C. 20585

Harry Calley

EM-44 Cloverleaf Bldg.

**U.S. Department of Energy-Headquarters**

19901 Germantown Rd  
Germantown, MD 20874

Kurt Juroff

EM-22 Cloverleaf Bldg.

1

**Washington State Department of Ecology**

Nuclear Waste Program  
P. O. Box 47600  
Olympia, WA 98504-7600

Roger Stanley

1

**Washington State Department of Health**

Radiation Protection  
7171 Cleanwater Lane  
P. O. Box 47827  
Olympia, WA 98504-7827

Allen W. Conklin

1

**Oregon State Office of Energy**

625 Marion St. NE, Suite 1  
Salem, OR 97301

Dirk Dunning

Do not remove from distribution without permission from ODOE



	S. H. Pfaff	H6-60
	W. Hewitt (YAHSGS)	H6-60
	D. H. Irby	H6-60
	C. S. Louie	H6-60
	D. L. Noyes	H6-60
	Wen-Shou Liou	H6-60
	J. L. Polehn	H6-60
	R. A. Quintero	H6-60
	M. J. Royack	H6-60
	R. W. Russell III	H6-60
	A. J. Stevens	H6-60
	D. J. Williams	H6-60
	Reading Room	H2-53
4	<b><u>Bechtel National, Inc.</u></b>	
	P. J. Brackenbury (3)	H4-02/MS1-B
	Neil Brosee	H4-02/MS12-2B
3	<b><u>Pacific National Northwest Laboratories</u></b>	
	S. F. Bobrowski	K7-28
	F. L. Leverenz, Jr.	K6-04
	B. E. Opitz	K6-75
59	<b><u>CH2M HILL Hanford Group, Inc. and Affiliated Companies</u></b>	
	D. I. Allen	H6-03
	J. C. Allen-Floyd	H6-64
	D. B. Amerine	R2-50
	E. S. Aromi	H6-63
	J. J. Badden	S5-07
	M. V. Berriochoa	H6-04
	K. M. Bowen	R2-12
	J. M. Conner	S5-08
	Q. R. Decker	S4-44
	C. DeFigh-Price	R2-58
	M. A. Fish	R1-14
	R. A. Dodd	S7-83
	J. G. Field	R2-12
	K. D. Fowler	S5-08
	R. Frink	S4-43
	M. S. Gerber	B3-30
	B. M. Hanlon (6)	R1-14
	B. A. Hasty	H6-04
	K. L. Hennesay (6)	R1-10
	B. A. Higley	R2-12
	T. M. Hohl	R2-12
	T. E. Jones	E6-35
	M. R. Kembel	S5-07
	N. W. Kirch	R2-58
	M. A. Knight	R1-14
	J. S. Konyu	H6-64
	J. G. Kristofzski	H6-03
	J. A. Lechelt	S5-08
	V. E. Mehrer	R3-86
	A. N. Naiknimbalkar	R2-12

R. Ni	H6-03
S. L. Orcutt	R2-12
L. L. Payne	R1-14
R. S. Popielarczyk	H6-03
B. J. Rabe	S5-07
R. E. Raymond	H6-03
W. E. Ross	R2-50
T. L. Sams	S7-83
D. J. Saueressig	S7-20
L. M. Sasaki	S7-90
N. J. Scott-Proctor	S5-00
G. A. Stanton, Jr.	S7-03
J. A. Voogd	S4-43
Central Files	B1-07
200 West Shift Office	T4-00
200 East Shift Office	S7-02
Environmental	
Data Mgmt Center (2)	H6-08
Environmental Library	R1-51