

0050786


## ENGINEERING CHANGE NOTICE

Page 1 of 2

1. ECN 653800

Proj.  
ECN

2. ECN Category (mark one)  Supplemental <input type="checkbox"/> Direct Revision <input checked="" type="checkbox"/> Change ECN <input type="checkbox"/> Temporary <input type="checkbox"/> Standby <input type="checkbox"/> Supersedeure <input type="checkbox"/> Cancel/Void <input type="checkbox"/>	3. Originator's Name, Organization, MSIN, and Telephone No. Andrew M. Templeton, Data Assessment and Interpretation, R2-12, 373-5589		4. USQ Required? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	5. Date 05/25/99
	6. Project Title/No./Work Order No. Tank 241-AZ-101		7. Bldg./Sys./Fac. No. 241-AZ-101	8. Approval Designator N/A
	9. Document Numbers Changed by this ECN (includes sheet no. and rev.) WHC-SD-WM-ER-410, Rev. 0-B		10. Related ECN No(s). ECNs: 612282, 644480	11. Related PO No. N/A
12a. Modification Work  <input type="checkbox"/> Yes (fill out Blk. 12b) <input checked="" type="checkbox"/> No (NA Blks. 12b, 12c, 12d)	12b. Work Package No. N/A	12c. Modification Work Complete  N/A  Design Authority/Cog. Engineer Signature & Date	12d. Restored to Original Condition (Temp. or Standby ECN only) N/A  Design Authority/Cog. Engineer Signature & Date	
13a. Description of Change This ECN has been generated in order to update the document to reflect results of recent data/information evaluation.  Replace pages: ES-1 through ES-4, 5-13, 5-14, 6-1, 6-2, and 7-1 through 7-4				
13b. Design Baseline Document? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No				
14a. Justification (mark one) Criteria Change <input checked="" type="checkbox"/> Design Improvement <input type="checkbox"/> Environmental <input type="checkbox"/> Facility Deactivation <input type="checkbox"/> As-Found <input type="checkbox"/> Facilitate Const <input type="checkbox"/> Const. Error/Omission <input type="checkbox"/> Design Error/Omission <input type="checkbox"/>				
14b. Justification Details A tank characterization report page change revision is required to reflect the results of recent evaluation of data/information pertaining to adequacy of tank sampling for safety screening purposes (Reynolds et al. 1999, Evaluation of Tank Data for Safety Screening, HNF-4217, Rev. 0, Lockheed Martin Hanford Corporation, Richland, Washington).				
15. Distribution (include name, MSIN, and no. of copies) See attached distribution.				

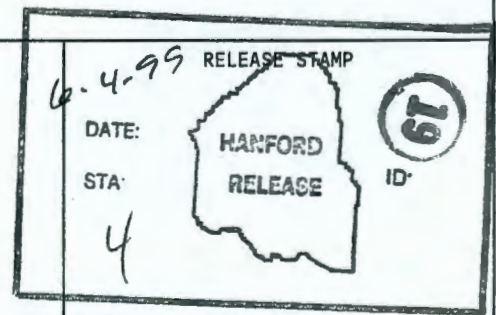

## Page 2 of 2

ECN-653800

20. Other Affected Documents: (NOTE: Documents listed below will not be revised by this ECN.) Signatures below indicate that the signing organization has been notified of other affected documents listed below.

Document Number/Revision	Document Number/Revision	Document Number Revision

N/A

[illegible]



## Tank Characterization Report for Double-Shell Tank 241-AZ-101

Andrew M. Templeton

Lockheed Martin Hanford Corp., Richland, WA 99352  
U.S. Department of Energy Contract 8023764-9-K001


EDT/ECN: ECN-653800 UC: 2070  
Org Code: 74B20 CACN/COA: 102217/EI00  
B&R Code: EW 3120074 Total Pages: 150


Key Words: Waste Characterization, Double-Shell Tank, DST, Tank 241-AZ-101, Tank AZ-101, AZ-101, AZ Farm, Tank Characterization Report, TCR, Waste Inventory, TPA Milestone M-44

Abstract: N/A

TRADEMARK DISCLAIMER. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof or its contractors or subcontractors.

Printed in the United States of America. To obtain copies of this document, contact: WHC/BCS Document Control Services, P.O. Box 1970, Mailstop H6-08, Richland WA 99352, Phone (509) 372-2420; Fax (509) 376-4989.

 6/4/99  
Release Approval Date

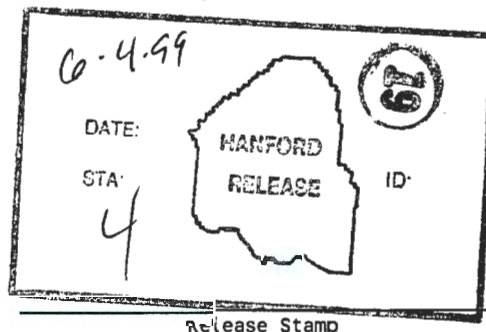

Approved for Public Release



## EXECUTIVE SUMMARY

This tank characterization report summarizes the information on the historical uses, status, and the sampling and analysis results of waste stored in the double-shell underground storage tank 241-AZ-101. This report supports the requirement of the *Hanford Federal Facility Agreement and Consent Order*, milestone M-44-08 (Ecology et al. 1994).

Tank 241-AZ-101 is located in the AZ Tank Farm in the 200 East Area of the Hanford Site. The tank, which went into service in 1976, is one of four double-shell tanks designated as aging waste tanks. It was constructed to store neutralized current acid waste, a high-level waste that originated from the reprocessing of irradiated nuclear fuel in the PUREX Plant. Tank 241-AZ-101 first received water in the fourth quarter of 1976. During the next seven years, the tank received a mixture of evaporator feed, double-shell slurry feed, complexed, noncomplexed, and dilute noncomplexed waste from PUREX miscellaneous streams. From 1984 through 1986, tank 241-AZ-101 received aging waste from the PUREX Plant exclusively. The remainder of the fill history of tank 241-AZ-101 consists of a series of small additions of water and dilute noncomplexed waste from tanks 241-AY-102 and 241-AZ-102.

A description and status of the tank are summarized in Tables ES-1 and ES-2 and Figures ES-1 and ES-2. Because the tank is active and could be receiving or transferring water, the volume of supernate and composition of the supernate will likely change. The tank, which has a design capacity of 3,790 kiloliters (kL) (1,000 kilogallons [kgal]), presently contains



3,630 kL (960 kgal) of waste in the form of supernate and sludge. When last measured, it contained 3,500 kL (925 kgal) of supernate (March 1995) and 130 kL (35 kgal) of sludge (September 1990).

This report summarizes three sampling and analysis events. Sludge composition and properties are based upon core samples taken from the tank in April and May 1989. Supernate composition is based on grab samples taken in March 1995 to evaluate waste compatibility. The core samples were taken before the data quality objective process was implemented; therefore, the data may not fully comply with the recent requirements of the waste compatibility data quality objective. The tank was sufficiently sampled to satisfy the requirements of safety screening (Reynolds et al. 1999).

Even though the fuel content of the waste has not been measured by differential scanning calorimetry, the total organic carbon, and the historical uses of the tank suggest that excessive fuel is not present. If the sludge is sampled again, the analyses should include an evaluation of the fuel content by differential scanning calorimetry to confirm the fuel estimates based on historical information and total organic carbon analysis. About 96 percent of the waste is supernate, and the moisture level of the driest sludge is 41.1 percent water, well above the 17 percent safety screening minimum (Babad and Redus 1994). The heat generated by radioactivity in the tank is estimated to be 241,600 British thermal units per hour (Btu/hr)(70,700 watts). The maximum heat load limit for this tank is  $4.E+06$  Btu/hr. The maximum temperature of the tank ranged from 74.4 to 84.4 °C (166 to 184 °F) for

December 1993 through December 1994. The  $^{239/240}\text{Pu}$  levels in the sludge were significantly lower than the criticality safety criterion. Based upon this information, the waste does not

Table ES-1. Tank 241-AZ-101.

Tank Description	
Type	Double shell
Constructed	1971 to 1977
In-Service	1976 <sup>1</sup>
Diameter	23 meters (m) or 75 feet (ft)
Usable depth	11 m (35 ft)
Design capacity	3,790 kiloliters (kL) or 1,000 kilogallons (kgal)
Bottom shape	Flat
Ventilation	Operating exhauster
Tank Status	
Total waste volume (March 1995)	3,630 kL (960 kgal)
Sludge volume (September 1990)	130 kL (35 kgal)
Supernatant volume (March 1995)	3,500 kL (925 kgal)
Surface level (March 1995)	886 centimeters (349 inches)
Maximum temperature (December 1993 to December 1994)	74.4 °C - 84.4 °C (166 °F - 184 °F)
Integrity	Sound
Sampling Dates	
Two samples	October 1987
Two core samples	April/May 1989
Four grab samples	March 1995
Service Status	
Active service	

<sup>1</sup>The tank received only water during 1976.



Table ES-2. Double-Shell Tank 241-AZ-101 Concentrations and Inventories for Major Analytes of Concern (from Table 4-2).

Physical Properties	Sludge Results <sup>1</sup>		Liquid Results <sup>2</sup>	
Density (g/milliliter [mL])	Core 1 1.28 Core 2 1.67		1.19	
Percent Water <sup>3</sup>	Core 1 41.1 Core 2 45		73.8 (Gravimetric) 73.0 (Thermogravimetric)	
pH	13.6		13.6	
Heat Load	241,600 British thermal units (70,700 watts)			
Chemical Constituents	Sludge Concentration (μg/g)	Sludge Inventory (kg)	Liquid Concentration (μg/g)	Liquid Inventory (kg)
Metals				
Al (Aluminum)	24,200	5,320	7,830	32,600
Cd (Cadmium)	4,920	1,070	---	---
Fe (Iron)	87,200	19,100	< 8.40	< 35.0
K (Potassium)	5,700	1,260	---	---
Mn (Manganese)	2,650	4,260	---	---
Na (Sodium)	79,000	17,300	80,000	333,000
Si (Silicon)	5,150	1,130	---	---
U (Uranium)	4,910	1,070	---	---
Zr (Zirconium)	30,900	6,720	---	---
Ions				
NO <sub>2</sub> <sup>-</sup> (Nitrite)	43,200	9,410	47,700	199,000
NO <sub>3</sub> <sup>-</sup> (Nitrate)	45,800	10,100	55,500	231,000
SO <sub>4</sub> <sup>2-</sup> (Sulfate)	16,900	3,320	12,900	53,900
Organics				
Total Organic Carbon (μg C/g)	9,180	2,030	866	3,600
Radionuclides	μCi/g	Ci	μCi/g	Ci
<sup>241</sup> Am	302	66,600	< 0.0253	< 10.5
<sup>144</sup> Ce	20.8	3,750	---	---
<sup>137</sup> Cs	1,480	319,000	1,340	5.57E+06
<sup>239</sup> Pu	3.58	781	< 3.53E-05	< 0.147
<sup>240</sup> Pu	1.01	222		
<sup>106</sup> Ru	37.4	6,800	---	---
<sup>90</sup> Sr	33,400	6.02E+06	---	---

Notes: Ci = curies  
 kg = kilograms  
 $\mu\text{Ci/g}$  = microcuries per gram  
 $\mu\text{C/g}$  = micrograms of carbon per gram  
 $\mu\text{g/g}$  = micrograms per gram

<sup>1</sup>Based on 1989 Sampling and Analysis

<sup>2</sup>Based on 1995 Sampling and Analysis

<sup>3</sup>Based on weight percent total solids determination



Table 5-9. Tank 241-AZ-101 Sludge Projected Heat Load.

Radionuclides	Curies (Ci) (from Table 4-2)	Watts
<sup>241</sup> Am	66,600	2,190
<sup>144</sup> Ce	3,750	30
<sup>60</sup> Co	2,080	32
<sup>134</sup> Cs	821	8.4
<sup>137</sup> Cs	319,000	1,500
<sup>154</sup> Eu	22,300	201
<sup>240</sup> Pu	222	6.80
<sup>106</sup> Ru	6,800	65.6
<sup>125</sup> Sb	19,700	66.0
<sup>90</sup> Sr	6,020,000	40,400
Total watts		44,500

upon these analytical values, is still significantly lower than the safety screening criterion for criticality of 1 g/L. The criticality specifications also require the pH of waste to be greater than 8.0 when the plutonium inventory exceeds 10 kg, and the depth of the supernate liquid exceeds 30 cm. The supernate depth in tank 241-AZ-101 exceeds 30 cm and the Pu inventory is approximately 18 kg. The pH of the supernate is 13.6, which satisfies the criticality prevention specification.

The flammability of the gas in the tank head space is another safety screening consideration. Analysis of tank head space is outside the scope of this report.

Historical and analytical information do not show that the waste composition exceeds the safety criteria for water content, heat, or criticality. Even though the fuel content of the waste has not been measured, the values for DSC, TOC, and historical uses of the tank suggest that excessive fuel is not present. The tank was sufficiently sampled to satisfy the requirements of safety screening (Reynolds et al. 1999).

### 5.5.2 Operational Evaluation

The 1995 supernate sampling and analysis were performed to evaluate the compatibility of waste for transfer to another tank. Sampling and analysis requirements for assessing waste compatibility have been addressed in the *Waste Compatibility Data Quality Objectives* (Carothers 1994). This objective is based on safety and operational considerations. Operational considerations include pumpability, waste segregation, heat generation, tank waste type, and high phosphate waste. The 1995 supernate results are compared to the key compatibility criteria in Table 5-10 (results from Table 4-2). The assessment shows



Table 5-10. Compatibility Assessment for Tank 241-AZ-101 Supernate.

Parameter	Criteria	1995 Results
$^{239/240}\text{Pu}$	$< 0.05 \text{ g/gal } (0.8 \text{ } \mu\text{Ci/g})^1$	$< 3.53\text{E-}05 \text{ } \mu\text{Ci/g}$
Specific Gravity	$< 1.41$	1.19
Energetics	exotherm/endothrm $< 1$	No exotherm observed
Corrosivity <sup>2</sup>	$0.01 \text{ M} < [\text{OH}^-] < 8.0 \text{ M}$ $[\text{NO}_3^-] < 1.0 \text{ M}$ $0.011 \text{ M} < [\text{NO}_2^-] < 5.5$	$[\text{OH}^-] = 0.67 \text{ M}$ $[\text{NO}_3^-] = 1.06 \text{ M}$ $[\text{NO}_2^-] = 1.20 \text{ M}$
Transuranics	$< 100 \text{ nCi/g}$	$< 25.4 \text{ nCi/g}$
Total organic carbon	$< 10 \text{ g/L}$	1.03 g/L

Notes:

 $\mu\text{Ci/g}$  = microrcuries per gram $\text{nCi/g}$  = nanocuries per gram<sup>1</sup>Based upon  $^{239}\text{Pu}$  specific activity and an assumed supernate density of 1 g/mL.

<sup>2</sup>Corrosivity decision rules were not developed for the aging waste tanks in the *Data Quality Objectives for the Waste Compatibility Program* (Carothers 1994) waste compatibility DQO because aging wastes are no longer generated with the permanent shutdown of the PUREX Plant (Carothers 1994). Instead, the wastes stored in Tank 241-AZ-101 must comply with the corrosion specifications listed in Operating Specifications for Aging Waste Operations in 241-AY and 241-AZ (Bergmann 1989).

that the nitrate concentration does not meet the primary criteria. In this situation the waste compatibility data quality objective requires that the following two conditions be met:

For  $1.0 \text{ M} < \text{NO}_3^- \leq 3.0 \text{ M}$

1.  $0.1 (\text{NO}_3^-) \leq \text{OH}^- < 10 \text{ M}$
2.  $\text{OH}^- + \text{NO}_2^- \geq 0.4 (\text{NO}_3^-)$

These two conditions are met for tank 241-AZ-101.

The low phosphate concentration (131  $\mu\text{g/mL}$ ) observed in the 1995 grab samples indicates that the potential for insoluble phosphates forming is low, and the waste is pumpable.



## 6.0 CONCLUSIONS AND RECOMMENDATIONS

The sludge in tank 241-AZ-101 was sampled and analyzed in 1987 and 1989; the supernate was sampled and analyzed in March 1995. Historical and analytical information indicate that the waste composition satisfies the safety criteria for water content, heat, and criticality. Although the fuel content of the sludge has not been measured by differential scanning calorimetry (DSC), the total organic carbon (TOC) and historical tank uses indicate that excessive fuel is not present. The tank was sufficiently sampled to satisfy the requirements of safety screening (Reynolds et al. 1999). If the sludge is sampled again, the analyses should include an evaluation of the fuel content by DSC to confirm the fuel estimates based on historical information and TOC analysis. Tank 241-AZ-101 meets the criteria specified in the waste compatibility DQO (Carothers 1994).

As expected the sludge contains large quantities of aluminum, iron, manganese, sodium, and zirconium as expected from PUREX chemical processing wastes. Concentrations of nitrate, nitrite, and sulfate are high also, as expected. The major radioactive constituents in the waste are  $^{90}\text{Sr}$ ,  $^{137}\text{Cs}$ , and  $^{241}\text{Am}$ . The heat generated by these isotopes is well below the 4,000,000 Btu/hr limit set for aging waste storage tanks.

The supernate  $^{239/240}\text{Pu}$  and  $^{241}\text{Am}$  levels are below the transuranic classification limit of 100 nCi/g. However, the sludge significantly exceeds the transuranic classification limit.





## 7.0 REFERENCES

- Agnew, S. F., 1994, *Hanford Defined Wastes: Chemical and Radionuclide Composition*, WHC-SD-WM-TI-629, Rev. 5, Westinghouse Hanford Company, Richland, Washington.
- Agnew, S. F., R. Corbin, T. Duran, K. Jurgensen, and B. Young, 1995, *Waste Status and Transaction Record Summary (WSTRS) for the Southeast Quadrant*, WHC-SD-WM-TI-689, Rev. 1, Westinghouse Hanford Company, Richland, Washington.
- Anderson, J. D., 1990, *A History of the 200 Area Tank Farms*, WHC-MR-0132, Westinghouse Hanford Company, Richland, Washington.
- Anderson, A. A., 1992, *Double-Shell Underground Waste Storage Tanks Riser Survey*, SD-RE-TI-093, Rev. 3, Westinghouse Hanford Company, Richland, Washington.
- Babad, H., and K. S. Redus, 1994, *Tank Safety Screening Data Quality Objectives*, WHC-SD-WM-SP-004, Rev. 0, Westinghouse Hanford Company, Richland, Washington.
- Babad, H., S. M. Blacker, and K. S. Redus, 1994, *Data Quality Objective to Support Resolution of the Organic Fuel Rich Tank Safety Issue*, WHC-SD-WM-DQO-006, Rev. 0, Westinghouse Hanford Company, Richland, Washington.
- Bell, K. E., 1994, *Tank Waste Remediation System Tank Waste Analysis Plan*, WHC-SD-WM-PLN-077, Rev. 0, Westinghouse Hanford Company, Richland, Washington.
- Bergmann, L. M., 1989, *Operating Specifications for Aging -Waste Operations in 241-AY and 241-AZ*, OSD-T-151-00017, Rev. D-0, Westinghouse Hanford Company, Richland, Washington.
- Brevick, C. H., L. A. Gaddis, and W. W. Pickett, 1994, *Historical Tank Content Estimate of the Southeast Quadrant of the Hanford 200 East Area*, WHC-SD-WM-ER-350, Rev. 0 (Preliminary Draft), ICF Kaiser Hanford Company, Richland, Washington.
- Carothers, K. G., 1994, *Data Quality Objectives for the Waste Compatibility Program*, WHC-SD-WM-DQO-001, Rev. 0, Westinghouse Hanford Company, Richland, Washington.
- Certa, P. J., 1983, *242-A Evaporator/Crystallizer FY 83 Campaign Run 83-1 Post Run Document*, WHC-SD-WM-PE-014, Rev. 0, Westinghouse Hanford Company, Richland, Washington.

De Lorenzo, D. S., A. T. DiCenso, D. B. Hiller, K. W. Johnson, J. H. Rutherford, and D. J. Smith, 1994, *Tank Characterization Reference Guide*, WHC-SD-WM-TI-648, Rev. 0, Los Alamos Technical Associates, Kennewick, Washington.

Ecology, EPA, DOE, 1994, *Hanford Federal Facility Agreement and Consent Order*, as amended, Washington State Department of Ecology, U.S. Environmental Protection Agency, and U.S. Department of Energy, Olympia, Washington.

Gray, W. J., M. E. Peterson, R. D. Scheele, and J. M. Tingey, 1993, *Characterization of the Second Core Sample of Neutralized Current Acid Waste from Double-Shell Tank 101-AZ*, Pacific Northwest Laboratory, Richland, Washington.

Hanks, R. W., 1978, *Low Reynolds Number Turbulent Pipeline Flow of Pseudohomogeneous Slurries*, Presented at Proceedings of the 5th International Conference on Hydraulics Transportation of Solids in Pipes, May 8-11, Hannover, Federal Republic of Germany.

Hanlon, B. L., 1995, *Waste Tank Summary for Month Ending March 31, 1995*, WHC-EP-0182-84, Westinghouse Hanford Company, Richland, Washington.

MacLean, G. T., 1995, *Tank AZ-101 Sludge Washing Test*, WHC-SD-WM-PTP-028, Draft, Westinghouse Hanford Company, Richland, Washington.

McGrail, B. P., 1991, *Results of the Analysis of the Large Chunk of Material and the Measurement of the Miller Number for DST 101-AZ Core #3 Waste*, (incoming correspondence no. 9101055 to L. M. Sasaki, dated February 11), Westinghouse Hanford Company, Richland, Washington.

*Resource Conservation and Recovery Act*, USC 6901 et seq.

Peterson, M. E., R. D. Scheele, and J. M. Tingey, 1989, *Final Report - Characterization of the First Core Sample of Neutralized Current Acid Waste from Double-Shell Tank 101-AZ*, (incoming correspondence no. 8904140 to A. J. DiLiberto, dated September 29), Westinghouse Hanford Company, Richland, Washington.

Reynolds, D. A., W. T. Cowley, J. A. Lechelt, B. C. Simpson, and C. DeFigh-Price, 1999, *Evaluation of Tank Data for Safety Screening*, HNF-4217, Rev. 0, Lockheed Martin Hanford Corporation, Richland, Washington.

Rollison, M. D., 1995, *Results for 241-AZ-101 Grab Samples Revision 2*, (internal memo no. 75970-95-037, Rev. 1, to J. M. Jones, dated June 29), Westinghouse Hanford Company, Richland, Washington.

Schreiber, R. D., 1995, *Tank 241-AZ-101 Tank Characterization Plan*, WHC-SD-WM-TP-284, Rev. 0, Westinghouse Hanford Company, Richland, Washington.



- Teats, M. C., 1982, *242-A Evaporator Campaign 81-1 Post Run Letter*, WHC-SD-WM-PE-007, Rev. 0, Westinghouse Hanford Company, Richland, Washington.
- Tran, T. T., 1993, *Thermocouple Status Single Shell and Double Shell Waste Tanks*, WHC-SD-WM-TI-553, Rev. 0, Westinghouse Hanford Company, Richland, Washington.
- Vail, T. S., 1994, *Waste Storage in Double-Shell Tanks and Associated Equipment*, CPS-T-149-00010, Rev. E-0, Westinghouse Hanford Company, Richland, Washington.
- Vitro Engineering Corp., 1973, *Plan Tank 101 Penetrations and Schedule 241-AZ Tank Farm*, Drawing No. H-2-67314, Rev. 1, ICF Kaiser Hanford Company, Richland, Washington.
- WHC, 1987, *Chemical Analysis of Tank 101-AZ and 102-AZ Samples Taken in October 1987*, (internal memo no. 12221-PCL88-091 from D. L. Herting to L. A. Mihalik, dated March 11), Westinghouse Hanford Company, Richland, Washington.
- WHC, 1988, *Future Aging Waste Tank Operations (No N Reactor Case)*, (internal memo no. 13314-88-041 from L. A. Mihalik to J. N. Appel, March 29), Westinghouse Hanford Company, Richland, Washington.
- WHC, 1989a, *Supernate Samples from 101-AZ - Follow up of 101-AZ Sludge Core*, (internal memo no. 13315-89-DJF-012 from D. J. Flesher to D. G. Baide and L. M. Bergmann, dated April 13), Westinghouse Hanford Company, Richland, Washington.
- WHC, 1989b, *Tank 101-AZ Samples and Analyses*, internal memo no. 13315-89-DJF-024 from D. J. Flesher to A. J. DiLiberto, dated November 29), Westinghouse Hanford Company, Richland, Washington.

This page intentionally left blank.



**DISTRIBUTION SHEET**

To	From	Page 1 of 2			
Distribution	Data Assessment and Interpretation	Date	05/25/99		
Project Title/Work Order		EDT No.	N/A		
Tank Characterization Report for Double-Shell Tank 241-AZ-101, WHC-SD-WM-ER-410, Rev. 0-C		ECN No.	ECN-653800		
Name	MSIN	Text With All Attach.	Text Only	Attach./Appendix Only	EDT/ECN Only

OFFSITESandia National Laboratory

P.O. Box 5800  
MS-0744, Dept. 6404  
Albuquerque, NM 87815

D. Powers

X

Nuclear Consulting Services Inc.

P. O. Box 29151  
Columbus, OH 43229-01051

J. L. Kovach

X

Chemical Reaction Sub-TAP

P.O. Box 271  
Lindsborg, KS 67456

B. C. Hudson

X

SAIC

555 Quince Orchard Rd., Suite 500  
Gaithersburg, MD 20878-1437

H. Sutter

X

Los Alamos Laboratory

CST-14 MS-J586  
P. O. Box 1663  
Los Alamos, NM 87545

S. F. Agnew

X

Tank Advisory Panel

102 Windham Road  
Oak Ridge, TN 37830

D. O. Campbell

X

# DISTRIBUTION SHEET

To	From	Page 2 of 2
Distribution	Data Assessment and Interpretation	Date 05/25/99
Project Title/Work Order		EDT No. N/A
Tank Characterization Report for Double-Shell Tank 241-AZ-101, WHC-SD-WM-ER-410, Rev. 0-C		ECN No. ECN-653800

Name	MSIN	Text With All Attach.	Text Only	Attach./Appendix Only	EDT/ECN Only
------	------	-----------------------	-----------	-----------------------	--------------

## ONSITE

### Department of Energy - Richland Operations

W. S. Liou	S7-54	X
DOE/RL Reading Room	H2-53	X

### DE&S Hanford, Inc.

G. D. Johnson	S7-73	X
---------------	-------	---

### Fluor Daniel Hanford Corporation

J. S. Hertzel	H8-67	X
---------------	-------	---

### Lockheed Martin Hanford, Corp.

J. W. Cammann	R2-11	X
L. M. Sasaki	R2-12	X
B. C. Simpson	R2-12	X
A. M. Templeton	R2-12	X
R. R. Thompson	R2-12	X
ERC (Environmental Resource Center)	R1-51	X
T.C.S.R.C.	R1-10	5

### Lockheed Martin Services, Inc.

B. G. Lauzon	R1-08	X
Central Files	B1-07	X
EDMC	H6-08	X

### Numatec Hanford Corporation

J. S. Garfield	R3-73	X
D. L. Herting	T6-07	X

### Pacific Northwest National Laboratory

A. F. Noonan	K9-91	X
--------------	-------	---

### Scientific Applications International Corporation

M. D. LeClair	R3-75	X
---------------	-------	---