

Waste Tank Summary Report for Month Ending SEPTEMBER 30, 2003

RECEIVED
DEC 01 2003

EDMC

Prepared for the U.S. Department of Energy
Assistant Secretary for Environmental Management

CH2MHILL
Hanford Group, Inc.

Richland, Washington

Contractor for the U.S. Department of Energy
Office of River Protection under Contract DE-AC27-99RL14047

Approved for Public Release; Further Dissemination Unlimited

LEGAL DISCLAIMER _____

This report was prepared as an account of work sponsored by an agency of the United States Government. Neither the United States Government nor any agency thereof, nor any of their employees, nor any of their contractors, subcontractors or their employees, makes any warranty, express or implied, or assumes any legal liability or responsibility for the accuracy, completeness, or any third party's use or the results of such use of any information, apparatus, product, or process disclosed, or represents that its use would not infringe privately owned rights. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof or its contractors or subcontractors. The views and opinions of authors expressed herein do not necessarily state or reflect those of the United States Government or any agency thereof.

This report has been reproduced from the best available copy.

Printed in the United States of America

S**ENGINEERING CHANGE NOTICE**

1a. ECN 720095 R 9

Page 1 of 6

 DM FM TM

1b. Proj. ECN W- - R

2. Request Information Record Information on the ECN-1 Form		3a. Design Inputs -Record Information on the ECN-2 Form		3b. Design Outputs / References - Record Information on the ECN-3 Form		3c. Engineering Evaluation / Estimate / Approval to Proceed w/ the Design - Record Information on the ECN-4 Form	
4. Originator's Name, Organization, MSIN, & Phone No. B. M. Hanlon, Process Analysis/Flowsheet and Process Models, R1-14, 373-2053				5. USQ Number No. TF - - R - <i>Bmh</i> <input checked="" type="checkbox"/> N/A <input type="checkbox"/> Refer to Work Package		6. Date 10/23/03	
7. Title HNF-EP-0182, Rev. 186, Waste Tank Summary for Month Ending September 30, 2003			8. Bldg. / Facility No. 241G		9. Equipment / Component ID N/A		10. Approval Designator N/A
11. Documents/Drawings Changed by this ECN (Record the information on the ECN-5 Form, including sheet and revision numbers.)			12. Design Basis Documents? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No		13. Safety Designation <input type="checkbox"/> SC <input type="checkbox"/> SS <input type="checkbox"/> GS <input checked="" type="checkbox"/> N/A		14. Expedited / Off-Shift ECN? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No
15a. Work Package Number N/A		15b. Modification Work Completed N/A <small>Responsible Engineer / Date</small>		15c. Restored to Original Status (TM) N/A <small>Responsible Engineer / Date</small>		16. Fabrication Support ECN? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	
17. Description of the Change (Use ECN Continuation pages, as needed) Complete revision of HNF-EP-0182, Waste Tank Summary 1. Tables and text updated to reflect status as of September 30, 2003. 2. For tanks 241-BY-106 and 241-S-111, data date for reporting volumes pumped during interim stabilization was changed to June 1, 1998, for consistency with Consent Decree and initial estimates of pumpable liquid remaining provided in HNF-2978, Rev. 5.							
18. Justification of the Change (Use ECN Continuation pages, as needed) DOE-ORP requires this document to be revised and issued monthly.						19. ECN Category <input checked="" type="checkbox"/> Direct Revision <input type="checkbox"/> Supplemental <input type="checkbox"/> Void/Cancel <u>ECN Type</u> <input type="checkbox"/> Supercedure <input type="checkbox"/> Closure <input type="checkbox"/> Change Prior	
20. Distribution Name MSIN Name MSIN Distribution list follows document						Release Stamp NOV 03 2003 DATE: <i>H</i> STA: <i>H</i> HANFORD RELEASE ID: 8	

ENGINEERING CHANGE NOTICE

1a. ECN 720095 R 9

Page 2 of 6

DM FM TM

1b. Proj. ECN W- - R

21. Engineering Check

Record Information on the ECN-6 Form as required

22. Design Verification Required?

Yes No

If Yes, as a minimum attach the one page checklist from TFC-ENG-DESIGN-P-17.

23. Closeout / Cancel / Void

Yes No

If Yes, Record Information on the ECN-7 Form and attach form(s).

24. Revisions Planned (Include a brief description of the contents of each revision)

Document will be revised monthly in 2003

Note: All Revisions shall have the approvals of the affected organizations as identified in block 10 "Approval Designator," on page 1 of this ECN.

25a. Commercial Grade Item Dedication Numbers (associated with this design change)

N/A

25b. Engineering Data Transmittal Numbers (associated with this design change, e.g., new drawings, new documents)

N/A

26a. Design Cost Estimate

N/A

26b. Materials / Procurement Costs

N/A

26c. Estimated Labor Hours

N/A

27. Field Change Notice(s) Used?

Yes No

If Yes, Record Information on the ECN-8 or ECN-9 Form, attach form(s), and identify permanent changes.

NOTE: ECNs are required to record and approve all FCNs issued. If the FCNs have not changed the original design media then they are just incorporated into the design media via an ECN. If the FCN did change the original design media then the ECN will include the necessary engineering changes to the original design media.

28. Approvals

Facility/Project Signatures	Date	A/E Signatures	Date
Design Authority _____		Originator/Design Agent _____	
Team Lead/Lead Engr. <u>BM Hanlon</u> <i>BM Hanlon</i>	<u>10/23/03</u>	Professional Engineer _____	
Resp. Engineer <u>BM Hanlon</u> <i>BM Hanlon</i>	<u>10/23/03</u>	Project Engineer _____	
Resp. Manager <u>NW Kirch</u> <i>NW Kirch</i>	<u>10/29/03</u>	Quality Assurance _____	
Quality Assurance _____		Safety _____	
IS&H Engineer _____		Designer _____	
NS&L Engineer _____		Environ. Engineer _____	
Environ. Engineer _____		Other _____	
Project Engineer _____		Other _____	
Design Checker <u>MA Knight</u> <i>MA Knight</i>	<u>10/27/03</u>	DEPARTMENT OF ENERGY / OFFICE OF RIVER PROTECTION	
Design Verifier _____		Signature or a Control Number that tracks the Approval Signature	
Operations _____			
Radcon _____		ADDITIONAL SIGNATURES	
EQRG _____			
Other _____			

**ECN - 5
DRAWING / DOCUMENT CHANGE LIST FORM**

1a. ECN 720095 R 9

Sheet 1 of ECN - 5
Page 3 of 6

DM FM TM

1b. Proj. ECN W- - R

List of Engineering Drawings/Documents Changed (Use the attached checklist for guidance)

Dwg./Doc. Number (Sheet/Page, Rev)	Title/Type	Shared	PC-002/ SDD/ HNF-3240/ HNF-4184	Existing Change Document Nos.
HNF-EP-0182, Rev. 185	Waste Tank Summary Report for Month Ending August 30, 2003	<input type="checkbox"/>	<input type="checkbox"/>	
		<input type="checkbox"/>	<input type="checkbox"/>	
		<input type="checkbox"/>	<input type="checkbox"/>	
		<input type="checkbox"/>	<input type="checkbox"/>	
		<input type="checkbox"/>	<input type="checkbox"/>	
		<input type="checkbox"/>	<input type="checkbox"/>	
		<input type="checkbox"/>	<input type="checkbox"/>	
		<input type="checkbox"/>	<input type="checkbox"/>	
		<input type="checkbox"/>	<input type="checkbox"/>	
		<input type="checkbox"/>	<input type="checkbox"/>	
		<input type="checkbox"/>	<input type="checkbox"/>	

Submitted to Document Service Center Prior to ECN Release?

Yes No

List of Non-Engineering Documents Needing Change

Document Number/Revision, Sheet/Page (if Available)	Document Title	Document Owner (Organization)	Individual Notified	Method	Date Notified

**ECN - 5
DRAWING / DOCUMENT CHANGE LIST FORM**

1a. ECN 720095 R 9

Sheet 2 of ECN - 5
Page 4 of 6

DM FM TM

1b. Proj. ECN W- - R

Drawings/Documents to be Modified Checklist

System Design Description	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Security Plan	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Functional Design Criteria	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Emergency Plan	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Functional Requirements	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Calculations (General)	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Specification (Equipment or Operating)	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Operating Procedure	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Criticality Specification	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	System / Subsystem Specifications	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Design Report	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Material Specification / BOM	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Training Plan	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Sampling Plan	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Equipment Specification	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Inspection Plan	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Procurement Specification	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Spare Parts List	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Construction Specification	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Test Specification	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Vendor Information	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Acceptance Test Plan	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Design Drawings	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Acceptance Test Procedure	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Safety Analysis / FSAR / SAR / DSA	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Pre-Operational Test Procedure	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Technical Safety Requirement	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Operation Test Plan	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Master Equipment List	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Operational Test Procedure	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Safety Equipment List	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	ASME Coded Item / Vessel	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Functional Analysis	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Automated Control Configuration Plan	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Environmental Requirement / Review	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Computer / Automated Control Software Plan	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Scope Description Document	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Process Control Plan	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Seismic / Stress / Structural Analysis	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Process Control Procedure	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Engineering Study	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Purchase Requisition	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Interface Control Drawing / Document	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Hazards Review	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Maintenance Procedure(s)	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	JCS PM Activity Datasheet	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Setpoint / Tolerance Document	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A		<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A		<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A		<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A

**ECN - 6
ENGINEERING CHECK LIST**

1a. ECN 720095 R 9

Sheet 1 of ECN - 6
Page 5 of 6

DM FM TM

1b. Proj. ECN W- - R

Design Details/Attributes (to be filled out by the change originator) identified in the ECN.

1. Issue/Problem Statement included	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> N/A	21. Basis for Selected Alternative explained, including assumptions	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
2. Safety/Commitment/Programmatic Impacts identified – NEPA Documentation completed	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	22. Potential Component/System Impacts identified and resolved	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
3. System/Equipment/Personnel Impacts identified	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	23. Potential Software Impacts identified and resolved	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
4. Technical Evaluation included	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	24. Potential Safety Impacts are identified and resolved (e.g., energized electrical equipment)	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
5. Compliance w/ Design Basis identified	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	25. Modification is Constructible and can be implemented	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
6. Assumptions/Sources clearly identified	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> N/A	26. Design considers Operational Impacts	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
7. Affected Documents and Databases clearly identified	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> N/A	27. Contamination Controls are planned	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
8. Inputs Verified	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> N/A	28. Pre-Installation/Mockup/Prototype Testing planned	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
9. Required Function(s) / changes clearly identified	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	29. Sketches/Drawings for Tools/Fabricated Components included	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
10. Safety Basis/Commitments/Concerns evaluated	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	30. Hardware Design described	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
11. Application of Industry Standards/Codes explained	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	31. Software/Firmware Design described	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
12. Proper Analytical Techniques employed	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	32. Inspections (per Codes & Standards) / Quality Checks included	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
13. Interfaces evaluated and identified	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	33. Dimensions and Tolerances included	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
14. Material/Component Compatibility evaluated	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	34. Sketches/Drawings for Installation included	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
15. ALARA/Radiological controls/chemical hazards evaluated	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	35. Housekeeping/Personnel Safety Requirements identified	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
16. Human/Machine Interface evaluated	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	36. Walkdown(s) performed/Labeling Correct	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
17. Program impacts evaluated	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	37. Acceptance Test generated and Acceptance Criteria included	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
18. Calculations updated	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	38. M&TE Requirements identified	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
19. Alternatives described/evaluated and address resolution of problem	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	39. Training/Qualification of Test Personnel identified	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
20. Impacts on Maintenance and OPS described	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	40. Safety and Hazards Analysis assessed	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>

Change Originator (Print/Initial; Sign on page 2 of the ECN)

B. M. Hanlon 

Italicized text items need to be addressed. Standard text items need to be addressed as applicable to the change as described.

**ECN - 6
ENGINEERING CHECK LIST**

1a. ECN 720095 R 9

Sheet 2 of ECN - 6
Page 6 of 6

DM FM TM

1b. Proj. ECN W- - R

Engineering Check Method (Select method(s) and provide explanation of how to be performed):

Peer Check Engineering Check Team* Other

Engineering Check Explanation:

* Engineering check team members other than the originating organization normally should consist of personnel representing: Operations, Maintenance & Reliability Engineering, Maintenance Management, Maintenance Crafts, Safety, and Projects.

Engineering Check Details

Engineering inputs correctly identified? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> N/A	Engineering changes properly documented? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> N/A
Calculations checked and are correct? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> N/A	Test procedures reviewed and are correct? <input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Engineering assumptions are stated and verified? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> N/A	Is the engineering change adequate? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> N/A
Engineering criteria incorporated into the engineering change? <input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Is the engineering change complete? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> N/A
Interfaces clearly identified in the engineering change? <input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Is the engineering change correct? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> N/A
EQRG pre-release review required? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	EQRG Pre-release Approval (Print/Initial; Sign on page 2 of the ECN)

Comments:

Document changes reviewed for consistency with source information and confirmed as correct. Document reviewed for editorial adequacy and accuracy. All discrepancies corrected and changes incorporated by originator.

Engineering Checker (Print/Initial; Sign on page 2 of the ECN)

M. A. Knight *M.A. Knight*

Italicized text items need to be addressed. Standard text items need to be addressed as applicable to the problem/issue described.

WASTE TANK SUMMARY REPORT FOR MONTH ENDING SEPTEMBER 30, 2003

BM HANLON

CH2M HILL Hanford Group, Inc.
Richland, WA 99352
U.S. Department of Energy Contract DE-AC27-99RL14047

EDT/ECN: ECN-720095-R9 UC:
Cost Center: Charge Code: 67 JM
B&R Code: Total Pages: 56 11/3/03

Key Words: REPORT, WASTE TANK SUMMARY

Abstract: See page iii of document


TRADEMARK DISCLAIMER. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof or its contractors or subcontractors.

Printed in the United States of America. To obtain copies of this document, contact: Document Control Services, P.O. Box 950, Mailstop H6-08, Richland WA 99352, Phone (509) 372-2420; Fax (509) 376-4989.

 10/31/03

Release Approval

Date

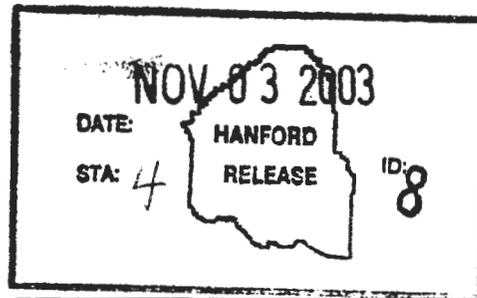

Release Stamp

Approved For Public Release

Waste Tank Summary Report for Month Ending SEPTEMBER 30, 2003

Prepared for the U.S. Department of Energy
Assistant Secretary for Environmental Management

CH2MHILL
Hanford Group, Inc.

Richland, Washington

Contractor for the U.S. Department of Energy
Office of River Protection under Contract DE-AC27-99RL14047

Approved for Public Release; Further Dissemination Unlimited

LEGAL DISCLAIMER

This report was prepared as an account of work sponsored by an agency of the United States Government. Neither the United States Government nor any agency thereof, nor any of their employees, nor any of their contractors, subcontractors or their employees, makes any warranty, express or implied, or assumes any legal liability or responsibility for the accuracy, completeness, or any third party's use or the results of such use of any information, apparatus, product, or process disclosed, or represents that its use would not infringe privately owned rights. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof or its contractors or subcontractors. The views and opinions of authors expressed herein do not necessarily state or reflect those of the United States Government or any agency thereof.

This report has been reproduced from the best available copy.

Printed in the United States of America

Waste Tank Summary Report for Month Ending SEPTEMBER 30, 2003

B. M. Hanlon
CH2M HILL Hanford Group, Inc.

Date Published
October 2003

Prepared for the U.S. Department of Energy
Assistant Secretary for Environmental Management

CH2MHILL
Hanford Group, Inc.

P. O. Box 1500
Richland, Washington

Contractor for the U.S. Department of Energy
Office of River Protection under Contract DE-AC27-99RL14047

Approved for Public Release; Further Dissemination Unlimited

This page intentionally left blank.

WASTE TANK SUMMARY REPORT

B. M. Hanlon

ABSTRACT

This report is the official inventory for radioactive waste stored in underground tanks in the 200 Areas at the Hanford Site. Data that depict the status of stored radioactive waste and tank vessel integrity are contained within the report. This report provides data on each of the existing 177 large underground waste storage tanks and 60 smaller miscellaneous underground storage tanks and special surveillance facilities, and supplemental information regarding tank surveillance anomalies and ongoing investigations. This report is intended to meet the requirement of U.S. Department of Energy Order 435.1 (DOE-HQ, August 28, 2001, Radioactive Waste Management, U.S. Department of Energy-Washington, D.C.) requiring the reporting of waste inventories and space utilization for the Hanford Site Tank Farm tanks.

This page intentionally left blank.

TABLE OF CONTENTS

SUMMARY

I. WASTE TANK STATUS1
 II. WASTE TANK INVESTIGATIONS1
 III. SURVEILLANCE AND WASTE TANK STATUS HIGHLIGHTS2

APPENDICES

APPENDIX A: DOUBLE-SHELL TANKS MONTHLY SUMMARY TABLES..... A-1
 Table A-1. Inventory and Status by Tank – Double-Shell Tanks A-2
 Table A-2. Double-Shell Tank Space Allocation, Inventory, and Waste Receipts..... A-3

APPENDIX B: SINGLE-SHELL TANKS MONTHLY SUMMARY TABLES.....B-1
 Table B-1. Inventory and Status by Tank – Single-Shell TanksB-2
 Table B-2. Single-Shell Tanks Stabilization Status Summary.....B-6
 Table B-3. Single-Shell Tanks Interim Stabilization StatusB-7
 Table B-4. Single-Shell Tank Interim Stabilization MilestonesB-11
 Table B-5. Single Shell Tank Leak Volume EstimatesB-13

APPENDIX C: MISCELLANEOUS UNDERGROUND STORAGE TANKS AND SPECIAL SURVEILLANCE FACILITIESC-1
 Table C-1. East and West Area Miscellaneous Underground Storage Tanks and Special Surveillance FacilitiesC-2
 Table C-2. East Area Inactive Miscellaneous Underground Storage Tanks and Special Surveillance FacilitiesC-3
 Table C-3. West Area Inactive Miscellaneous Underground Storage Tanks and Special Surveillance FacilitiesC-4

APPENDIX D: GLOSSARY OF TERMS D-1
 Table D-1. Glossary of Terms D-2

APPENDIX E: TANK CONFIGURATION AND FACILITIES CHARTSE-1
 Figure E-1. High-Level Waste Tank ConfigurationE-2
 Figure E-2. Double-Shell Tank Instrumentation ConfigurationE-3
 Figure E-3. Single-Shell Tank Instrumentation ConfigurationE-4
 Figure E-4. 200 East Tank Waste ContentsE-5/6
 Figure E-5. 200 West Tank Waste ContentsE-7/8
 Figure E-6. Hanford Tank Farm Facilities 200 East.....E-9/10
 Figure E-7. Hanford Tank Farm Facilities 200 WestE-11/12

METRIC CONVERSION CHART		
1 inch	=	2.54 centimeters
1 foot	=	30.48 centimeters
1 gallon	=	3.79 liters
1 ton	=	0.91 metric tons
$^{\circ}\text{F} = \left(\frac{9}{5} ^{\circ}\text{C} \right) + 32$		
1 Btu/h = 0.2931 watts (International Table)		

WASTE TANK SUMMARY REPORT
For Month Ending September 30, 2003

Note: Changes from the previous month are in **bold print**.

I. WASTE TANK STATUS

Double-Shell Tanks (DST)	28 double-shell	10/86 - date last DST tank was completed
Single-Shell Tanks (SST)	149 single-shell	1966 - date last SST tank was completed
Assumed Leaker Tanks	67 single-shell	07/93 - date last Assumed Leaker was identified
Sound Tanks	28 double-shell 82 single-shell	1986 - date DSTs determined sound 07/93 - date last SST determined Sound
Interim Stabilized Tanks ^a (IS)	139 single-shell	08/03 - date last IS occurred
Not Interim Stabilized ^b	10 single-shell	Tanks not Interim Stabilized
Isolated-Intrusion Prevention Completed (IP) ^c	99 single-shell	09/96 - date last IP occurred
Retrieval ^c	9 single-shell	10/02 - date effective
Misc. Underground Storage Tanks (MUST) and Special Surveillance Facilities (Active)	10 Tanks East Area 7 Tanks West Area	03/01 - last date a tank was added or removed from MUST list
Misc. Underground Storage Tanks (IMUST) and Special Surveillance Facilities (Inactive) ^d	18 Tanks East Area 25 Tanks West Area	11/01 - last date a tank was added or removed from IMUST list

^a Of the 136 tanks classified as Interim Stabilized, 65 are listed as Assumed Leakers. (See Table B-5)

^b One of these tanks is an Assumed Leaker (BY-106). (See Table B-5) The total of 10 tanks includes 9 tanks covered by the Consent Decree (A-101, AX-101, BY-106, S-101, S-102, S-111, S-112 U-107, and U-108); and C-106, which is not included in the Consent Decree and which is not Interim Stabilized; this tank is being pumped for Retrieval. Tanks S-102 and S-112 are in the Retrieval process, and AX-101 is under evaluation for meeting Interim Stabilization criteria. **Tanks S-107 and SX-112 are being evaluated to confirm their Interim Stabilization status.**

^c Tank status for 9 tanks (C-104, C-201, C-202, C-203, C-204, S-102, S-103, S-105 and S-106) was changed from Isolated-Intrusion Prevention Completed (IP) to "Retrieval," effective October 2002. Tanks S-102 and S-112 are also now in the Retrieval process.

^d Tables C-2 and C-3, the Inactive Miscellaneous Underground Storage Tanks (IMUST) now reflect only those tanks managed by CH2M HILL Hanford Group, Inc. (CH2M HILL).

II. WASTE TANK INVESTIGATIONS

There are no single- or double-shell tanks or catch tanks which are showing surface level or interstitial liquid level (ILL) decreases, or drywell radiation level increases in excess of established criteria.

There are no single- or double-shell tanks or catch tanks for which an off-normal or unusual occurrence report has been issued, or for which a waste tank investigation is in progress for assumed leaks or re-leaks.

III. SURVEILLANCE AND WASTE TANK STATUS HIGHLIGHTS

A. Single-Shell Tanks Saltwell Pumping

All pumping in Kgallons

Tank Number	Pumping Began	Initial Estimated Pumpable Liquid (HNF-2978, Rev. 5)	Pumped This Month	Total Pumped
241-A-101	May 6, 2000	556	0	542
241-BY-106	July 11, 2001	86	1	90
241-S-101	July 27, 2002	82	0	68
241-S-111	December 18, 2002	109	2	98
241-U-107	September 29, 2001	124	2	119
241-U-108	December 2, 2001	113	1	109

C. Single-Shell Tanks Under Evaluation for Interim Stabilization

Tank Number	Date Tank Placed Under Evaluation for Interim Stabilization
241-AX-101	June 2, 2003
241-S-107	August 28, 2003 - to confirm IS status
241-SX-112	August 28, 2003 - to confirm IS status

D. Single-Shell Tanks in Retrieval and Closure:

Tank Number	Status
241-C-104	In preparation for retrieval
241-C-106	Being pumped
241-C-200 series	In preparation for retrieval
241-S-102	In preparation for retrieval
241-S-112	Being pumped

E. Interim Milestones Met

The U.S. Department of Energy (DOE), Office of River Protection (ORP) informed the Washington Department of Ecology (Ecology) on September 30, 2003, that Hanford Federal Facility Agreement and Consent Order (HFFACO) Interim Milestones M-045-02L and M-046-00J were completed.

Milestone M-045-02L requires DOE to “Submit Annual Updates to Single-Shell Tank (SST) Retrieval Sequence Document,” and M-046-00J requires DOE to submit a “Double-Shell Tank (DST) Space Evaluation.” The due date for both of these milestones was September 30, 2003.

DOE, Ecology, and CH2M HILL Hanford Group, Inc. participated in meetings that resulted in modeling assumptions for completing the tank waste treatment and tank closure mission. These assumptions were the basis for modeling runs which contain associated SST retrieval sequences and DST space evaluations that meet the mission target to treat the tank waste by 2028.

F. ENRAF (liquid level measurement device) Installation Status

ENRAFs have been installed in 136 of the 149 single-shell tanks. All except nine ENRAFs are read automatically by the Tank Monitoring Surveillance System (TMACS); these nine are read manually. There are seven ENRAFs not yet installed in BY-farm; three in C-farm; and three in U-farm. There are no current plans to install these due to funding being needed for higher priority projects. These 13 tanks are presently monitored by Manual Tape.

This page intentionally left blank.

APPENDIX A
DOUBLE-SHELL TANKS
MONTHLY SUMMARY TABLES

TABLE A-1. INVENTORY AND STATUS BY TANK
DOUBLE-SHELL TANKS
September 30, 2003

						WASTE VOLUMES			
TANK	TANK INTEGRITY	WASTE TYPE	TANK LEVEL (inches)	TOTAL WASTE (Kgal)	AVAIL. SPACE (Kgal)	SUPER-NATANT LIQUID (Kgal)	SLUDGE (Kgal)	SALTCAKE (Kgal)	SOLIDS VOLUME UPDATE
241-AN TANK FARM STATUS									
AN-101	SOUND	DSSF	351	964	180	964	0	0	06/30/99
AN-102	SOUND	CC	392	1078	66	944	0	134	12/31/02
AN-103	SOUND	DSS	349	960	184	501	0	459	06/30/99
AN-104	SOUND	DSSF	383	1054	90	609	0	445	06/30/99
AN-105	SOUND	DSSF	410	1128	16	590	0	538	01/31/03
AN-106	SOUND	DN	171	470	674	453	0	17	06/30/99
AN-107	SOUND	CC	402	1106	38	871	0	235	09/30/03
7 DOUBLE-SHELL TANKS			TOTALS:	6760	1248	4932	0	1828	
241-AP TANK FARM STATUS									
AP-101	SOUND	DSSF	404	1111	33	1111	0	0	05/01/89
AP-102	SOUND	DN	101	277	867	254	23	0	05/31/02
AP-103	SOUND	CC	325	895	249	895	0	0	05/31/96
AP-104	SOUND	CC	401	1103	41	1103	0	0	10/13/88
AP-105	SOUND	DSSF	344	945	199	856	0	89	06/30/99
AP-106	SOUND	CP	414	1138	6	1138	0	0	10/13/88
AP-107	SOUND	DN	108	296	848	296	0	0	10/13/88
AP-108	SOUND	DSSF	29	81	1063	81	0	0	10/13/88
8 DOUBLE-SHELL TANKS			TOTALS:	5846	3306	5734	23	89	
241-AW TANK FARM STATUS									
AW-101	SOUND	DSSF	411	1129	15	733	0	396	01/31/03
AW-102	SOUND	EVFD	104	285	840	255	30	0	01/31/01
AW-103	SOUND	DSSF/NCRW	400	1100	44	787	273	40	06/30/99
AW-104	SOUND	DSSF	391	1076	68	853	66	157	06/30/99
AW-105	SOUND	DN/NCRW	153	422	722	159	263	0	06/30/99
AW-106	SOUND	SRCVR	405	1113	31	874	0	239	06/30/99
6 DOUBLE-SHELL TANKS			TOTALS:	5125	1720	3661	632	832	
241-AY TANK FARM STATUS									
AY-101	SOUND	DC	65	180	821	84	96	0	06/30/99
AY-102	SOUND	DN	298	819	182	649	170	0	09/30/03
2 DOUBLE-SHELL TANKS			TOTALS:	999	1003	733	266	0	
241-AZ TANK FARM STATUS									
AZ-101	SOUND	AW	348	958	43	906	52	0	06/30/98
AZ-102	SOUND	AW	359	986	15	881	105	0	06/30/99
2 DOUBLE-SHELL TANKS			TOTALS:	1944	58	1787	157		
241-SY TANK FARM STATUS									
SY-101	SOUND	CC	351	966	178	691	0	275	06/30/99
SY-102	SOUND	DN/PT	371	1021	129	876	145	0	09/30/03
SY-103	SOUND	CC	268	737	407	395	0	342	06/30/99
3 DOUBLE-SHELL TANKS			TOTALS:	2724	714	1962	145	617	

NOTES: 1 KGAL DIFFERENCES ARE THE RESULT OF COMPUTER ROUNDING
 SUPERNATANT + SLUDGE (includes liquid) + SALTCAKE (includes liquid) = TOTAL WASTE
 AVAILABLE SPACE VOLUMES INCLUDE RESTRICTED SPACE
 SY-102 - Maximum Operating Liquid Level changed to 1,149,500 gallons effective 7/1/03, Process Memo #2E-03-025.

**TABLE A-2. DOUBLE-SHELL TANK SPACE ALLOCATION, INVENTORY AND
WASTE RECEIPTS (ALL VOLUMES IN KGALS)
September 30, 2003**

TOTAL DST CAPACITY	
(*)NON-AGING =	27,443
AGING =	4,004
TOTAL =	31,447

MONTHLY INVENTORY CHANGE	
INVENTORY ON 09/30/03	23,398
INVENTORY ON 08/31/03	23,169
CHANGE =	229

CALCULATION OF REMAINING SPACE	
TOTAL DST CAPACITY =	31,447
WASTE INVENTORY =	-23,398
DEDICATED OPERATIONAL SPACE =	-2,541
(**) RESTRICTED USAGE SPACE =	-1,962
(***)EMERGENCY SPACE ALLOCATION =	-1,200
REMAINING AVAILABLE SPACE =	2,346

(*) SY-102 maximum operating limit increased to 1150 kgal on July 1, 2003 per Process Memo #2E-03-025.

(**) Restricted Usage Space adjusted in December 2002 to align with DOE requirements on Restricted Usage Space.

(***) Emergency Space Allocation adjusted in July 2003 per HNF-3484 Rev. 4, includes space for WTP returns.

SEPTEMBER DST WASTE RECEIPTS					
FACILITY GENERATIONS		OTHER GAINS ASSOCIATED WITH		OTHER LOSSES ASSOCIATED WITH	
SALTWELL LIQUID (WEST)	14	SLURRY	7	SLURRY	3
(*)SALTWELL LIQUID (EAST)	0	CONDENSATE	12	CONDENSATE	12
TANK FARMS	5	INSTRUMENTATION	0	INSTRUMENTATION	0
242-A	29	UNKNOWN	2	UNKNOWN	8
C-106	60				
S-112	173				
TOTAL =	281	TOTAL =	21	TOTAL =	23

(*) does not include 7 kgal saltwell liquid and water from BY-106 to 244-BX DCRT

PROJECTED VERSUS ACTUAL WASTE VOLUMES						
	ACTUAL DST WASTE RECEIPTS	PROJECTED DST WASTE RECEIPTS (1)	MISC. DST CHANGES (+/-)	WVR	NET DST CHANGE	TOTAL DST VOLUME
10/02	119	N/A	-18	0	101	23,292
11/02	106	N/A	-11	-417	-322	22,970
12/02	213	N/A	-16	0	197	23,167
01/03	115	N/A	0	-306	-201	22,966
02/03	152	N/A	2	-137	17	22,983
03/03	139	N/A	-13	-145	-19	22,964
04/03	218	N/A	-18	0	200	23,164
05/03	106	N/A	-3	0	103	23,267
06/03	253	N/A	5	-147	111	23,378
07/03	162	N/A	3	-349	-184	23,194
08/03	101	N/A	-11	-115	-25	23,169
09/03	281	N/A	-2	-50	229	23,398

(1) The "PROJECTED DST WASTE RECEIPTS" and "WVR" numbers will be updated once the Performance Based Incentive (PBI) agreement is in place with processing schedules and assumptions defined.

(2) Total Waste Volume Reduction (WVR) through the 242A Evaporator since restart on 4/15/94 = 13,324 kgals.

This page intentionally left blank

APPENDIX B
SINGLE-SHELL TANKS
MONTHLY SUMMARY TABLES

TABLE B-1. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

September 30, 2003

Official waste volume estimates from Best-Basis Inventory baseline, January 1, 2002; HNF-2978, latest update; and RPP-5556.

Sludge and Saltcake volumes include any Retained Gas, with the exception of AX-101.

				WASTE VOLUMES							
TANK NO.	TANK INTEGRITY	TANK STATUS	TOTAL WASTE (Kgal)	SUPER-NATANT LIQUID (Kgal)	DRAINABLE INTERSTITIAL LIQUID (Kgal)	PUMPED THIS MONTH (Kgal)	TOTAL PUMPED (Kgal)	DRAINABLE LIQUID REMAINING (Kgal)	SLUDGE (Kgal)	SALT CAKE (Kgal)	SOLIDS VOLUME UPDATE
241-A TANK FARM STATUS											
A-101	SOUND	/PI	395	-	-	0	542	-	3	392	09/30/03
A-102	SOUND	IS/PI	40	3	9	0	40	12	0	37	01/31/03
A-103	ASMD LKR	IS/IP	371	5	87	0	111	92	2	364	01/01/02
A-104	ASMD LKR	IS/IP	28	0	0	0	0	0	28	0	01/27/78
A-105	ASMD LKR	IS/IP	37	0	0	0	0	0	37	0	10/31/00
A-106	SOUND	IS/IP	79	0	9	0	0	9	50	29	01/01/02
6 TANKS - TOTAL			950						120	822	
241-AX TANK FARM STATUS											
AX-101	SOUND	/PI	319	-	-	0	369	-	3	316	04/30/03
AX-102	ASMD LKR	IS/IP	30	0	0	0	13	0	6	24	01/01/02
AX-103	SOUND	IS/IP	107	0	22	0	0	22	8	99	09/30/03
AX-104	ASMD LKR	IS/IP	7	0	0	0	0	0	7	0	01/01/02
4 TANKS - TOTAL			463						24	439	
241-B TANK FARM STATUS											
B-101	ASMD LKR	IS/IP	109	0	20	0	0	20	28	81	01/01/02
B-102	SOUND	IS/IP	32	4	7	0	0	11	0	28	06/30/99
B-103	ASMD LKR	IS/IP	56	0	10	0	0	10	1	55	01/01/02
B-104	SOUND	IS/IP	374	0	45	0	0	45	309	65	01/01/02
B-105	ASMD LKR	IS/IP	290	0	20	0	0	20	28	262	01/01/02
B-106	SOUND	IS/IP	122	1	8	0	0	9	121	0	01/01/02
B-107	ASMD LKR	IS/IP	161	0	23	0	0	23	86	75	01/01/02
B-108	SOUND	IS/IP	91	0	19	0	0	19	27	64	01/31/03
B-109	SOUND	IS/IP	125	0	23	0	0	23	50	75	01/01/02
B-110	ASMD LKR	IS/IP	245	1	27	0	0	28	244	0	01/01/02
B-111	ASMD LKR	IS/IP	242	1	23	0	0	24	241	0	01/01/02
B-112	ASMD LKR	IS/IP	35	3	2	0	0	5	15	17	01/01/02
B-201	ASMD LKR	IS/IP	30	0	5	0	0	5	30	0	01/01/02
B-202	SOUND	IS/IP	29	0	4	0	0	4	29	0	01/01/02
B-203	ASMD LKR	IS/IP	52	1	5	0	0	6	51	0	01/01/02
B-204	ASMD LKR	IS/IP	51	1	5	0	0	6	50	0	01/01/02
16 TANKS - TOTAL			2044						1310	722	
241-BX TANK FARM STATUS											
BX-101	ASMD LKR	IS/IP/CCS	48	0	4	0	0	4	48	0	01/01/02
BX-102	ASMD LKR	IS/IP/CCS	112	0	0	0	0	0	112	0	04/28/02
BX-103	SOUND	IS/IP/CCS	73	11	4	0	0	15	62	0	11/29/83
BX-104	SOUND	IS/IP/CCS	100	3	4	0	17	7	97	0	01/01/02
BX-105	SOUND	IS/IP/CCS	72	5	4	0	15	9	67	0	01/01/02
BX-106	SOUND	IS/IP/CCS	38	0	4	0	14	4	38	0	01/01/95
BX-107	SOUND	IS/IP/CCS	347	0	37	0	23	37	347	0	09/18/90
BX-108	ASMD LKR	IS/IP/CCS	31	0	4	0	0	4	31	0	01/31/01
BX-109	SOUND	IS/IP/CCS	193	0	25	0	8	25	193	0	09/17/90
BX-110	ASMD LKR	IS/IP/CCS	205	1	35	0	2	36	65	139	01/01/01
BX-111	ASMD LKR	IS/IP/CCS	189	0	6	0	117	6	32	157	01/01/02
BX-112	SOUND	IS/IP/CCS	164	1	9	0	4	10	163	0	01/01/02
12 TANKS - TOTAL			1572						1255	296	

TABLE B-1. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

September 30, 2003

Official waste volume estimates from Best-Basis Inventory baseline, January 1, 2002; HNF-2978, latest update; and RPP-5556. Sludge and Saltcake volumes include Retained Gas

TANK NO.	TANK INTEGRITY	TANK STATUS	TOTAL WASTE (Kgal)	WASTE VOLUMES						SLUDGE (Kgal)	SALT CAKE (Kgal)	SOLIDS VOLUME UPDATE
				SUPER-NATANT LIQUID (Kgal)	DRAINABLE INTERSTITIAL LIQUID (Kgal)	PUMPED THIS MONTH (Kgal)	TOTAL PUMPED (Kgal)	DRAINABLE LIQUID REMAINING (Kgal)				
241-BY TANK FARM STATUS												
BY-101	SOUND	IS/IP	370	0	24	0	36	24	37	333	01/01/02	
BY-102	SOUND	IS/PI	277	0	40	0	159	40	0	277	05/01/95	
BY-103	ASMD LKR	IS/PI	417	0	58	0	96	58	9	408	01/31/03	
BY-104	SOUND	IS/IP	358	0	51	0	330	51	45	313	01/01/02	
BY-105	ASMD LKR	IS/PI	481	0	47	0	45	47	48	433	03/31/03	
BY-106	ASMD LKR	/PI	471	-	-	1	90	-	32	439	09/30/03	
BY-107	ASMD LKR	IS/IP	271	0	42	0	56	42	15	256	01/31/03	
BY-108	ASMD LKR	IS/IP	222	0	33	0	28	33	40	182	01/01/02	
BY-109	SOUND	IS/PI	277	0	37	0	157	37	24	253	01/01/02	
BY-110	SOUND	IS/IP	366	0	20	0	213	20	43	323	01/01/02	
BY-111	SOUND	IS/IP	302	0	14	0	313	14	0	302	01/01/02	
BY-112	SOUND	IS/IP	286	0	24	0	116	24	2	284	03/31/02	
12 TANKS - TOTAL			4098						295	3803		
241-C TANK FARM STATUS												
C-101	ASND LKR	IS/IP	88	0	4	0	0	4	88	0	11/29/83	
C-102	SOUND	IS/IP	316	0	62	0	47	62	316	0	09/30/95	
C-103	SOUND	IS/PI	73	1	10	0	114	11	72	0	08/31/03	
C-104	SOUND	IS/R	259	0	29	0	0	29	259	0	01/01/02	
C-105	SOUND	IS/PI	132	0	10	0	0	10	132	0	02/29/00	
C-106	SOUND	P/R	12	-	-	60	141	-	9	0	09/30/03	
C-107	SOUND	IS/IP	248	0	30	0	41	30	248	0	01/01/02	
C-108	SOUND	IS/IP	66	0	4	0	0	4	66	0	02/24/84	
C-109	SOUND	IS/IP	64	0	4	0	0	4	64	0	01/31/03	
C-110	ASND LKR	IS/IP	178	1	37	0	16	38	177	0	06/14/95	
C-111	ASND LKR	IS/IP	58	0	4	0	0	4	58	0	01/31/03	
C-112	SOUND	IS/IP	104	0	6	0	0	6	104	0	09/18/90	
C-201	ASND LKR	IS/R	1	0	0	0	0	0	1	0	01/01/02	
C-202	ASND LKR	IS/R	1	0	0	0	0	0	1	0	01/19/79	
C-203	ASND LKR	IS/R	3	0	0	0	0	0	3	0	01/31/03	
C-204	ASND LKR	IS/R	2	0	0	0	0	0	2	0	01/31/03	
16 TANKS - TOTAL			1605						1600	0		
241-S TANK FARM STATUS												
S-101	SOUND	/PI	351	-	-	0	68	-	122	229	09/30/03	
S-102	SOUND	/PI	438	-	-	0	62	-	22	416	06/30/03	
S-103	SOUND	IS/R	238	1	45	0	24	46	9	228	01/31/03	
S-104	ASMD LKR	IS/IP	288	0	49	0	0	49	132	156	12/20/84	
S-105	SOUND	IS/R	406	0	42	0	114	42	2	404	01/01/02	
S-106	SOUND	IS/PI	455	0	26	0	204	26	0	455	02/28/01	
S-107	SOUND	/PI	311	-	-	0	82	-	292	19	09/30/03	
S-108	SOUND	IS/PI	550	0	4	0	200	4	5	545	01/01/02	
S-109	SOUND	IS/PI	533	0	16	0	34	16	13	520	06/30/01	
S-110	SOUND	IS/PI	389	0	30	0	203	30	96	293	01/01/02	
S-111	SOUND	/PI	415	-	-	2	98	-	75	340	09/30/03	
S-112	SOUND	P/R	596	-	-	0	306	-	6	590	09/30/03	
12 TANKS TOTAL			4970						774	4195		

TABLE B-1. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

September 30, 2003

Official waste volume estimates are from the Best-Basis Inventory dated January 1, 2002; HNF-2978, latest update, and RPP-5556. Sludge and Saltcake volumes including any Retained Gas.

				WASTE VOLUMES								
TANK NO.	TANK INTEGRITY	TANK STATUS	TOTAL WASTE (Kgal)	SUPER-NATANT LIQUID (Kgal)	DRAINABLE INTERSTITIAL LIQUID (Kgal)	PUMPED THIS MONTH (Kgal)	TOTAL PUMPED (Kgal)	DRAINABLE LIQUID REMAINING (Kgal)	SLUDGE (Kgal)	SALT CAKE (Kgal)	SOLIDS VOLUME UPDATE	
241-SX TANK FARM STATUS												
SX-101	SOUND	IS/PI	418	0	43	0	33	44	144	274	08/31/03	
SX-102	SOUND	/PI	409	-	-	0	98	-	55	354	08/31/03	
SX-103	SOUND	IS /PI	509	0	40	0	134	40	78	431	09/30/03	
SX-104	ASMD LKR	IS/PI	446	0	48	0	231	48	136	310	04/30/00	
SX-105	SOUND	IS /PI	375	0	39	0	153	39	63	312	12/31/02	
SX-106	SOUND	IS/PI	396	0	37	0	148	37	0	396	01/31/03	
SX-107	ASMD LKR	IS/IP	95	0	7	0	0	7	79	16	01/01/02	
SX-108	ASMD LKR	IS/IP	73	0	0	0	0	0	73	0	01/01/02	
SX-109	ASMD LKR	IS/IP	241	0	0	0	0	0	58	183	01/01/02	
SX-110	ASMD LKR	IS/IP	56	0	0	0	0	0	29	27	01/01/02	
SX-111	ASMD LKR	IS/IP	115	0	11	0	0	11	76	39	01/01/02	
SX-112	ASMD LKR	IS/IP	75	0	6	0	0	6	56	19	01/01/02	
SX-113	ASMD LKR	IS/IP	19	0	0	0	0	0	19	0	01/01/02	
SX-114	ASMD LKR	IS/IP	155	0	30	0	0	30	41	114	01/31/02	
SX-115	ASMD LKR	IS/IP	4	0	0	0	0	0	4	0	01/01/02	
15 TANKS - TOTALS:			3386						911	2475		
241-T TANK FARM STATUS												
T-101	ASMD LKR	IS/PI	100	0	16	0	25	16	37	63	01/01/02	
T-102	SOUND	IS/IP	32	13	3	0	0	16	19	0	08/31/84	
T-103	ASMD LKR	IS/IP	27	4	3	0	0	7	23	0	11/29/83	
T-104	SOUND	IS/PI	317	0	31	0	150	31	317	0	11/30/99	
T-105	SOUND	IS/IP	98	0	5	0	0	5	98	0	05/29/87	
T-106	ASMD LKR	IS/IP	22	0	0	0	0	0	22	0	01/01/01	
T-107	ASMD LKR	IS/PI	173	0	34	0	11	34	173	0	05/31/96	
T-108	ASMD LKR	IS/IP	16	0	4	0	0	4	5	11	01/01/01	
T-109	ASMD LKR	IS/IP	62	0	11	0	0	11	0	62	01/01/02	
T-110	SOUND	IS/IP	370	1	48	0	50	49	369	0	03/31/02	
T-111	ASMD LKR	IS/PI	447	0	38	0	10	38	447	0	01/01/02	
T-112	SOUND	IS/IP	67	7	4	0	0	11	60	0	04/28/82	
T-201	SOUND	IS/IP	31	2	4	0	0	6	29	0	01/01/02	
T-202	SOUND	IS/IP	21	0	3	0	0	3	21	0	07/12/81	
T-203	SOUND	IS/IP	37	0	5	0	0	5	37	0	01/01/02	
T-204	SOUND	IS/IP	37	0	5	0	0	5	37	0	01/01/02	
16 TANKS - TOTAL:			1857						1694	136		
241-TX TANK FARM STATUS												
TX-101	SOUND	IS/IP/CCS	91	0	7	0	0	7	74	17	01/01/02	
TX-102	SOUND	IS/IP/CCS	217	0	27	0	94	27	2	215	03/31/03	
TX-103	SOUND	IS/IP/CCS	145	0	18	0	68	18	0	145	01/01/02	
TX-104	SOUND	IS/IP/CCS	68	2	9	0	4	11	34	32	01/01/02	
TX-105	ASMD LKR	IS/IP/CCS	576	0	25	0	122	25	8	568	01/01/02	
TX-106	SOUND	IS/IP/CCS	348	0	37	0	135	37	5	343	03/31/02	
TX-107	ASMD LKR	IS/IP/CCS	29	0	7	0	0	7	0	29	01/31/03	
TX-108	SOUND	IS/IP/CCS	129	0	8	0	14	8	6	123	01/01/02	
TX-109	SOUND	IS/IP/CCS	363	0	6	0	72	6	363	0	01/01/02	
TX-110	ASMD LKR	IS/IP/CCS	467	0	14	0	115	14	37	430	01/01/02	
TX-111	SOUND	IS/IP/CCS	365	0	10	0	98	10	43	322	01/01/02	
TX-112	SOUND	IS/IP/CCS	634	0	26	0	94	26	0	634	01/01/02	
TX-113	ASMD LKR	IS/IP/CCS	639	0	18	0	19	18	93	546	01/01/02	
TX-114	ASMD LKR	IS/IP/CCS	532	0	17	0	104	17	4	528	01/01/02	
TX-115	ASMD LKR	IS/IP/CCS	554	0	25	0	99	25	9	545	01/31/03	
TX-116	ASMD LKR	IS/IP/CCS	599	0	21	0	24	21	66	533	04/30/03	
TX-117	ASMD LKR	IS/IP/CCS	481	0	10	0	54	10	29	452	01/01/02	
TX-118	SOUND	IS/IP/CCS	256	0	31	0	89	31	0	256	01/01/02	
18 TANKS - TOTAL:			6493						773	5718		

TABLE B-1. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS
August 31, 2003

Official waste volume estimates are from the Best-Basis Inventory dated January 1, 2002, HNF-2978, latest update; and RPP-5556. Sludge and Saltcake volumes include any Retained Gas.

				WASTE VOLUMES							
TANK NO.	TANK INTEGRITY	TANK STATUS	TOTAL WASTE (Kgal)	SUPER-NATANT LIQUID (Kgal)	DRAINABLE INTERSTITIAL LIQUID (Kgal)	PUMPED THIS MONTH (Kgal)	TOTAL PUMPED (Kgal)	DRAINABLE LIQUID REMAINING (Kgal)	SLUDGE (Kgal)	SALT CAKE (Kgal)	SOLIDS VOLUME UPDATE
241-TY TANK FARM STATUS											
TY-101	ASMD LKR	IS/IP/CCS	119	0	2	0	8	2	72	47	01/31/03
TY-102	SOUND	IS/IP/CCS	69	0	13	0	7	13	0	69	01/01/02
TY-103	ASMD LKR	IS/IP/CCS	155	0	23	0	12	23	103	52	01/01/02
TY-104	ASMD LKR	IS/IP/CCS	44	1	4	0	0	5	43	0	03/31/02
TY-105	ASMD LKR	IS/IP/CCS	231	0	12	0	4	12	231	0	04/28/82
TY-106	ASMD LKR	IS/IP/CCS	16	0	1	0	0	1	16	0	01/01/02
6 TANKS - TOTALS			634						465	168	
241-U TANK FARM STATUS											
U-101	ASMD LKR	IS/IP	24	0	4	0	0	4	24	0	01/01/02
U-102	SOUND	IS /PI	327	1	37	0	87	38	43	283	12/31/02
U-103	SOUND	IS/PI	417	1	33	0	99	34	11	405	12/31/02
U-104	ASMD LKR	IS/IP	122	0	0	0	0	0	122	0	01/01/02
U-105	SOUND	IS/PI	353	0	44	0	88	44	32	321	03/30/01
U-106	SOUND	IS/PI	172	3	36	0	39	39	0	169	01/31/03
U-107	SOUND	/PI	287	-	-	2	119	-	15	272	09/30/03
U-108	SOUND	/PI	359	-	-	1	109	-	29	330	09/30/03
U-109	SOUND	IS/PI	401	0	47	0	78	47	35	366	04/30/02
U-110	ASMD LKR	IS/PI	176	0	16	0	0	16	176	0	01/01/02
U-111	SOUND	IS/PI	222	0	31	0	85	31	26	196	08/31/03
U-112	ASMD LKR	IS/IP	45	0	4	0	0	4	45	0	02/10/84
U-201	SOUND	IS/IP	4	1	1	0	0	2	3	0	06/30/03
U-202	SOUND	IS/IP	4	1	0	0	0	1	3	0	06/30/03
U-203	SOUND	IS/IP	3	1	0	0	0	1	2	0	06/30/03
U-204	SOUND	IS/IP	3	1	0	0	0	1	2	0	06/30/03
16 TANKS - TOTALS			2919						568	2342	

Note: +/- 1 Kgal difference in volumes is due to rounding.

TABLE B-2. SINGLE-SHELL TANKS STABILIZATION STATUS SUMMARY
September 30, 2003

Partial Interim Isolated (PI)	Intrusion Prevention Completed (IP)		Interim Stabilized (IS)	
	EAST AREA	WEST AREA	EAST AREA	WEST AREA
A-101	A-103	S-104	A-102	S-103
A-102	A-104		A-103	S-104
	A-105	SX-107	A-104	S-105
AX-101	A-106	SX-108	A-105	S-106
		SX-109	A-106	S-107
BY-102	AX-102	SX-110		S-108
BY-103	AX-103	SX-111	AX-102	S-109
BY-105	AX-104	SX-112	AX-103	S-110
BY-106		SX-113	AX-104	
BY-109	B-FARM - 16 tanks	SX-114		SX-102
	BX-FARM - 12 tanks	SX-115	B-FARM - 16 tanks	SX-103
			BX-FARM - 12 tanks	SX-104
C-103				SX-105
C-105	BY-101	T-102	BY-101	SX-106
C-106	BY-104	T-103	BY-102	SX-107
East Area 11	BY-107	T-105	BY-103	SX-108
	BY-108	T-106	BY-104	SX-109
WEST AREA	BY-110	T-108	BY-105	SX-110
S-101	BY-111	T-109	BY-107	SX-111
S-107	BY-112	T-112	BY-108	SX-112
S-108		T-201	BY-109	SX-113
S-109	C-101	T-202	BY-110	SX-114
S-110	C-102	T-203	BY-111	SX-115
S-111	C-107	T-204	BY-112	
S-112	C-108			
	C-109	TX-FARM - 18 tanks		
SX-101	C-110		C-101	
SX-102	C-111	TY-FARM - 6 tanks	C-102	T-Farm - 16 tanks
SX-103	C-112		C-103	TX-Farm - 18 tanks
SX-104			C-104	TY-Farm - 6 tanks
SX-105		U-101	C-105	U-101
SX-106		U-104	C-107	U-102
		U-112	C-108	U-103
T-101		U-201	C-109	U-104
T-104		U-202	C-110	U-105
T-107		U-203	C-111	U-106
T-110		U-204	C-112	U-109
T-111	East Area 50	West Area 52	C-201	U-110
	Total 102		C-202	U-111
			C-203	U-112
U-102	Retrieval (R)		C-204	U-201
U-103	East Area	West Area	East Area 63	U-202
U-105	C-104	S-102		U-203
U-106	C-106	S-103		U-204
U-107	C-201	S-105		West Area 76
U-108	C-202	S-106		Total 139
U-109	C-203	S-112		
U-110	C-204			
U-111				
West Area 26	East Area 6	West Area 5	Controlled, Clean, and Stable (CCS)	
Total 37		Total 11	East Area	West Area
			BX-Farm - 12 Tanks	TX-Farm - 18 Tanks
				TY Farm - 6 Tanks
			East Area 12	West Area 24
			Total 36	

CCS activities have been deferred until funding is available

TABLE B-3. SINGLE-SHELL TANKS INTERIM STABILIZATION STATUS

September 30, 2003

Tank Number	Tank Integrity	Interim Stabil. Date (1)	Stabil. Method	Tank Number	Tank Integrity	Interim Stabil. Date (1)	Stabil. Method	Tank Number	Tank Integrity	Interim Stabil. Date (1)	Stabil. Method
A-101	SOUND	N/A		C-101	ASMD LKR	11/83	AR	T-108	ASMD LKR	11/78	AR
A-102	SOUND	08/89	SN	C-102	SOUND	09/95	JET(2)	T-109	ASMD LKR	12/84	AR
A-103	ASMD LKR	06/88	AR	C-103	SOUND	07/03	JET (20)	T-110	SOUND	01/00	JET(5)
A-104	ASMD LKR	09/78	AR(3)	C-104	SOUND	09/89	SN	T-111	ASMD LKR	02/95	JET
A-105	ASMD LKR	07/79	AR	C-105	SOUND	10/95	AR	T-112	SOUND	03/81	AR(2)(3)
A-106	SOUND	08/82	AR	C-106	SOUND	N/A		T-201	SOUND	04/81	AR (3)
AX-101	SOUND	N/A		C-107	SOUND	09/95	JET	T-202	SOUND	08/81	AR
AX-102	ASMD LKR	09/88	SN	C-108	SOUND	03/84	AR	T-203	SOUND	04/81	AR
AX-103	SOUND	08/87	AR	C-109	SOUND	11/83	AR	T-204	SOUND	08/81	AR
AX-104	ASMD LKR	08/81	AR	C-110	ASMD LKR	05/95	JET	TX-101	SOUND	02/84	AR
B-101	ASMD IKR	03/81	SN	C-111	ASMD LKR	03/84	SN	TX-102	SOUND	04/83	JET
B-102	SOUND	08/85	SN	C-112	SOUND	09/90	AR	TX-103	SOUND	08/83	JET
B-103	ASMD IKR	02/85	SN	C-201	ASMD LKR	03/82	AR	TX-104	SOUND	09/79	SN
B-104	SOUND	06/85	SN	C-202	ASMD LKR	08/81	AR	TX-105	ASMD LKR	04/83	JET
B-105	ASMD IKR	12/84	AR	C-203	ASMD LKR	03/82	AR	TX-106	SOUND	06/83	JET
B-106	SOUND	03/85	SN	C-204	ASMD LKR	09/82	AR	TX-107	ASMD LKR	10/79	AR
B-107	ASMD LKR	03/85	SN	S-101	SOUND	N/A		TX-108	SOUND	03/83	JET
B-108	SOUND	05/85	SN	S-102	SOUND	N/A		TX-109	SOUND	04/83	JET
B-109	SOUND	04/85	SN	S-103	SOUND	04/00	JET (6)	TX-110	ASMD LKR	04/83	JET
B-110	ASMD LKR	12/84	AR	S-104	ASMD LKR	12/84	AR	TX-111	SOUND	04/83	JET
B-111	ASMD LKR	06/85	SN	S-105	SOUND	09/88	JET	TX-112	SOUND	04/83	JET
B-112	ASMD LKR	05/85	SN	S-106	SOUND	02/01	JET (10)	TX-113	ASMD LKR	04/83	JET
B-201	ASMD LKR	08/81	AR (3)	S-107	SOUND	08/03	JET (22)	TX-114	ASMD LKR	04/83	JET
B-202	SOUND	05/85	AR(2)	S-108	SOUND	12/96	JET	TX-115	ASMD LKR	09/83	JET
B-203	ASMD LKR	06/84	AR	S-109	SOUND	06/01	JET (13)	TX-116	ASMD LKR	04/83	JET
B-204	ASMD LKR	06/84	AR	S-110	SOUND	01/97	JET	TX-117	ASMD LKR	03/83	JET
BX-101	ASMD LKR	09/78	AR(3)	S-111	SOUND	N/A		TX-118	SOUND	04/83	JET
BX-102	ASMD LKR	11/78	AR	S-112	SOUND	N/A		TY-101	ASMD LKR	04/83	JET
BX-103	SOUND	11/83	AR(2)(3)	SX-101	SOUND	08/03	JET (21)	TY-102	SOUND	09/79	AR
BX-104	SOUND	09/89	SN	SX-102	SOUND	08/03	JET (23)	TY-103	ASMD LKR	02/83	JET
BX-105	SOUND	03/81	SN	SX-103	SOUND	05/03	JET (18)	TY-104	ASMD LKR	11/83	AR
BX-106	SOUND	07/95	SN	SX-104	ASMD LKR	04/00	JET (7)	TY-105	ASMD LKR	02/83	JET
BX-107	SOUND	09/90	JET	SX-105	SOUND	08/02	JET (16)	TY-106	ASMD LKR	11/78	AR
BX-108	ASMD LKR	07/79	SN	SX-106	SOUND	05/00	JET (8)	U-101	ASMD LKR	09/79	AR
BX-109	SOUND	08/90	JET	SX-107	ASMD LKR	10/79	AR	U-102	SOUND	06/02	JET (15)
BX-110	ASMD LKR	08/85	SN	SX-108	ASMD LKR	08/79	AR	U-103	SOUND	09/00	JET (9)
BX-111	ASMD LKR	03/95	JET	SX-109	ASMD LKR	05/81	AR	U-104	ASMD LKR	10/78	AR
BX-112	SOUND	09/90	JET	SX-110	ASMD LKR	08/79	AR	U-105	SOUND	03/01	JET (11)
BY-101	SOUND	05/84	JET	SX-111	ASMD LKR	07/79	SN	U-106	SOUND	03/01	JET (12)
BY-102	SOUND	04/95	JET	SX-112	ASMD LKR	07/79	AR	U-107	SOUND	N/A	
BY-103	ASMD LKR	11/97	JET(2)	SX-113	ASMD LKR	11/78	AR	U-108	SOUND	N/A	
BY-104	SOUND	01/85	JET	SX-114	ASMD LKR	07/79	AR	U-109	SOUND	04/02	JET (14)
BY-105	ASMD LKR	03/03	JET	SX-115	ASMD LKR	09/78	AR(3)	U-110	ASMD LKR	12/84	AR
BY-106	ASMD LKR	N/A		T-101	ASMD LKR	04/93	SN	U-111	SOUND	06/03	JET (19)
BY-107	ASMD LKR	07/79	JET	T-102	SOUND	03/81	AR(2)(3)	U-112	ASMD LKR	09/79	AR
BY-108	ASMD LKR	02/85	JET	T-103	ASMD LKR	11/83	AR	U-201	SOUND	08/79	AR
BY-109	SOUND	07/97	JET	T-104	SOUND	11/99	JET(4)	U-202	SOUND	08/79	SN
BY-110	SOUND	01/85	JET	T-105	SOUND	06/87	AR	U-203	SOUND	08/79	AR
BY-111	SOUND	01/85	JET	T-106	ASMD LKR	08/81	AR	U-204	SOUND	08/79	SN
BY-112	SOUND	06/84	JET	T-107	ASMD LKR	05/96	JET				

LEGEND:		Interim Stabilized Tanks	139
AR	= Administratively interim stabilized		
JET	= Saltwell jet pumped to remove drainable interstitial liquid	Not Yet Interim Stabilized	10
SN	= Supernatant pumped (Non-Jet pumped)		
N/A	= Not yet interim stabilized		
ASMD			
LKR	= Assumed Leaker	Total Single-Shell Tanks	149

TABLE B-3. SINGLE-SHELL TANKS INTERIM STABILIZATION STATUS

Footnotes: (in chronological order)

- (1) These dates indicate when the tanks were actually interim stabilized. In some cases, the official interim stabilization documents were issued at a later date.
- (2) Although tanks 241-BX-103, T-102, and T-112 met the interim stabilization administrative procedure at the time they were stabilized, they no longer meet the recently updated administrative procedure. The tanks were re-evaluated in 1996 and letter 9654456, J. H. Wicks to J. K. McClusky, DOE-RL, dated September 30, 1996, was issued which recommended that no further pumping be performed on these tanks, based on an economic evaluation.

Document RPP-5556, Rev. 0, "Updated Drainable Interstitial Liquid Volume Estimates for 119 Single-Shell Tanks Declared Stabilized," J. G. Field, February 7, 2000, states that five tanks no longer meet the stabilization criteria (241-BX-103, T-102, and T-112 exceed the supernatant criteria, and BY-103 and C-102 exceed the Drainable Interstitial Liquid [DIL] criteria).

An intrusion investigation was completed on tank 241-B-202 in 1996 because of a detected increase in surface level. As a result of this investigation, it was determined that this tank no longer meets the recently updated administrative procedure for 200 series tanks.

- (3) Earlier versions of HNF-SD-RE-TI-178, "SST Stabilization Record," indicated that original Interim Stabilization data are missing on four tanks: 241-B-201, T-102, T-112, and T-201. HNF-SD-RE-TI-178, Rev. 7, dated February 9, 2001, added three additional tanks to those missing stabilization data: 241-A-104, BX-101, and SX-115.
- (4) Tank 241-T-104 was declared Interim Stabilized on November 19, 1999. In-tank video taken October 7, 1999, shows the surface is clearly sludge-type waste with no saltcake present. There is no visible supernatant on the surface. Waste surface appears level across tank with numerous cracks. There is a minimal collapsed area around the saltwell screen, with no visible bottom.
- (5) Tank 241-T-110 was declared Interim Stabilized on January 5, 2000, after a major equipment failure. An in-tank video taken October 7, 1999 (pumping was discontinued on August 12, 1999), showed the surface of this tank as smooth, brown-tinted sludge with visible cracks.
- (6) Tank 241-S-103 was declared Interim Stabilized on April 18, 2000. The surface is a rough, black and brown-colored waste with yellow patches of saltcake visible throughout. The surface appears to be damp, but not saturated, and shows irregular cracking typically seen with surfaces beginning to dry out. A pool of supernatant (10 feet in diameter, 5 feet deep, 1.0 Kgallons) is visible from video observations.
- (7) Tank 241-SX-104 was declared Interim Stabilized on April 26, 2000, after a major equipment failure. The surface is a rough, yellowish gray saltcake waste with an irregular surface of visible cracks and shelves that were created as the surface dried out. The waste surface appears to be dry and shows no standing liquid within the tank.
- (8) Tank 241-SX-106 was declared Interim Stabilized on May 5, 2000. The surface is a smooth, white-colored saltcake waste. The surface level slopes slightly from the tank sidewall down to a large depression in the center of the tank. A second depression surrounds both saltwell screens and an abandoned Liquid Observation Well (LOW). The waste surfaces appear dry and show no standing liquid within the tank.

- (9) Tank 241-U-103 was declared Interim Stabilized on September 11, 2000. The surface is a brown colored waste with irregular patches of white salt crystal. Approximately 30% of the waste surface is covered by the salt formations. The surface level slopes slightly from the tank sidewall down to the first of two depressions in the center of the tank. The waste surface appears dry and shows signs of drying and cracking due to saltwell pumping. LOW readings indicate an average adjusted ILL of 60.2 inches. There is a small pool of supernatant estimated to be 500 gallons.
- (10) Tank 241-S-106 was declared Interim Stabilized on February 1, 2001. The surface is a rough, brown and yellow-colored saltcake waste with an irregular surface of mounds and saltcake crystals that were created as the surface was dried out. The waste surface appears to be dry and shows no standing liquid within the tank. There is no evidence of supernatant from video observations. The waste surface slopes gradually from the tank sidewall to the depression in the center of the tank. The depression surrounds both of the saltwell screens, but does not extend around the temperature probe and ENRAF devices.
- (11) Tank 241-U-105 was declared Interim Stabilized on March 29, 2001, after a major equipment failure. The surface is a brown colored waste with irregular patches of white salt crystal. Approximately 15% of the surface is covered by the salt formations. The surface level slopes to the first of two depressions in the center of the tank; the first depression is cone shaped and estimated to be 22 feet in diameter. The second depression, inside the first, is cylindrically shaped and has a diameter of approximately 10 feet. Both depressions are centered on the saltwell screen. The waste surface appears dry and shows signs of cracking due to saltwell pumping. There is no visible liquid in the tank.
- (12) Tank 241-U-106 was declared Interim Stabilized on March 9, 2001. The surface is a dark brown/yellow colored waste that is covered with many stalagmite-type crystals growing on the surface. The crystals cover approximately 75% of the waste surface. The waste surface is irregular, appears dry, and shows only minimal signs of cracking due to saltwell pumping. The supernatant pool is estimated to be 13.3 feet in diameter based on the visible portion of the saltwell screen. The pool is centered on the saltwell screen.
- (13) Tank 241-S-109 was declared Interim Stabilized on June 11, 2001. The surface is primarily a white colored salt crystal with small patches of dark salt visible due to saltwell/sampling activities. Approximately 95% of the waste surface is covered by the salt formations. The surface level slopes slightly from the tank sidewall down to a depression in the center of the tank. The waste surface appears rough and dry and shows signs of cracking and slumping due to saltwell pumping.
- (14) Tank 241-U-109 was declared Interim Stabilized on April 5, 2002. The declaration letter to DOE was issued on June 20, 2002. The surface is primarily a brown colored waste with irregular patches of white salt crystal. Approximately 70% of the waste surface is covered by the salt formations. The surface level slopes slightly from the tank sidewall down to a depression in the center of the tank. The depression is cone shaped and is centered on the saltwell screen. The waste surface appears dry and shows signs of cracking due to saltwell pumping. There is no visible liquid within the tank.
- (15) Tank 241-U-102 was declared Interim Stabilized on June 19, 2002. The declaration letter to DOE was issued June 28, 2002. The surface is primarily a gray-brown colored cracked waste with irregular patches of white salt crystal. Approximately 50% of the waste surface is covered by the salt formations. The surface level slopes slightly from the tank sidewall down to a depression in the center of the tank. The depression is cone shaped and is centered on the saltwell screen. The waste surface appears dry and shows signs of cracking due to saltwell pumping. There is approximately a 5-foot wide pool of visible liquid within the saltwell screen depression.
- (16) Tank 241-SX-105 was declared Interim Stabilized on August 1, 2002; the declaration letter to DOE was issued August 20, 2002. The surface is a rough, yellowish-gray saltcake waste with an irregular surface of visible cracks and shelves due to saltwell pumping. The waste surface appears to be dry and shows no standing water within the tank. The waste surface slopes gradually from the tank sidewall to the center of the tank. There are no large depressions in or around the center of the tank.

- (17) Tank 241-BY-105 was declared Interim Stabilized on March 7, 2003; the declaration letter to DOE was issued March 25, 2003. An in-tank video was taken January 5, 2003. The surface is a rough, yellowish brown saltcake waste with an irregular surface of visible lumps and shelves that were created as the surface was dried out by saltwell pumping. The waste surface appears to be dry and shows no standing water within the tank. A large hole around the saltwell screen shows no evidence of supernatant liquid.
- (18) Tank 241-SX-103 was declared Interim Stabilized on May 31, 2003; the declaration letter to DOE was issued June 13, 2003. An in-tank video was taken December 31, 2001. The upper waste surface is uneven and rough, with many cracks and shelves due to surface drying caused by saltwell pumping. All estimations regarding waste dimensions were obtained by comparison with known dimensions of installed in-tank equipment.
- (19) Tank 241-U-111 was declared Interim Stabilized on June 25, 2003, due to major equipment failure; the declaration letter to DOE was issued July 14, 2003. An in-tank video was taken March 25, 2003. The surface is a dry, crusty, flat surface saltcake waste with a fairly uniform surface of large cracks and pocked holes that were created as the surface was dried out by saltwell pumping. The waste surface is dry and shows no standing water. A hole around the saltwell screen shows no sign of standing water.
- (20) Tank 241-C-103 was declared Interim Stabilized on July 11, 2003, due to major equipment failure; the declaration letter to DOE was issued August 13, 2003. An in-tank video was taken March 3, 2003. The surface is a dry-cracked brown sludge type waste, which appears to be relatively level and to have more cracking near the tank walls. There is a roughly 3-foot diameter supernatant pool around the saltwell screen. There are also small supernatant pools around two risers and many liquid pockets across the center waste surface. The ENRAF is out of service and there is no liquid observation well (LOW) installed in the tank.
- (21) Tank 241-SX-101 was declared Interim Stabilized on August 14, 2003; the declaration letter to DOE was issued August 22, 2003. An in-tank video was taken August 6, 2003. The surface is a rough, yellowish gray saltcake waste with an irregular surface of visible cracks and shelves that were created as the waste was dried out by saltwell pumping. The waste surface appears to be dry and shows no standing water. A cylindrical pool (approximately 5 foot diameter) around the saltwell screen shows evidence of apparent supernatant liquid, but upon closer examination, was determined to be interstitial liquid.
- (22) Tank 241-S-107 was declared Interim Stabilized on August 28, 2003, due to major equipment failure. This tank is in evaluation to confirm interim stabilization criteria have been met.
- (23) Tank 241-SX-102 was declared Interim Stabilized on August 28, 2003, due to major equipment failure. This tank is in evaluation to confirm interim stabilization criteria have been met.

TABLE B-4. SINGLE-SHELL TANK INTERIM STABILIZATION MILESTONES
September 30, 2003

New single-shell tank interim stabilization milestones were negotiated in 1999 and are identified in the "Consent Decree." The Consent Decree was approved on August 16, 1999.

CONSENT DECREE
Attachments A-1 and A-2

The following table is the schedule for pumping liquid waste from the remaining twenty-nine (29) single-shell tanks. This schedule is enforceable pursuant to the terms of the Decree except for the "Projected Pumping Completion Dates," which are estimates only and not enforceable. Also, this schedule does not include tank C-106.

Tank Designation	Projected Pumping Start Date	Actual Pumping Start Date	Projected Pumping Completion Date	Interim Stabilization Date
1. T-104	Already initiated	March 24, 1996	May 30, 1999	November 19, 1999
2. T-110	Already initiated	May 12, 1997	May 30, 1999	January 5, 2000
3. SX-104	Already initiated	September 26, 1997	December 30, 2000	April 26, 2000
4. SX-106	Already initiated	October 6, 1998	December 30, 2000	May 5, 2000
5. S-102	Already initiated	March 18, 1999	March 30, 2001	(Retrieval)
6. S-106	Already initiated	April 16, 1999	March 30, 2001	February 1, 2001
7. S-103	Already initiated	June 4, 1999	March 30, 2001	April 18, 2000
8. U-103 *	June 15, 2000	September 26, 1999	April 15, 2002	September 11, 2000
9. U-105 *	June 15, 2000	December 10, 1999	April 15, 2002	March 29, 2001
10. U-102 *	June 15, 2000	January 20, 2000	April 15, 2002	June 19, 2002
11. U-109 *	June 15, 2000	March 11, 2000	April 15, 2002	April 5, 2002
12. A-101	October 30, 2000	May 6, 2000	September 30, 2003	
13. AX-101	October 30, 2000	July 29, 2000	September 30, 2003	
14. SX-105	March 15, 2001	August 8, 2000	February 28, 2003	August 1, 2002
15. SX-103	March 15, 2001	October 26, 2000	February 28, 2003	May 31, 2003
16. SX-101	March 15, 2001	November 22, 2000	February 28, 2003	August 14, 2003
17. U-106 *	March 15, 2001	August 24, 2000	February 28, 2003	March 9, 2001
18. BY-106	July 15, 2001	July 11, 2001	June 30, 2003	
19. BY-105	July 15, 2001	July 11, 2001	June 30, 2003	March 7, 2003
20. U-108	December 30, 2001	December 2, 2001	August 30, 2003	
21. U-107	December 30, 2001	September 29, 2001	August 30, 2003	
22. S-111	December 30, 2001	December 18, 2001	August 30, 2003	
23. SX-102	December 30, 2001	December 15, 2001	August 30, 2003	August 28, 2003
24. U-111	November 30, 2002	June 14, 2002	September 30, 2003	June 25, 2003
25. S-109	November 30, 2002	September 23, 2000	September 30, 2003	June 11, 2001
26. S-112	November 30, 2002	September 21, 2002	September 30, 2003	(Retrieval)
27. S-101	November 30, 2002	July 27, 2002	September 30, 2003	
28. S-107	November 30, 2002	September 4, 2002	September 30, 2003	August 28, 2003
29. C-103	Pumping operations began in this tank on November 29, 2002, approximately five months ahead of the scheduled start date of April 2003. It is the final tank to begin pumping operations specified in this Decree. Pumping was completed in this tank on March 3, 2003, and a declaration memo that the tank has met interim stabilization criteria was issued on March 7, 2003. This tank was declared Interim Stabilized on July 11, 2003.			

* Tanks containing organic complexants.

Completion of Interim Stabilization. DOE will complete interim stabilization of all 29 single-shell tanks listed above by September 30, 2004.

Percentage of Pumpable Liquid Remaining to be Removed:

93% of Total Liquid	9/30/1999 (1)
38% of Organic Complexed Pumpable Liquids	9/30/2000 (2)
5% of Organic Complexed Pumpable Liquids	9/30/2001 (3)
18% of Total Liquid	9/30/2002 (4)
2% of Total Liquid	9/30/2003 (5)

The “percentage of pumpable liquid remaining to be removed” is calculated by dividing the volume of pumpable liquid remaining to be removed from tanks not yet interim stabilized by the sum of the total amount of liquid that has been pumped and the pumpable liquid that remains to be pumped from all tanks.

- (1) The Pumpable Liquid Remaining was reduced to 88% by September 30, 1999. Reference LMHC-9957926 R1, D. I. Allen, LHMC, to D. C. Bryson, DOE-ORP, dated October 26, 1999.
- (2) The Complexed Pumpable Liquid Remaining was reduced to 38% by September 15, 2000. Reference CHG-0004752, R. F. Wood, CHG, to J. J. Short, DOE-ORP, dated September 13, 2000.
- (3) Reference CHG-0104859, R. F. Wood, CHG, to J. S. O’Connor, DOE-ORP, dated September 20, 2001: this reference states that tanks U-102 and U-109 appear to have met the interim stabilization criteria, thereby reducing the Complexed Pumpable Liquid Remaining to zero. Reference CHG-0202630, dated June 20, 2002, declared tank U-109 Interim Stabilized and confirmed the completion of Consent Decree milestone, Attachment A, Item 11, as well as the partial completion of milestone D-001-004-T01. Reference CHG-0202901, dated June 28, declared tank U-102 Interim Stabilized and confirmed the completion of Consent Decree milestone, Attachment A, Item 10, as well as the partial completion of milestone D-001-004-T01.
- (4) The Pumpable Liquid Remaining was reduced to less than 18% of the total liquid by September 30, 2003. Reference CHG-204636, R. F. Wood, CHG, to J. S. O’Connor, DOE-ORP, dated September 30, 2002. The percentage of pumpable liquid remaining was 17.94% or less than 550 Kgallons.
- (5) The Pumpable Liquid Remaining was reduced to 2% of the total liquid by August 31, 2003, approximately 30 days ahead of the required completion date of September 30, 2003. The confirmation letter to DOE-ORP will be issued in September 2003. The volume of pumpable liquid remaining in the non-stabilized tanks is slightly less than 2% of the original total pumpable volume.

TABLE B-5. SINGLE-SHELL TANK LEAK VOLUME ESTIMATES (Sheet 1 of 6)
September 30, 2003

Tank Number	Date Declared Confirmed or Assumed Leaker (3)	Volume Gallons (2)	Associated KiloCuries 137 Cs (9)	Interim Stabilized Date (11)	Leak Estimate	
					Updated	Reference
241-A-103	1987	5500 (8)		06/88	1987	(j)
241-A-104	1975	500 to 2500	0.8 to 1.8 (q)	09/78	1983	(a)(q)
241-A-105 (1)	1963	10000 to 277000	85 to 760 (b)	07/79	1991	(b)(c)
241-AX-102	1988	3000 (8)		09/88	1989	(h)
241-AX-104	1977	-- (6)		08/81	1989	(g)
241-B-101	1974	-- (6)		03/81	1989	(g)
241-B-103	1978	-- (6)		02/85	1989	(g)
241-B-105	1978	-- (6)		12/84	1989	(g)
241-B-107	1980	8000 (8)		03/85	1986	(d)(f)
241-B-110	1981	10000 (8)		03/85	1986	(d)
241-B-111	1978	-- (6)		06/85	1989	(g)
241-B-112	1978	2000		05/85	1989	(g)
241-B-201	1980	1200 (8)		08/81	1984	(e)(f)
241-B-203	1983	300 (8)		06/84	1986	(d)
241-B-204	1984	400 (8)		06/84	1989	(g)
241-BX-101	1972	-- (6)		09/78	1989	(g)
241-BX-102	1971	70000	50 (l)	11/78	1986	(d)
241-BX-108	1974	2500	0.5 (l)	07/79	1986	(d)
241-BX-110	1976	-- (6)		08/85	1989	(g)
241-BX-111	1984 (13)	-- (6)		03/95	1993	(g)
241-BY-103	1973	<5000		11/97	1983	(a)
241-BY-105	1984	-- (6)		N/A	1989	(g)
241-BY-106	1984	-- (6)		N/A	1989	(g)
241-BY-107	1984	15100 (8)		07/79	1989	(g)
241-BY-108	1972	<5000		02/85	1983	(a)
241-C-101	1980	20000 (8)(10)		11/83	1986	(d)
241-C-110	1984	2000		05/95	1989	(g)
241-C-111	1968	5500 (8)		03/84	1989	(g)
241-C-201 (4)	1988	550		03/82	1987	(i)
241-C-202 (4)	1988	450		08/81	1987	(i)
241-C-203	1984	400 (8)		03/82	1986	(d)
241-C-204 (4)	1988	350		09/82	1987	(i)
241-S-104	1968	24000 (8)		12/84	1989	(g)
241-SX-104	1988	6000 (8)		04/00	1988	(k)
241-SX-107	1964	<5000		10/79	1983	(e)
241-SX-108 (5)(14)	1962	2400 to 35000	17 to 140 (m)(q)(t)	08/79	1991	(m)(q)(t)
241-SX-109 (5)(14)	1965	<10000	<40 (n)(t)	05/81	1992	(n)(t)
241-SX-110	1976	5500 (8)		08/79	1989	(g)
241-SX-111 (14)	1974	500 to 2000	0.6 to 2.4 (f)(q)(t)	07/79	1986	(d)(q)(t)
241-SX-112 (14)	1969	30000	40 (l)(t)	07/79	1986	(d)(t)
241-SX-113	1962	15000	8 (l)	11/78	1986	(d)
241-SX-114	1972	-- (6)		07/79	1989	(g)
241-SX-115	1965	50000	21 (o)	09/78	1992	(o)
241-T-101	1992	7500 (8)		04/93	1992	(p)
241-T-103	1974	<1000 (8)		11/83	1989	(g)
241-T-106	1973	115000 (8)	40 (l)	08/81	1986	(d)
241-T-107	1984	-- (6)		05/96	1989	(g)
241-T-108	1974	<1000 (8)		11/78	1980	(f)
241-T-109	1974	<1000 (8)		12/84	1989	(g)
241-T-111	1979, 1994 (12)	<1000 (8)		02/95	1994	(f)(r)
241-TX-105	1977	-- (6)		04/83	1989	(g)
241-TX-107 (5)	1984	2500		10/79	1986	(d)
241-TX-110	1977	-- (6)		04/83	1989	(g)
241-TX-113	1974	-- (6)		04/83	1989	(g)
241-TX-114	1974	-- (6)		04/83	1989	(g)
241-TX-115	1977	-- (6)		09/83	1989	(g)
241-TX-116	1977	-- (6)		04/83	1989	(g)
241-TX-117	1977	-- (6)		03/83	1989	(g)
241-TY-101	1973	<1000 (8)		04/83	1980	(f)
241-TY-103	1973	3000	0.7 (l)	02/83	1986	(d)
241-TY-104	1981	1400 (8)		11/83	1986	(d)
241-TY-105	1960	35000	4 (l)	02/83	1986	(d)
241-TY-106	1959	20000	2 (l)	11/78	1986	(d)
241-U-101	1959	30000	20 (l)	09/79	1986	(d)
241-U-104	1961	55000	0.09 (l)	10/78	1986	(d)
241-U-110	1975	5000 to 8100 (8)	0.05 (q)	12/84	1986	(d)(q)
241-U-112	1980	8500 (8)		09/79	1986	(d)
67 Tanks		<750,000 - 1,050,000 (7)				

N/A = not applicable (not yet interim stabilized)

TABLE B-5. SINGLE-SHELL TANKS LEAK VOLUME ESTIMATES

Footnotes:

(1) Current estimates [see Reference (b)] are that 610 Kgallons of cooling water was added to tank A-105 from November 1970 to December 1978 to aid in evaporative cooling. In accordance with Dangerous Waste Regulations [Washington Administrative Code 173-303-070 (2)(a)(ii), as amended, Washington State Department of Ecology, 1990, Olympia, Washington], any of this cooling water that has been added and subsequently leaked from the tank must be classified as a waste and should be included in the total leak volume. In August 1991, the leak volume estimate for this tank was updated in accordance with the WAC regulations. Previous estimates excluded the cooling water leaks from the total leak volume estimates because the waste content (concentration) in the cooling water which leaked should be much less than the original liquid waste in the tank (the sludge is relatively insoluble). The total leak volume estimate in this report (10 to 277 Kgallons) is based on the following (see References):

1. Reference (b) contains an estimate of 5 to 15 Kgallons for the initial leak prior to August 1968.
2. Reference (b) contains an estimate of 5 to 30 Kgallons for the leak while the tank was being sluiced from August 1968 to November 1970.
3. Reference (b) contains an estimate of 610 Kgallons of cooling water added to the tank from November 1970 to December 1978, but it was estimated that the leakage was small during this period. This reference contains the statement "Sufficient heat was generated in the tank to evaporate most, and perhaps nearly all, of this water." This results in a low estimate of zero gallons leakage from November 1970 to December 1978.
4. Reference (c) contains an estimate the 378 to 410 Kgallons evaporated out of the tank from November 1970 to December 1978. Subtracting the minimum evaporation estimate from the cooling water added estimate provides a range from 0 to 232 Kgallons of cooling water leakage from November 1970 to December 1978.

	<u>Low Estimate</u>	<u>High Estimate</u>
Prior to August 1968	5,000	15,000
August 1968 to November 1970	5,000	30,000
November 1970 to December 1978	<u>0</u>	<u>232,000</u>
Totals	10,000	277,000

- (2) These leak volume estimates do not include (with some exceptions), such things as: (a) cooling/raw water leaks, (b) intrusions (rain infiltration) and subsequent leaks, (c) leaks inside the tank farm but not through the tank liner (surface leaks, pipeline leaks, leaks at the joint for the overflow or fill lines, etc.), and (d) leaks from catch tanks, diversion boxes, encasements, etc.
- (3) In many cases, a leak was suspected long before it was identified or confirmed. For example, Reference (d) shows that tank U-104 was suspected of leaking in 1956. The leak was confirmed in 1961. This report lists the "assumed leaker" date of 1961. Using present standards, tank U-104 would have been declared an assumed leaker in 1956. In 1984, the criteria designations of "suspected leaker," "questionable integrity," "confirmed leaker," "declared leaker," and "borderline and dormant" were merged into one category now reported as "assumed leaker." See Reference (f) for explanation of when, how long, and how fast some of the tanks leaked. It is highly likely that there have been undetected leaks from single-shell tanks because of the nature of their design and instrumentation.
- (4) The leak volume estimate date for these tanks is before the declared leaker date because the tank was in a suspected leaker or questionable integrity status; however, a leak volume had been estimated prior to the tank being reclassified.

- (5) The increasing radiation levels in drywells and laterals associated with these three tanks could be indicating continuing leak or movement of existing radionuclides in the soil. There is no conclusive way to confirm these observations. (Repeat spectral drywell scans are not part of the current Tank Farm leak detection program but can be run on request a special needs arise. A select subset of drywells is routinely monitored by the Vadose Zone Characterization Project to assess movement of gamma-emitting radionuclides in the subsurface. There are currently no functioning laterals and no plan to prepare them for use).
- (6) Methods were used to estimate the leak volumes from these 19 tanks based on the assumption that their cumulative leakage is approximately the same as for 18 of the 24 tanks identified in footnote (9). For more details see Reference (g). The total leak volume estimate for these tanks is 150 Kgallons (rounded to the nearest Kgallon), for an average of approximately 8 Kgallons for each of 19 tanks.
- (7) The total has been rounded to the nearest 50 Kgallons. Upper bound values were used in many cases in developing these estimates. It is likely that some of these tanks have not actually leaked.
- (8) Leak volume estimate is based solely on observed liquid level decreases in these tanks. This is considered to be the most accurate method for estimating leak volumes.
- (9) The curie content shown is as listed in the reference document and is not decayed to a consistent date: therefore, a cumulative total is inappropriate.
- (10) Tank C-101 experienced a liquid level decrease in the late 1960s and was taken out of service and pumped to a minimum heel in December 1969. In 1970, the tank was classified as a “questionable integrity” tank. Liquid level data show decreases in level throughout the 1970s and the tank was saltwell pumped during the 1970s, ending in April 1979. The tank was reclassified as a “confirmed leaker” in January 1980. See References (q) and (r); refer to Reference (s) for information on the potential for there to have been leaks from other C-farm tanks (specifically, C-102, C-103, and C-109).
- (11) These dates indicate when the tanks were declared to be interim stabilized. In some cases, the official interim stabilization documents were issued at a later date. Also, in some cases, the field work associated with interim stabilization was completed at an earlier date.
- (12) Tank T-111 was declared an “assumed re-leaker” on February 28, 1994, due to a decreasing trend in surface level measurement. This tank was pumped, and interim stabilization completed on February 22, 1995.
- (13) Tank BX-111 was declared an “assumed re-leaker” in April 1993. Preparations for pumping were delayed, following an administrative hold placed on all tank farm operations in August 1993. Pumping resumed and the tank was declared interim stabilized on March 15, 1995.
- (14) The leak volume and curie release estimates on tanks SX-108, SX-109, SX-111, and SX-112 have been re-evaluated using a Historical Leak Model [see Reference (t)]. In general, the model estimates are much higher than the values listed in the table, both for volume and curies released. The values listed in the table do not reflect this revised estimate because, “In particular, it is worth emphasizing that this report was never meant to be a definitive update for the leak baseline at the Hanford Site. It was rather meant to be an attempt to view the issue of leak inventories with a new and different methodology.” (This quote is from the first page of the referenced report).
- (15) **Tri-Party Agreement milestones (M-45 series) were developed that establish a formalized approach for evaluating impacts on groundwater quality of loss of tank wastes to the vadose zone underlying these tank farms.**

SST Vadose Zone Project drilling and testing activities near tank BX-102 were completed in March 2001. A borehole (299-E33-45) was drilled through the postulated uranium plume resulting from the

1951 tank BX-102 overflow event to confirm the presence of uranium, define its present depth, and survey other contaminants of interest such as Tc-99. Samples were collected for laboratory analyses.

Borehole W33-46, adjacent to tank B-110, was drilled to a depth of approximately 190 feet in July 2001. Soil samples were collected for analysis as part of the tank farm vadose zone characterization activities.

On July 31, 2002, the Washington State Department of Ecology issued a letter-directive which suggested a path forward in dealing with the high ⁹⁹Tc activity in groundwater at well 299-W23-19 near tank SX-115. No formal remediation is required, however, extensive purging of the well is to be done concurrent with quarterly sampling. In addition, an array of specific conductivity probes is to be placed in the well to monitor the electrical properties of the water (⁹⁹Tc activity is directly proportional to electrical conductivity). A data logger with remote reading capability together with the specific conductivity probes was installed and fully operational on March 11, 2003.

References:

- (a) Murthy, K. S., et al., June 1983, *Assessment of Single-Shell Tank Residual Liquid Issues at Hanford Site, Washington*, PNL-4688, Pacific Northwest Laboratory, Richland, Washington.
- (b) WHC, 1991a, *Tank 241-A-105 Leak Assessment*, WHC-MR-0264, Westinghouse Hanford Company, Richland, Washington.
- (c) WHC, 1991b, *Tank 241-A-105 Evaporation Estimate 1970 Through 1978*, WHC-EP-0410, Westinghouse Hanford Company, Richland, Washington.
- (d) Smith, D. A., January 1986, *Single-Shell Tank Isolation Safety Analysis Report*, SD-WM-SAR-006, Rev. 1, Rockwell Hanford Operations, Richland, Washington.
- (e) McCann, D. C., and T. S. Vail, September 1984, *Waste Status Summary*, RHO-RE-SR-14, Rockwell Hanford Operations, Richland, Washington.
- (f) Catlin, R. J., March 1980, *Assessment of the Surveillance Program of the High-Level Waste Storage Tanks at Hanford*, Office of Environmental Compliance and Review, for the U.S. Department of Energy, Washington D.C.
- (g) Baumhardt, R. J., May 15, 1989, Letter to R. E. Gerton, U.S. Department of Energy-Richland Operations Office, *Single-Shell Tank Leak Volumes*, 8901832B R1, Westinghouse Hanford Company, Richland, Washington.
- (h) WHC, 1990a, Occurrence Report, *Surface Level Measurement Decrease in Single-Shell Tank 241-AX-102*, WHC-UO-89-023-TF-05, Westinghouse Hanford Company, Richland, Washington.
- (i) Groth, D. R., July 1, 1987, Internal Memorandum to R. J. Baumhardt, *Liquid Level Losses in Tanks 241-C-201, -202 and -204*, 65950-87-517, Westinghouse Hanford Company, Richland, Washington.
- (j) Groth, D. R., and G. C. Owens, May 15, 1987, Internal Memorandum to J. H. Roecker, *Tank 103-A Integrity Evaluation*, Rockwell Hanford Operations, Richland, Washington.
- (k) Dunford, G. L., July 8, 1988, Internal Memorandum to R. K. Welty, *Engineering Investigation: Interstitial Liquid Level Decrease in Tank 241-SX-104*, 13331-88-416, Westinghouse Hanford Company, Richland, Washington.
- (l) ERDA, 1975, *Final Environmental Statement Waste Management Operations, Hanford Reservation, Richland, Washington*, ERDA-1538, 2 vols., U.S. Energy Research and Development Administration, Washington, D.C.
- (m) WHC, 1992a, *Tank 241-SX-108 Leak Assessment*, WHC-MR-0300, Westinghouse Hanford Company, Richland, Washington.
- (n) WHC, 1992b, *Tank 241-SX-109 Leak Assessment*, WHC-MR-0301, Westinghouse Hanford Company, Richland, Washington.
- (o) WHC, 1992c, *Tank 241-SX-115 Leak Assessment*, WHC-MR-0302, Westinghouse Hanford Company, Richland, Washington.
- (p) WHC, 1992d, Occurrence Report, *Apparent Decrease in Liquid Level in Single Shell Underground Storage Tank 241-T-101, Leak Suspected; Investigation Continuing*, RL-WHC-TANKFARM-1992-0073, Westinghouse Hanford Company, Richland, Washington.

- (q) WHC, 1990b, *A History of the 200 Area Tank Farms*, WHC-MR-0132, Westinghouse Hanford Company, Richland, Washington.
- (r) WHC, 1993, *Assessment of Unsaturated Zone Radionuclide Contamination Around Single-Shell Tanks 241-C-105 and 241-C-106*, WHC-SD-EN-TI-185, REV OA, Westinghouse Hanford Company, Richland, Washington.
- (s) WHC, 1994, Occurrence Report, *Apparent Liquid Level Decrease in Single Shell Underground Storage Tank 241-T-111; Declared an Assumed Re-Leaker*, RL-WHC-TANKFARM-1994-0009, Westinghouse Hanford Company, Richland, Washington.
- (t) HNF, 1998, Agnew, S. F., and R. A. Corbin, August 1998, *Analysis of SX Farm Leak Histories - Historical Leak Model (HLM)*, HNF-3233, Rev. 0, Los Alamos National Laboratory, Los Alamos, New Mexico.

APPENDIX C
MISCELLANEOUS UNDERGROUND STORAGE TANKS
AND SPECIAL SURVEILLANCE FACILITIES

TABLE C-1. EAST AND WEST AREA MISCELLANEOUS UNDERGROUND STORAGE TANKS AND SPECIAL SURVEILLANCE FACILITIES

ACTIVE - still running transfers through the associated diversion boxes or pipeline encasements
September 30, 2003

<u>FACILITY</u>	<u>LOCATION</u>	<u>WASTE RECEIVES WASTE FROM: (Gallons)</u>		<u>MONITORED BY</u>	<u>REMARKS</u>
EAST AREA					
241-A-302-A	A Farm	A-151 DB	649	SACS/ENRAF/TMACS	Pumped to AW-105, 7/00
241-ER-311	B Plant	ER-151, ER-152 DB	3903	SACS/ENRAF/Manually	Pumped to AP-108, 7/01
241-AZ-151	AZ Farm	AZ-702 condensate	6319	SACS/ENRAF/TMACS	Volume changes daily - pumped to AZ-101 or AY-102 as needed
241-AZ-154	AZ Farm		25	SACS/MT	
244-BX-TK/SMP	BX	DCRT - Receives from several farms	24513	SACS/MT	Receives transfers and is pumped as needed
244-A-TK/SMP	A Complex	DCRT - Receives from several farms	3873	MCS/SACS/WTF	WTF - Receives transfers and is pumped as needed
A-350	A Farm	Collects drainage	374	MCS/SACS/WTF	WTF (uncorrected). Pumped as needed
AR-204	AY Farm	Tanker trucks from various facilities	775	DIP TUBE	Pumped to AP-108, 7/00
A-417	A Farm		1176	SACS/WTF	WTF returned to service 2/7/03. Pumped to AP 102, 3/03
CR-003-TK/SUMP	C Farm	DCRT	2984	MT/ZIP CORD	Zip cord in sump O/S; water intrusion, 1/98
WEST AREA					
241-TX-302-C	TX Farm	TX-154 DB	102	SACS/ENRAF	TMACS
241-U-301-B	U Farm	U-151, U-152, U-153, U-252 DE	7965	SACS/ENRAF/Manually	Returned to service 12/30/93
241-UX-302-A	U Plant	UX-154 DB	1461	SACS/ENRAF/Manually	Pumped to 244-S, 1/12/03; rain intrusion 2/03
241-S-304	S Farm	S-151 DB	130	SACS/ENRAF/Manually	Recalibration caused decrease 6/03
244-S-TK/SMP	S Farm	From Single-Shell Tanks for transfer to SY-102	19828	SACS/Manually	Replaced S-302-A in 10/91; ENRAF installed 7/98. Sump not alarming.
244-TX-TK/SMP	TX Farm	From Single-Shell Tanks and Plutonium Finishing Plant for transfer to SY-102	4848	SACS/Manually	WTF (uncorrected). Transfer from 222-S Lab via 219-S tank 102, 9/03
Vent Station Catch Tank		Cross Site Transfer Line	433	SACS/Manually	MT. Steam jet transfer from tank D-5, 241-Z facility 1/03. Transferred to SY-102, 6/03
					Line flush from SY-102 to 244-TX, 3/03
					MT. Rain intrusion, 1/03.

Total Active Facilities - 17

Legend:	DB	Diversion Box
	DCRT	Double-Contained Receiver Tank
	TK, SMP	Tank, Sump
	ENRAF	Surface Level Measurement Device
	MT	Surface Level Measurement Device
	Zip Cord	Surface Level Measurement Device
	WTF	Weight Factor (can be recorded as WTF, CWF (uncorrected) and WTF (uncorrected))
	SACS	Surveillance Automated Control System
	MCS	Monitor and Control System
	Manually	Not connected to any automated system
	O/S	Out of Service

(1) Source: WHC-SD-WM-TI-356, Waste Storage Tank Status and Leak Detection Criteria, Rev. 0, September 30, 1988

TABLE C-2. EAST AREA INACTIVE MISCELLANEOUS UNDERGROUND STORAGE TANKS AND SPECIAL SURVEILLANCE FACILITIES (CURRENTLY MANAGED BY TANK FARM CONTRACTOR)

INACTIVE - no longer receiving waste transfers
September 30, 2003

<u>FACILITY</u>	<u>LOCATION RECEIVED WASTE FROM:</u>		<u>WASTE MONITORED</u>		
			<u>(Gallons)</u>	<u>BY</u>	<u>REMARKS</u>
209-E-TK-111	209 E Bldg	Decon Catch Tank	Unknown	NM	Removed from service 1988
241-A-302-B	A Farm	A-152 DB	5837	SACS/MT	Isolated 1985, Project B-138 Interim Stabilized 1990, Rain intrusion
241-AX-151	N of PUREX	PUREX	Unknown	NM	Isolated 1985
241-AX-152	AX Farm	AX-152 DB	0	SACS/MT	Declared Assumed Leaker; pumped to AY-102, 3/01, no longer being used
241-B-301-B	B Farm	B-151, B-152, B-153, B-252 DB	22250	NM	Isolated 1985 (1)
241-B-302-B	B Farm	B-154 DB	4930	NM	Isolated 1985 (1)
241-BX-302-A	BX Farm	BR-152, BX-153, BXR-152, BYR-152 DB	840	NM	Isolated 1985 (1)
241-BX-302-B	BX Farm	BX-154 DB	1040	NM	Isolated 1985 (1)
241-BX-302-C	BX Farm	BX-155 DB	870	NM	Isolated 1985 (1)
241-BY-ITS2-Tk 1	BY Farm	Vapor condenser	Unknown	NM	Isolated
241-BY-ITS2-Tk 2	BY Farm	Heater Flush Tank	Unknown	NM	Stabilized 1977
241-C-301-C	C Farm	C-151, C-152, C-153, C-252 DB	10470	NM	Isolated 1985 (1)
241-ER-311A	SW B Plant	ER-151 DB	Empty	NM	Abandoned in place 1954
244-AR Vault	A Complex	Between farms & B-Plant	Unknown	NM	Stabilized 8/18/03, RPP-12051
244-BXR-TK/SMP-001	BX Farm	Transfer lines	7200	NM	Interim Stabilization 1985 (1)
244-BXR-TK/SMP-002	BX Farm	Transfer lines	2180	NM	Interim Stabilization 1985 (1)
244-BXR-TK/SMP-003	BX Farm	Transfer lines	1810	NM	Interim Stabilization 1985 (1)
244-BXR-TK/SMP-011	BX Farm	Transfer lines	7100	NM	Interim Stabilization 1985 (1)

Total East Area Inactive Facilities - 18

Legend:	DB	Diversion Box
	MT	Surface Level Measurement Device
	SACS	Surveillance Automated Control System
	TK, SMP	Tank, Sump
	NM	Not Monitored

(1) Source: WHC-SD-WM-TI-356, Waste Storage Tank Status and Leak Detection Criteria, Rev. 0, September 30, 1988

TABLE C-3. WEST AREA INACTIVE MISCELLANEOUS UNDERGROUND STORAGE TANKS AND SPECIAL SURVEILLANCE FACILITIES

(CURRENTLY MANAGED BY TANK FARM CONTRACTOR)

INACTIVE - no longer receiving waste transfers
September 30, 2003

<u>FACILITY</u>	<u>LOCATION</u>	<u>RECEIVED WASTE FROM: (Gallons)</u>	<u>WASTE MONITORED BY</u>	<u>REMARKS</u>
213-W-TK-1	E of 213-W Compactor Facility	Water Retention Tank	Unknown NM	Contains only water
231-W-151-001	N. of Z Plant	231-Z Floor drains	Unknown NM	Inactive, last data 1974
231-W-151-002	N. of Z Plant	231-Z Floor drains	Unknown NM	Inactive, last data 1974
241-S-302	S Farm	240-S-151 DB	8223 SACS/ENRAF	Assumed Leaker EPDA 85-04
241-S-302-A	S Farm	241-S-151 DB	0	Assumed Leaker TF-EFS-90-042
Partially filled with grout 2/91, determined still to be an assumed leaker after leak test. Manual FIC readings are unobtainable due to dry grouted surface. CASS monitoring system retired 2/99; intrusion reading discontinued. S-304 replaced S-302				
241-S-302-B	S Farm	S Encasements	Empty NM	Isolated 1985 (1)
241-SX-302 (SX-304)	SX Farm	SX-151 DB, 151 TB	Unknown NM	Isolated 1987
241-T-301	T Farm	DB T-151, -151, -153, -252	Unknown NM	Isolated 1985 (241-T-301B)
241-TX-302	TX Farm	TX-153 DB	Unknown NM	Isolated 1985 (1)
241-TX-302-X-B	TX Farm	TX Encasements	Unknown NM	Isolated 1985 (1)
241-TX-302-B	TX Farm	TX-155 DB	3256 SACS/ENRAF	New ENRAF installed 9/10/02
241-TX-302-B(R)	E. of TX Farm	TX-155 DB	Unknown NM	Isolated
241-TY-302-A	TY Farm	TX-153 DB	Unknown NM	Isolated 1985 (1)
241-TY-302-B	TY Farm	TY Encasements	Empty NM	Isolated 1985 (1)
241-Z-8	E. of Z Plant	Recuplex waste	Unknown NM	Isolated, 1974, 1975
242-T-135	T Evaporator	T Evaporator	Unknown NM	Isolated
242-TA-R1	T Evaporator	Z Plant waste	Unknown NM	Isolated
243-S-TK-1	N. of S Farm	Personnel Decon. Facility	Empty NM	Isolated
244-TXR-TK/SMP-001	TX Farm	Transfer lines	Unknown NM	Interim Stabilized, MT removed 1984 (1)
244-TXR-TK/SMP-002	TX Farm	Transfer lines	Unknown NM	Interim Stabilized, MT removed 1984 (1)
244-TXR-TK/SMP-003	TX Farm	Transfer lines	Unknown NM	Interim Stabilized, MT removed 1984 (1)
244-UR-001	Vault TK U-Farm	Tank, Sump and Cell	4220 NM	Stabilized 1985
244-UR-002	Vault TK U-Farm	Tank, Sump and Cell	1400 NM	Stabilized 1985
244-UR-003	Vault TK U-Farm	Tank, Sump and Cell	5996 NM	Stabilized 1985
244-UR-004	Vault TK U-Farm	Tank, Sump and Cell	Empty NM	Stabilized 1985

Total West Area Inactive Facilities - 25

Legend:	DB, TD	Diversion Box, Transfer Box
	CASS	Computer Automated Surveillance System
	FIC, ENRAF	Surface Level Measurement Devices
	MT	Manual Tape- Surface Level Measurement Device
	TK, SMP	Tank, Sump
	SACS	Surveillance Automated Control System
	R	Replacement
	NM	Not Monitored

(1) Source: WHC-SD-WM-TI-356, Waste Storage Tank Status and Leak Detection Criteria Rev. 0, September 30, 1988

APPENDIX D
GLOSSARY OF TERMS

TABLE D-1. GLOSSARY OF TERMS

1. DEFINITIONS

WASTE TANKS - General

Waste Tank Safety Issue

A potentially unsafe condition in the handling of waste material in underground storage tanks that requires corrective action to reduce or eliminate the unsafe condition. There are currently no waste tank safety issues.

Characterization

Characterization is understanding the Hanford tank waste chemical, physical, and radiological properties to the extent necessary to ensure safe storage and interim operation, and ultimate disposition of the waste.

WASTE TYPES

Aging Waste (AW)

High level, first cycle solvent extraction waste from the PUREX plant (NCAW).

Concentrated Complexant (CC)

Concentrated product from the evaporation of dilute complexed waste.

Concentrated Phosphate Waste (CP)

Waste originating from the decontamination of the N Reactor in the 100 N Area. Concentration of this waste produces concentrated phosphate waste.

Dilute Complexed Waste (DC)

Characterized by a high content of organic carbon including organic complexants: ethylenediaminetetraacetic acid (EDTA), citric acid, and hydroxyethyl-ethylenediaminetriacetic acid (HEDTA), were the major complexants used. Main sources of DC waste in the DST system are saltwell liquid inventory (from SSTs).

Dilute Non-Complexed Waste (DN)

Low activity liquid waste originating from S and T Plants, the 300 and 400 Areas, PUREX facility (decladding supernatant and miscellaneous wastes), 100 N Area (sulfate waste), B Plant, saltwells, and PFP (supernatant).

Drainable Interstitial Liquid (DIL)

Interstitial liquid that is not held in place by capillary forces and will, therefore, migrate or move by gravity.

Double-Shell Slurry (DSS)

Waste that exceeds the sodium aluminate saturation boundary in the evaporator without exceeding receiver tank composition limits. For reporting purposes, DSS is considered a solid.

Double-Shell Slurry Feed (DSSF)

Waste concentrated just before reaching the sodium aluminate saturation boundary in the evaporator without exceeding receiver tank composition limits. This form is not as concentrated as DSS.

Evaporator Feed Tank (EVFD)

Dilute waste staged for evaporation; waste type will vary (usually DN or DC).

PT(PFP TRU Solids)

PFP operations generated a low-level, non-complexed supernate and TRU solids. The solids currently in SY-102 came primarily from past PFP operations and were designated PT. The supernatant currently in this tank is dilute non-complexed, designated as DN.

Slurry Receiver Tank (SRCVR)

Concentrated waste produced by evaporation; waste type will vary (usually DSSF or CC).

Supernatant Liquid

The liquid above the solids or in large liquid pools covered by floating solids in waste storage tanks.

INTERIM STABILIZATION (Single-Shell Tanks only)

Interim Stabilized (IS)

A tank which contains less than 50 Kgallons of drainable interstitial liquid and less than 5 Kgallons of supernatant. If the tank was jet pumped to achieve interim stabilization, then the jet pump flow or saltwell screen inflow must also have been at or below 0.05 gpm before interim stabilization criteria are met.

Jet Pump

The jet pump system includes 1) a jet assembly with foot valve mounted to the base of two pipes that extend from the top of the well casing to near the bottom of the well casing inside the saltwell screen, 2) a centrifugal pump to supply power fluid to the down-hole jet assembly, 3) flexible or rigid transfer jumpers, 4) a flush line, and 5) a flowmeter. The jumpers contain piping, valves, and pressure and limit switches.

The centrifugal pump and jet assembly are needed to pump the interstitial liquid from the saltwell screen into the pump pit, nominally a 40-foot elevation rise. The power fluid passes through a nozzle in the jet assembly and acts to convert fluid pressure head to velocity head, thereby reducing the pressure in the jet assembly chamber. The reduction in pressure allows the interstitial liquid to enter the jet assembly chamber and mix with the power fluid. Velocity head is converted to pressure head above the nozzle, lifting power fluid, and interstitial liquid to the pump pit. Pumping rates vary from 0.05 to about 4 gpm.

Saltwell Screen

The saltwell system is a 10-inch diameter saltwell casing consisting of a stainless steel saltwell screen welded to a Schedule 40 carbon steel pipe. The casing and screen are to be inserted into the 12-inch tank riser located in the pump pit. The stainless steel screen portion of the system will extend through the tank waste to near the bottom of the tank. The saltwell screen portion of the casing is an approximately 10-foot length of 300 Series, 10-inch diameter, stainless steel pipe with screen openings (slots) of 0.05 inches.

Emergency Pumping Trailer

A 45-foot tractor-type trailer is equipped to provide storage space and service facilities for emergency pumping equipment: this consists of two dedicated jet pump jumpers and two jet pumps, piping and dip tubes for each, two submersible pumps and attached piping, and a skid-mounted Weight Factor Instrument Enclosure with an air compressor and electronic recording instruments. The skid also contains a power control station for the pumps, pump pit leak detection, and instrumentation. A rack for over 100 feet of overground double-contained piping is also in the trailer.

INTRUSION PREVENTION (ISOLATION) (Single-Shell Tanks only)

Partially Interim Isolated (PI)

The administrative designation reflecting the completion of the physical effort required for Interim Isolation except for isolation of risers and piping that is required for jet pumping or for other methods of stabilization.

Interim Isolated (II)

The administrative designation reflecting the completion of the physical effort required to minimize the addition of liquids into an inactive storage tank, process vault, sump, catch tank, or diversion box. In June 1993 the term "Interim Isolation" was replaced by "Intrusion Prevention."

Intrusion Prevention (IP)

Intrusion Prevention is the administrative designation reflecting the completion of the physical effort required to minimize the addition of liquids into an inactive storage tank, process vault, sump, catch tank, or diversion box. Under no circumstances are electrical or instrumentation devices disconnected or disabled during the intrusion prevention process (with the exception of the electrical pump).

Controlled, Clean, and Stable (CCS)

Controlled, Clean, and Stable reflects the completion of several objectives: "Controlled" - provide remote monitoring for required instrumentation and implement controls required in the TWRS Authorization Basis; "Clean" - remove surface soil contamination and downpost the Tank Farms to RBA/URMA/RA radiological control status, remove abandoned equipment, and place reusable equipment in compliant storage; and "Stable" - remove pumpable liquids from the SSTs and IMUSTs and isolate the tanks.

Retrieval (R)

The process of removing, to the maximum extent practical, all the waste from a given underground storage tank. The retrieval process is selected specific to each tank and accounts for the waste type stored and the access and support systems available. Generally, retrieval is focused on removal of solids from the tank.

Final Closure

Final closure of the operable units (tank farms) shall be defined as regulatory approval of completion of closure actions and commencement of post-closure actions. For the purposes of this agreement (Hanford Federal Facility Agreement and Consent Order Change Control Form, Change Number M-45-02-03), all units located within the boundary of each tank farm will be closed in accordance with Washington Administrative Code 173-303-610. In evaluating closure operations for single-shell tanks, contaminated soil, and ancillary equipment, the Washington State Department of Ecology and the Washington State Environmental Protection Agency will consider cost, technical practicability, and potential exposure to radiation. Closure of all units within the boundary of a given tank farm will be addressed in a closure plan for single-shell tanks.

TANK INTEGRITY

Sound

The integrity classification of a waste storage tank for which surveillance data indicate no loss of liquid attributed to a breach of integrity.

Assumed Leaker

The integrity classification of a waste storage tank for which surveillance data indicate a loss of liquid attributed to a breach of integrity.

Assumed Re-Leaker

A condition that exists after a tank has been declared as an "assumed leaker" and then the surveillance data indicate a new loss of liquid attributed to a breach of integrity.

TANK INVESTIGATION

Intrusion

A term used to describe the infiltration of liquid into a waste tank.

SURVEILLANCE INSTRUMENTATION

Drywells

Historically, the drywells were monitored with gross logging tools as part of a secondary leak monitoring system. In some cases, neutron-moisture sensors were used to monitor moisture in the soil as a function of well depth, which could be indicative of tank leakage. The routine gross gamma logging data were stored electronically from 1974 through 1994. The routine gross gamma logging program ended in 1994. A program was initiated in 1995 to log each of the available drywells in each tank farm with a spectral gamma logging system. The spectral gamma logging system provides quantitative values for gamma-emitting radionuclides. The baseline spectral gamma logging database is available electronically.

Repeat spectral drywell scans are not part of the established Tank Farm leak detection program, but they can be run on request if special needs arise. A select subset of drywells is routinely monitored by the Vadose Zone Characterization Project to assess movement of gamma-emitting radionuclides in the subsurface.

Laterals

Laterals are horizontal drywells positioned under single-shell waste storage tanks to detect radionuclides in the soil which could be indicative of tank leakage. These drywells can be monitored by radiation detection probes. Laterals are 4-inch inside diameter steel pipes located 8 to 10 feet below the tank's concrete base. There are three laterals per tank. Laterals are located only in A and SX farms. There are currently no functioning laterals and no plan to prepare them for use.

Surface Levels

The surface level measurements in all waste storage tanks are monitored by manual or automatic conductivity probes, and recorded and transmitted or entered into the Surveillance Analysis Computer System.

Automatic FIC

An automatic waste surface level measurement device is manufactured by the Food Instrument Corporation (FIC). The instrument consists of a conductivity electrode (plummet) connected to a calibrated steel tape, a steel tape reel housing and a controller that automatically raises and lowers the plummet to obtain a waste surface level reading. The controller can provide a digital display of the data and until February 1999, the majority of the FICs transmitted readings to the Computer Automated Computer Surveillance System (CASS). Since CASS retirement, all FIC gauges are read manually. FICs are being replaced by ENRAF detectors (see below).

ENRAF 854 ATG Level Detector

FICs and some manual tapes are in the process of being replaced by the ENRAF ATG 854 level detector. The ENRAF gauge, fabricated by ENRAF Incorporated, determines waste level by detecting variations in the weight of a displacer suspended in the tank waste. The displacer is connected to a wire wound onto a precision measuring drum. A change in the waste level causes a change in the weight of the displacer which will be detected by the force transducer. Electronics within the gauge causes the servo motor to adjust the position of the displacer and compute the tank level based on the new position of the displacer drum. The gauge displays the level in decimal inches. The first few ENRAFs that received remote reading capability transmit liquid level data via analog output to the TMACS. The remaining ENRAFs and future installations will transmit digital level data to TMACS via an ENRAF Computer Interface Unit (CIU). The CIU allows fully remote communication with the gauge, minimizing tank farm entry.

Annulus

The annulus is the space between the inner and outer shells on DSTs only. Drain channels in the insulating and/or supporting concrete carry any leakage to the annulus space where conductivity probes are installed. The annulus conductivity probes and radiation detectors are the primary means of leak detection for all DSTs.

Liquid Observation Well (LOW)

In-tank liquid observation wells are used for monitoring the ILL in single-shell tanks. The wells are usually constructed of fiberglass or TEFZEL-reinforced epoxy-polyester resin (TEFZEL is a trademark of E. I. du Pont de Nemours & Company). There are a few LOWs constructed of steel. LOWs are sized to extend to within 1 inch of the bottom of the waste tank, are sealed at their bottom ends, and have a nominal outside diameter of 3.5 inches. Gamma and neutron probes are used to monitor changes in the ILL, and can indicate intrusions or leakage by increases or decreases in the ILL. There are 70 LOWs installed in SSTs that contain or are capable of containing greater than 50 Kgallons of drainable interstitial liquid. All of the LOWs are monitored weekly with the exception of TX-108 which is monitored by request only. Two LOWs installed in DSTs SY-102 and AW-103 are used for special, rather than routine, surveillance purposes only.

Thermocouple (TC)

A thermocouple is a thermoelectric device used to measure temperature. More than one thermocouple element on a device (probe) is called a thermocouple tree. In DSTs there may be one or more thermocouple trees in risers in the primary tank. In addition, in DSTs only, there are TC elements installed in the insulating concrete, the lower primary tank knuckle, the secondary tank concrete foundation, and in the outer structural concrete.

These monitor temperature gradients within the concrete walls, bottom of the tank, and the domes. In SSTs, one or more thermocouples may be installed directly in a tank, although some SSTs do not have any trees installed. A single TC element may be installed in a riser or lowered down an existing riser or LOW. There are also four thermocouple laterals beneath tank 105-A in which temperature readings are taken in 34 TC elements.

In-tank Photographs and Videos

In-tank photographs and videos may be taken to aid in resolving in-tank measurement anomalies and determine tank integrity. Photographs and videos help determine sludge and liquid levels by visual examination.

ACRONYMS - Waste Type acronyms begin on Page D-2

<u>BBI</u>	Best Basis Inventory
<u>CCS</u>	Controlled, Clean, and Stable (tank farms)
<u>CH2M HILL</u>	CH2M HILL Hanford Group, Inc.
<u>DCRT</u>	Double-Contained Receiver Tank
<u>DST</u>	Double-Shell Tank
<u>FSAR</u>	Final Safety Analysis Report effective October 18, 1999
<u>Gal</u>	Gallon
<u>GPM</u>	Gallons Per Minute
<u>II</u>	Interim Isolated
<u>Kgal</u>	Kilogallons
<u>IP</u>	Intrusion Prevention Completed
<u>IS</u>	Interim Stabilized

- MT/FIC/ENRAF Manual Tape, Food Instrument Corporation, ENRAF Corporation (surface level measurement devices)
- OSD Operating Specifications Document
- PI Partial Interim Isolated
- PER Problem Evaluation Request
- PPF Plutonium Finishing Plant
- RBA/URMA/RA Radiological Buffer Area/Underground Radiation Material Area/Radiation Area
- SAR Safety Analysis Report
- SHMS Standard Hydrogen Monitoring System
- SST Single-Shell Tank
- SWL Salt Well Liquid
- TFXR Tank Transfer Database
- TMACS Tank Monitor and Control System
- TPA Hanford Federal Facility Consent and Compliance Order, "Washington State Department of Ecology, U.S. Environmental Protection Agency, and U.S. Department of Energy," as amended (Tri-Party Agreement)
- TSR Technical Safety Requirement
- USQ Unreviewed Safety Question

Additional definitions (used in the SST Inventory columns) follow: (IL, DIL, DLR, PLR, etc.)

2. INVENTORY AND STATUS BY TANK – COLUMN VOLUME CALCULATIONS AND DEFINITIONS FOR TABLE B-1 (Single-Shell Tanks only)

COLUMN HEADING	COLUMN VOLUME CALCULATIONS (Underlined)/DEFINITIONS
Total Waste	<u>Solids volume plus Supernatant Liquid.</u> Solids include sludge and saltcake (see definitions below).
Supernatant Liquid (1)	<u>May be either measured or estimated.</u> Supernatant is either the estimated or measured liquid floating on the surface of the waste or under a floating solids crust. In-tank photographs or videos are useful in estimating the liquid volumes; liquid floating on solids and core sample data are useful in estimating large liquid pools under a floating crust.

COLUMN HEADING	COLUMN VOLUME CALCULATIONS (Underlined)/DEFINITIONS
Drainable Interstitial Liquid (DIL) (1)	<u>This is initially calculated.</u> Drainable interstitial liquid is calculated based on the saltcake and sludge volumes, using calculated porosity values from past pumping or actual data for each tank. Interstitial liquid is liquid that fills the interstitial spaces of the solids waste. The sum of the interstitial liquid contained in saltcake and sludge minus an adjustment for capillary height is the initial volume of drainable interstitial liquid.
Pumped This Month	<u>Net total gallons of liquid pumped from the tank during the month.</u> If supernatant is present, pump production is first subtracted from the supernatant volume. The remainder is then subtracted from the drainable interstitial liquid volume.
Total Pumped (1)	<u>Cumulative net total gallons of liquid pumped from 1979 to date.</u>
Drainable Liquid Remaining (DLR) (1)	<u>Supernatant plus Drainable Interstitial Liquid.</u> The total Drainable Liquid Remaining is the sum of drainable interstitial liquid and supernatant.
Sludge	<u>Solids formed during sodium hydroxide additions to waste.</u> Sludge was usually in the form of suspended solids when the waste was originally received in the tank from the waste generator. In-tank photographs or videos may be used to estimate the volume.
Saltcake	<u>Results from crystallization and precipitation after concentration of liquid waste, usually in an evaporator.</u> If saltcake is layered over sludge, it is only possible to measure total solids volume. In-tank photographs or videos may be used to estimate the saltcake volume.
Solids Volume Update	<u>Indicates the latest update of any change in the solids volume.</u>

(1) Volumes for supernatant, DIL, and DLR are not shown in these columns until interim stabilization is completed. Total gallons pumped, total waste, sludge, and saltcake volumes are shown and adjusted based on actual pumping volumes.

APPENDIX E
TANK CONFIGURATION AND FACILITIES CHARTS


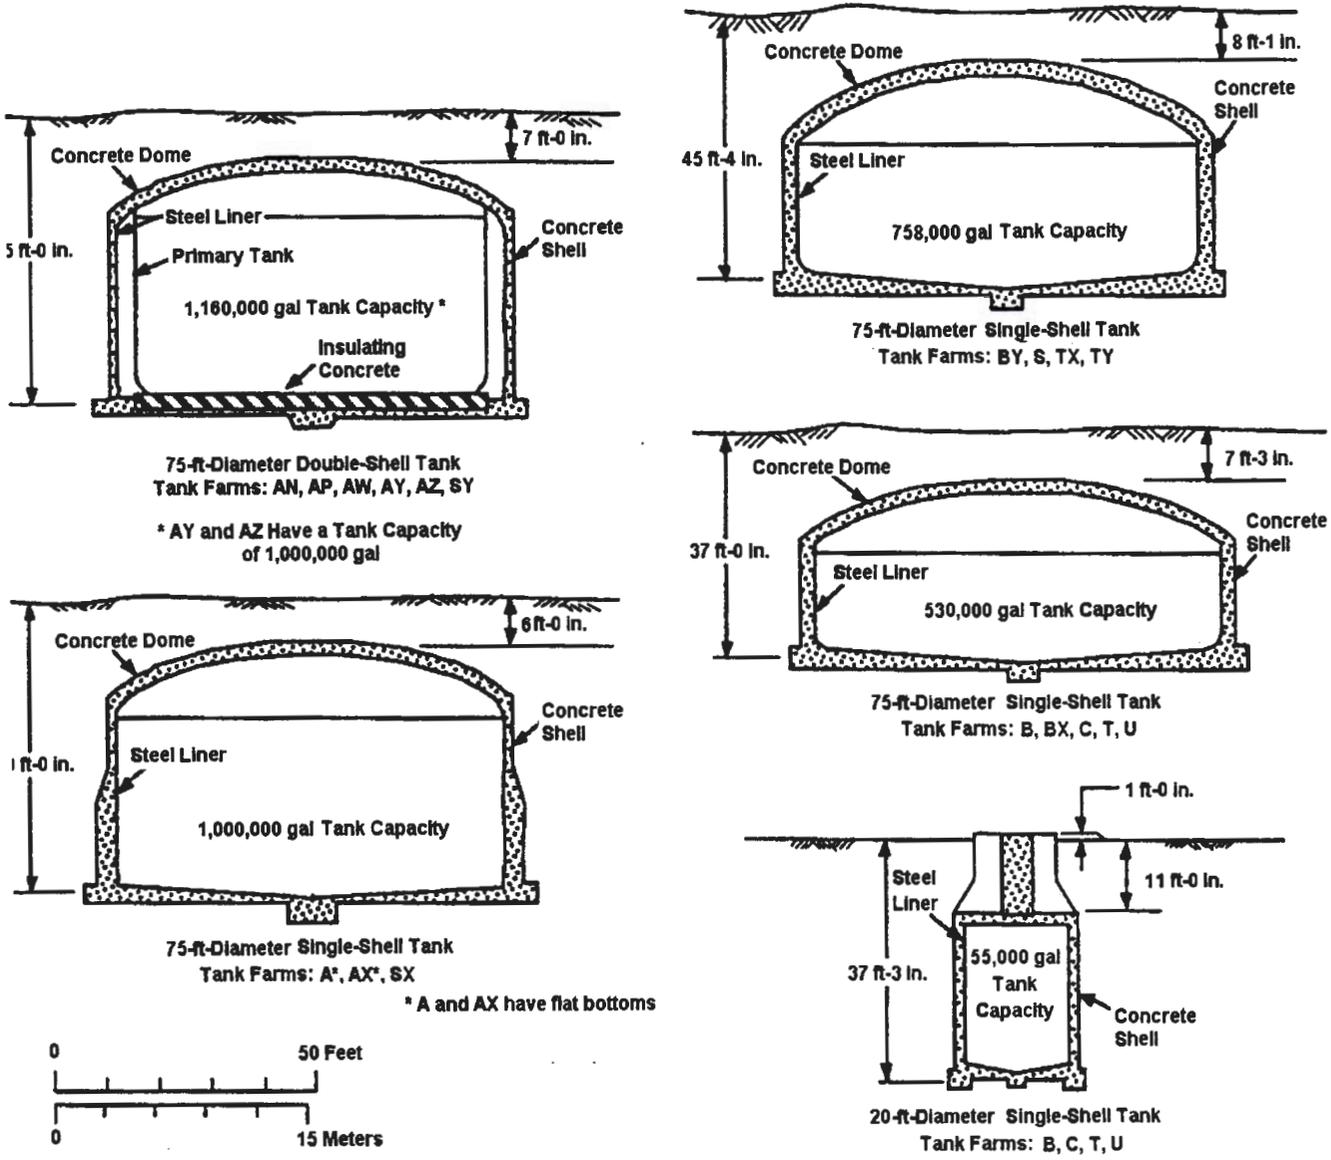


Figure E-1. High-Level Waste Tank Configurations

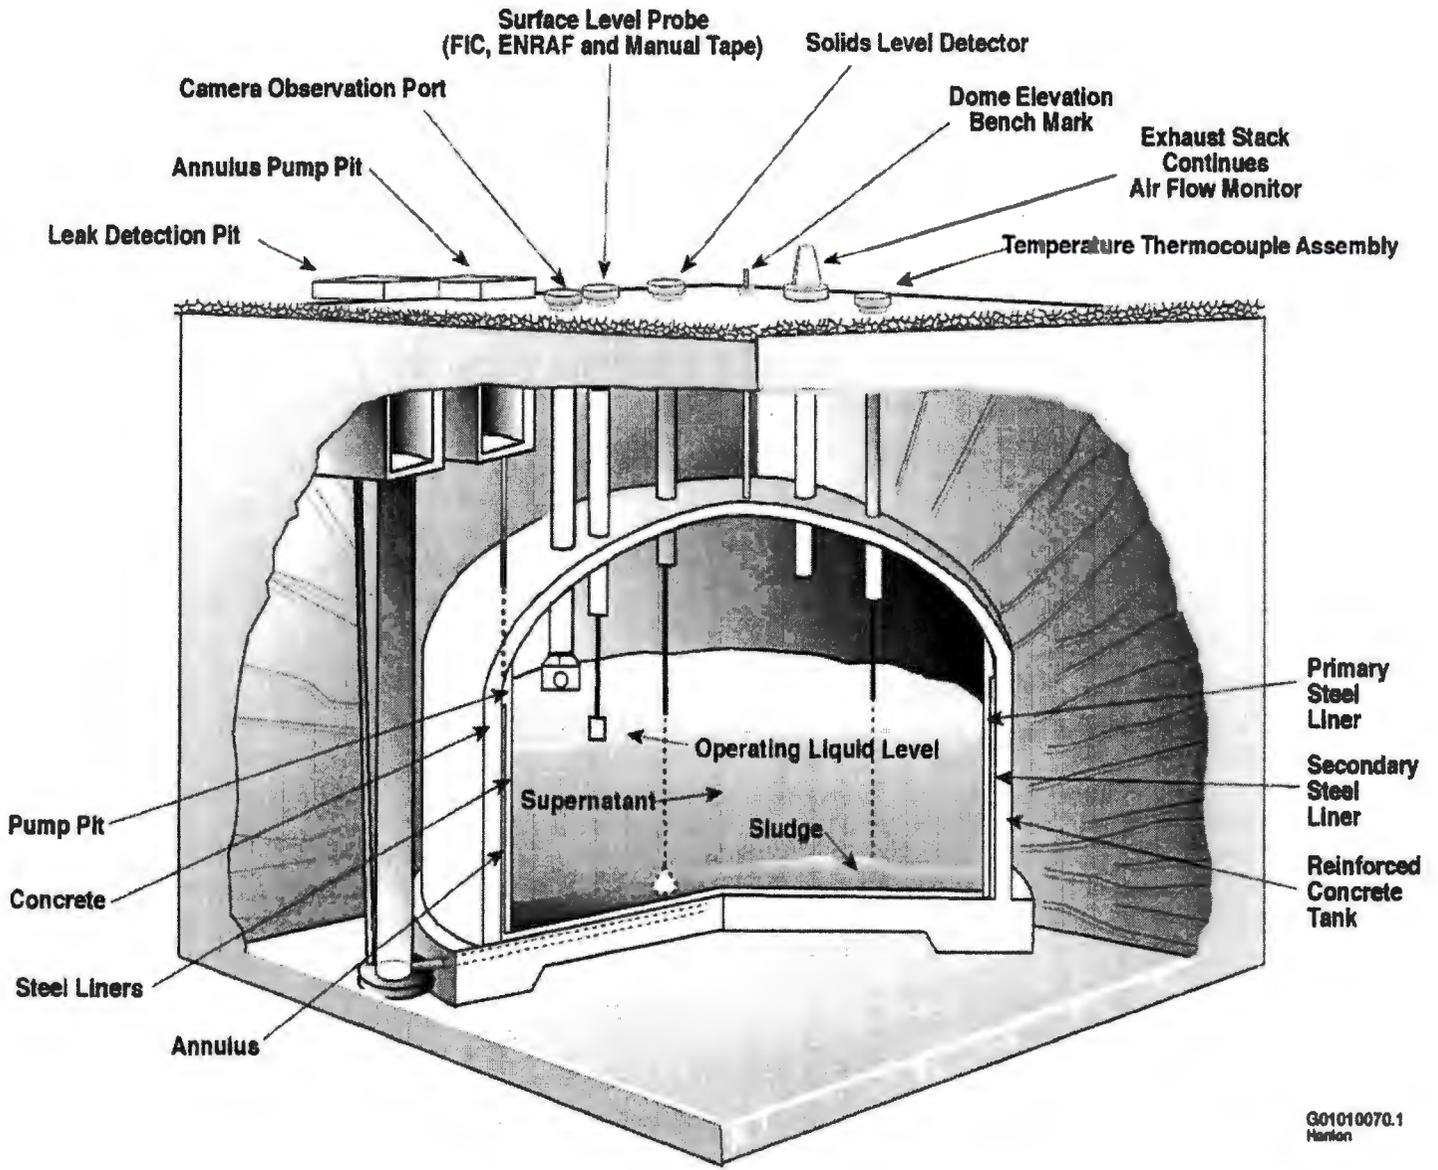

G01010070.1
Hanlon

Figure E-2. Double-Shell Tank Instrumentation Configuration

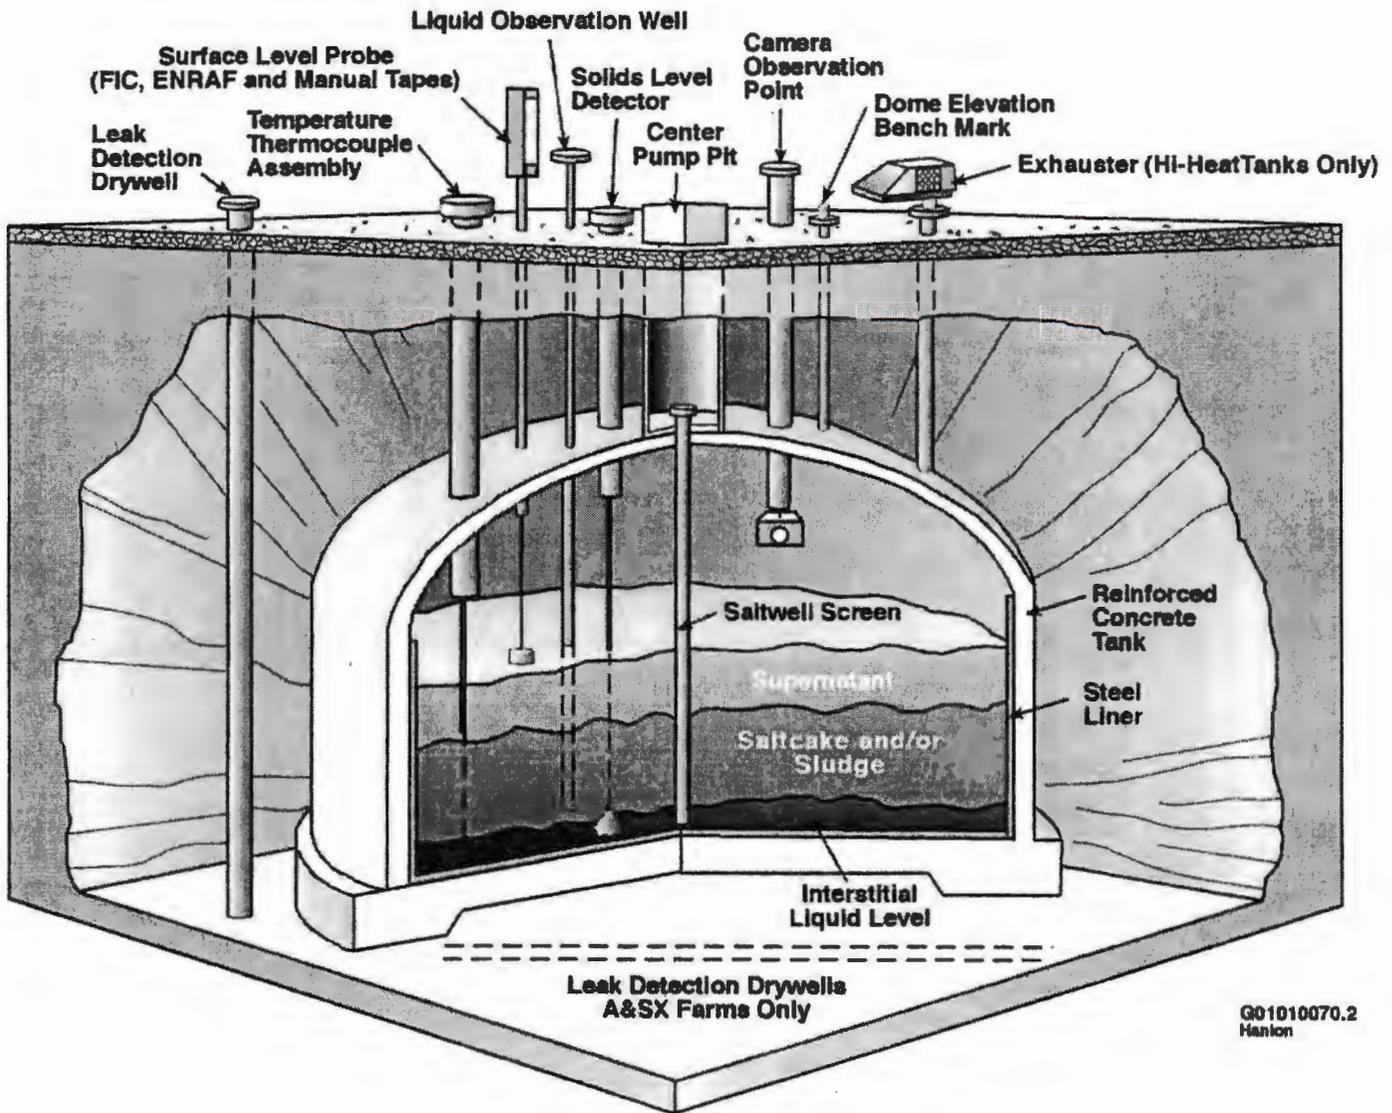


Figure E-3. Single-Shell Tank Instrumentation Configuration

1

MACTEC
8310 Centerbrook Place
Alexandra, VA 22308

Stanley Blacker, Vice President
Do not remove from distribution without permission from addressee

1

CH2M HILL
6060 S. Willow Drive
Greenwood Village, CO 80111-5142

Dr. Bob Iotti, President and General Manager

1

John Marvin, Inc.
12122 N. Guinevere
Spokane, WA 99218

Donald M. Ogden

TRI-CITIES:

3

Washington State Department of Ecology
1315 W. 4th Avenue
Kennewick, WA 99336-6018

Brenda Jentzen
Jeff Lyon
Nancy Uziemblo

1

Richard Welty
409 S. 41st Ave
W. Richland, WA 99353

1

Tri-City Herald
P.O. Box 2608
Tri-Cities, WA 99302

John Stang

1

Harry Babad
2540 Cordoba Ct.
Richland, WA 99352

1

Vista Engineering Technologies
8203 W. Quinault
Bldg. C, Suite 200
Kennewick, WA 99336

J. Pete Sederburg

1

Robert J. Cash
114 Somerset
Richland, WA 99352-1966

ONSITE

1	<u>S. M. Stoller Corporation</u>	
	P. D. Henwood	B2-62
1	<u>General Accounting Office</u>	
	C. R. Abraham	A1-80
1	<u>Washington State Department of Ecology</u>	
	Library	B5-18
1	<u>U.S. Environmental Protection Agency</u>	
	David Bartus	B5-18
15	<u>U.S. Department of Energy</u>	
	C. J. Bosted	H6-60
	D. C. Bryson	H6-60
	M. B. Burandt	H6-60
	V. L. Callahan	H6-60
	S. H. Pfaff	H6-60
	D. H. Irby	H6-60
	D. L. Noyes	H6-60
	Wen-Shou Liou	H6-60
	J. L. Polehn	H6-60
	R. A. Quintero	H6-60
	M. J. Royack	H6-60
	R. W. Russell III	H6-60
	A. J. Stevens	H6-60
	D. J. Williams	H6-60
	Reading Room	H2-53
4	<u>Bechtel National, Inc.</u>	
	P. J. Brackenbury (3)	H4-02/MS1-B
	Neil Brosee	H4-02/MS12-2B
3	<u>Pacific National Northwest Laboratories</u>	
	S. F. Bobrowski	K7-28
	F. L. Leverenz, Jr.	K6-04
	B. E. Opitz	K6-75
60	<u>CH2M HILL Hanford Group, Inc. and Affiliated Companies</u>	
	D. I. Allen	H6-03
	J. C. Allen-Floyd	H6-64
	D. B. Amerine	R2-50
	E. S. Aromi	H6-63
	J. J. Badden	S5-07
	M. V. Berriochoa	H6-04
	K. M. Bowen	R1-44
	J. M. Conner	S5-13
	Q. R. Decker	S4-44
	C. DeFigh-Price	R2-58
	M. A. Fish	R1-14
	R. A. Dodd	S7-83


J. G. Field		R1-44
K. D. Fowler		S5-13
R. Frink		S4-43
M. S. Gerber		B3-30
B. M. Hanlon	(6)	R1-14
B. A. Hasty		H6-04
K. L. Hennesay	(6)	R1-10
B. A. Higley		R1-44
T. M. Hohl		R1-44
T. E. Jones		E6-35
M. R. Kembel		S7-70
N. W. Kirch		R1-44
M. A. Knight		R1-14
J. S. Konyu		H6-64
J. G. Kristofzski		H6-03
J. A. Lechelt		S5-13
R. H. Lipfert		S7-03
V. E. Mehrer		R3-86
A. N. Naiknimbalkar		R1-44
R. Ni		H6-03
S. L. Orcutt		R1-44
R. S. Popielarczyk		H6-03
P. A. Powell		R1-51
B. J. Rabe		S5-07
R. E. Raymond		H6-03
W. E. Ross		S5-08
T. L. Sams		H6-03
D. J. Saueressig		S7-20
L. M. Sasaki		S7-90
N. J. Scott-Proctor		S5-00
G. A. Stanton, Jr.		S7-70
J.A. Voogd		S4-43
Central Files		B1-07
200 West Shift Office		T4-00
200 East Shift Office		S7-02
Environmental		
Data Mgmt Center	(2)	H6-08
Environmental Library		R1-51

200 East Tank Waste Contents

A-Tank Farm- 1954-55

6 @ 1,000,000 GAL Tank Capacity, Single-Shell


Tank	Kgal		
	Sludge	Saltcake	Supernatant
241-A-101	3	392	0
241-A-102	0	37	3
241-A-103	2	364	5
241-A-104	28	0	0
241-A-105	37	0	0
241-A-106	50	29	0

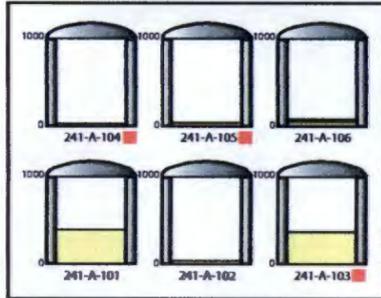

AZ-Tank Farm- 1975-76

2 @ 1,000,000 GAL Tank Capacity, Double-Shell


Tank	Kgal		
	Sludge	Saltcake	Supernatant
241-AZ-101	52	0	906
241-AZ-102	105	0	881

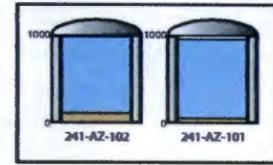

AN-Tank Farm- 1981

7 @ 1,160,000 GAL Tank Capacity, Double-Shell


Tank	Kgal		
	Sludge	Saltcake	Supernatant
241-AN-101	0	0	964
241-AN-102	0	134	944
241-AN-103	0	459	501
241-AN-104	0	445	609
241-AN-105	0	538	590
241-AN-106	0	17	453
241-AN-107	0	235	871

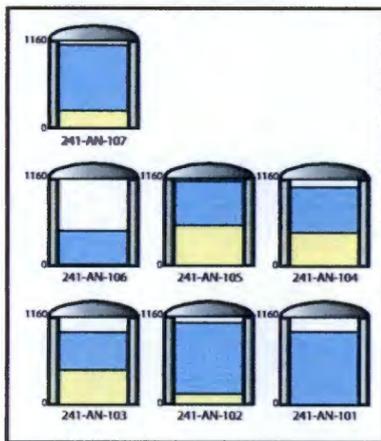

B-Tank Farm- 1945-47

12 @ 530,000 GAL Tank Capacity, Single-Shell


Tank	Kgal		
	Sludge	Saltcake	Supernatant
241-B-101	28	81	0
241-B-102	0	28	4
241-B-103	1	55	0
241-B-104	309	65	0
241-B-105	28	262	0
241-B-106	121	0	1
241-B-107	86	75	0
241-B-108	27	64	0
241-B-109	50	75	0
241-B-110	244	0	1
241-B-111	241	0	1
241-B-112	15	17	3
241-B-201	30	0	0
241-B-202	29	0	0
241-B-203	51	0	1
241-B-204	50	0	1

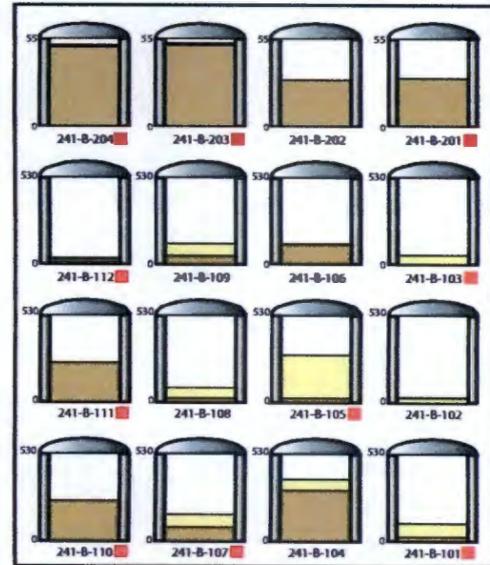

AP-Tank Farm- 1986

8 @ 1,160,000 GAL Tank Capacity, Double-Shell


Tank	Kgal		
	Sludge	Saltcake	Supernatant
241-AP-101	0	0	1111
241-AP-102	23	0	254
241-AP-103	0	0	895
241-AP-104	0	0	1103
241-AP-105	0	89	856
241-AP-106	0	0	1138
241-AP-107	0	0	296
241-AP-108	0	0	81

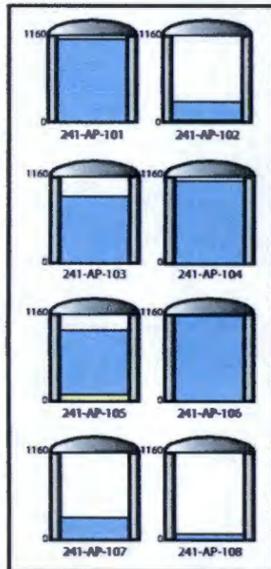

BX-Tank Farm- 1948-50

12 @ 530,000 GAL Tank Capacity, Single-Shell


Tank	Kgal		
	Sludge	Saltcake	Supernatant
241-BX-101	48	0	0
241-BX-102	112	0	0
241-BX-103	62	0	11
241-BX-104	97	0	3
241-BX-105	67	0	5
241-BX-106	38	0	0
241-BX-107	347	0	0
241-BX-108	31	0	0
241-BX-109	193	0	0
241-BX-110	65	139	1
241-BX-111	32	157	0
241-BX-112	163	0	1

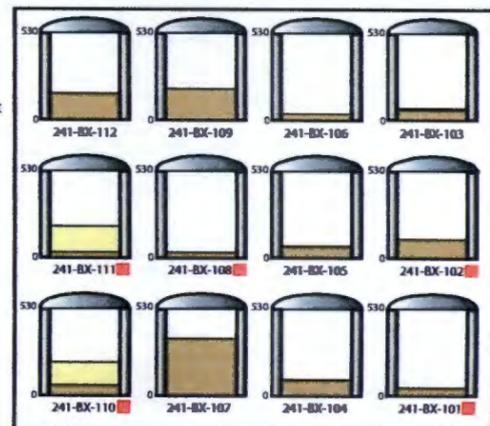

AW-Tank Farm- 1980

6 @ 1,160,000 GAL Tank Capacity, Double-Shell

Tank	Kgal		
	Sludge	Saltcake	Supernatant
241-AW-101	0	396	733
241-AW-102	30	0	255
241-AW-103	273	40	787
241-AW-104	66	157	853
241-AW-105	263	0	159
241-AW-106	0	239	874

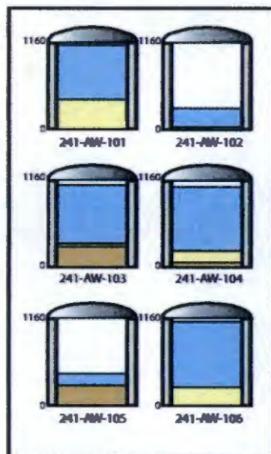

BY-Tank Farm- 1950-51

12 @ 758,000 GAL Tank Capacity, Single-Shell


Tank	Kgal		
	Sludge	Saltcake	Supernatant
241-BY-101	37	333	0
241-BY-102	0	277	0
241-BY-103	9	408	0
241-BY-104	45	313	0
241-BY-105	48	433	0
241-BY-106	32	439	0
241-BY-107	15	256	0
241-BY-108	40	182	0
241-BY-109	24	253	0
241-BY-110	43	323	0
241-BY-111	0	302	0
241-BY-112	2	284	0



AX-Tank Farm- 1965-66

4 @ 1,000,000 GAL Tank Capacity, Single-Shell


Tank	Kgal		
	Sludge	Saltcake	Supernatant
241-AX-101	3	316	0
241-AX-102	6	24	0
241-AX-103	8	99	0
241-AX-104	7	0	0

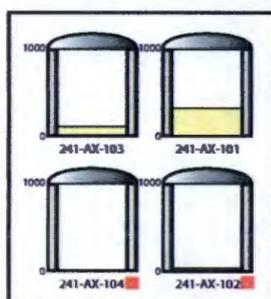

C-Tank Farm- 1946-53

12 @ 530,000 GAL Tank Capacity, Single-Shell

Tank	Kgal		
	Sludge	Saltcake	Supernatant
241-C-101	88	0	0
241-C-102	316	0	0
241-C-103	72	0	1
241-C-104	259	0	0
241-C-105	132	0	0
241-C-106	9	0	3
241-C-107	248	0	0
241-C-108	66	0	0
241-C-109	64	0	0
241-C-110	177	0	1
241-C-111	58	0	0
241-C-112	104	0	0
241-C-201	1	0	0
241-C-202	1	0	0
241-C-203	3	0	0
241-C-204	2	0	0

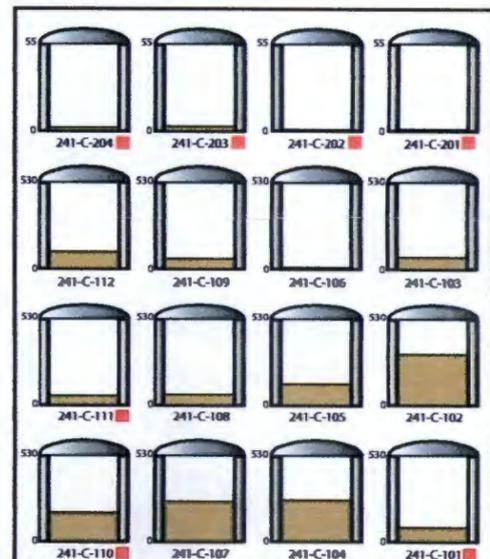

LEGEND

Sludge Saltcake Supernatant Available Space Assumed/Confirmed Leaker Data Derived From Waste Tank Summary Report Dated 9/30/03


VAPO12CHARDOSAB By Staff Member/alknmbalkar/Tank Figures/200 East Tank Profile 093003.pdf

Figure E-4

200 West Tank Waste Contents


S-Tank Farm- 1950-51 12 @ 758,000 GAL Tank Capacity, Single-Shell Kgal

Tank	Sludge	Saltcake	Supernatant
241-S-101	122	229	0
241-S-102	22	416	0
241-S-103	9	228	1
241-S-104	132	156	0
241-S-105	2	404	0
241-S-106	0	455	0
241-S-107	292	19	0
241-S-108	5	545	0
241-S-109	13	520	0
241-S-110	96	293	0
241-S-111	75	340	0
241-S-112	6	590	0

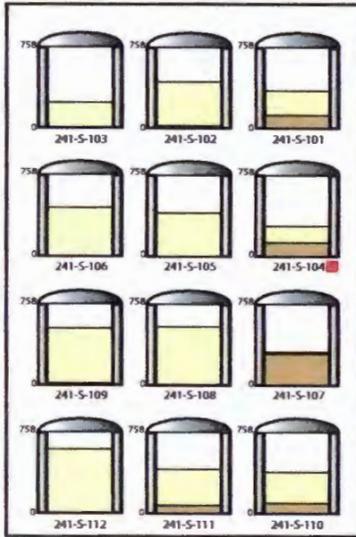


TX-Tank Farm- 1947-48 18 @ 758,000 GAL Tank Capacity, Single-Shell Kgal

Tank	Sludge	Saltcake	Supernatant
241-TX-101	74	17	0
241-TX-102	2	215	0
241-TX-103	0	145	0
241-TX-104	34	32	2
241-TX-105	8	568	0
241-TX-106	5	343	0
241-TX-107	0	29	0
241-TX-108	6	123	0
241-TX-109	363	0	0
241-TX-110	37	430	0
241-TX-111	43	322	0
241-TX-112	0	634	0
241-TX-113	93	546	0
241-TX-114	4	528	0
241-TX-115	9	545	0
241-TX-116	66	533	0
241-TX-117	29	452	0
241-TX-118	0	256	0

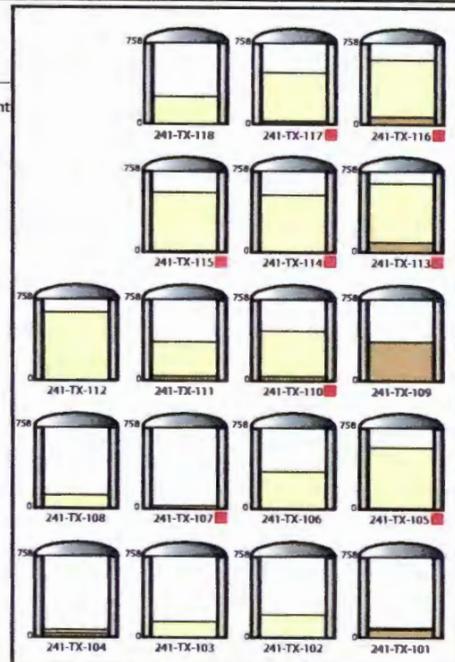


SX-Tank Farm- 1953-54 15 @ 1,000,000 GAL Tank Capacity, Single-Shell Kgal

Tank	Sludge	Saltcake	Supernatant
241-SX-101	144	274	0
241-SX-102	55	354	0
241-SX-103	78	431	0
241-SX-104	136	310	0
241-SX-105	63	312	0
241-SX-106	0	396	0
241-SX-107	79	16	0
241-SX-108	73	0	0
241-SX-109	58	183	0
241-SX-110	29	27	0
241-SX-111	76	39	0
241-SX-112	56	19	0
241-SX-113	19	0	0
241-SX-114	41	114	0
241-SX-115	4	0	0

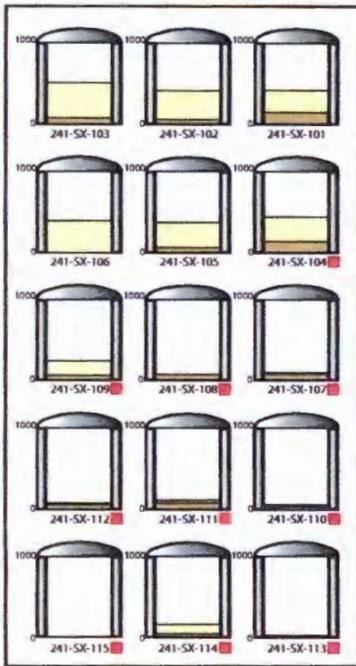


TY-Tank Farm- 1951-52 6 @ 758,000 GAL Tank Capacity, Single-Shell Kgal

Tank	Sludge	Saltcake	Supernatant
241-TY-101	72	47	0
241-TY-102	0	69	0
241-TY-103	103	52	0
241-TY-104	43	0	1
241-TY-105	231	0	0
241-TY-106	16	0	0

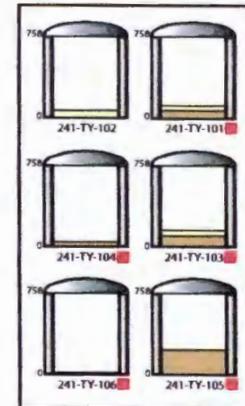


SY-Tank Farm- 1977 3 @ 1,160,000 GAL Tank Capacity, Double-Shell Kgal

Tank	Sludge	Saltcake	Supernatant
241-SY-101	0	275	691
241-SY-102	145	0	876
241-SY-103	0	342	395

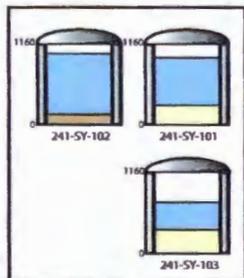


T-Tank Farm- 1943-44 12 @ 530,000 GAL Tank Capacity, Single-Shell 4 @ 55,000 GAL Tank Capacity, Single-Shell Kgal

Tank	Sludge	Saltcake	Supernatant
241-T-101	37	63	0
241-T-102	19	0	13
241-T-103	23	0	4
241-T-104	317	0	0
241-T-105	98	0	0
241-T-106	22	0	0
241-T-107	173	0	0
241-T-108	5	11	0
241-T-109	0	62	0
241-T-110	369	0	1
241-T-111	447	0	0
241-T-112	60	0	7
241-T-201	29	0	2
241-T-202	21	0	0
241-T-203	37	0	0
241-T-204	37	0	0

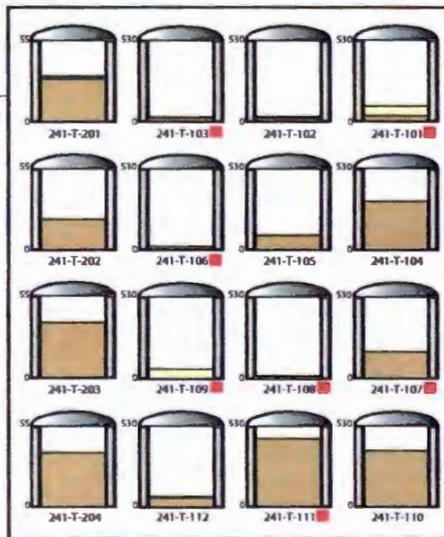


U-Tank Farm- 1946-49 12 @ 530,000 GAL Tank Capacity, Single-Shell 4 @ 55,000 GAL Tank Capacity, Single-Shell Kgal

Tank	Sludge	Saltcake	Supernatant
241-U-101	24	0	0
241-U-102	43	283	1
241-U-103	11	405	1
241-U-104	122	0	0
241-U-105	32	321	0
241-U-106	0	169	3
241-U-107	15	272	0
241-U-108	29	330	0
241-U-109	35	366	0
241-U-110	176	0	0
241-U-111	26	196	0
241-U-112	45	0	0
241-U-201	3	0	1
241-U-202	3	0	1
241-U-203	2	0	1
241-U-204	2	0	1

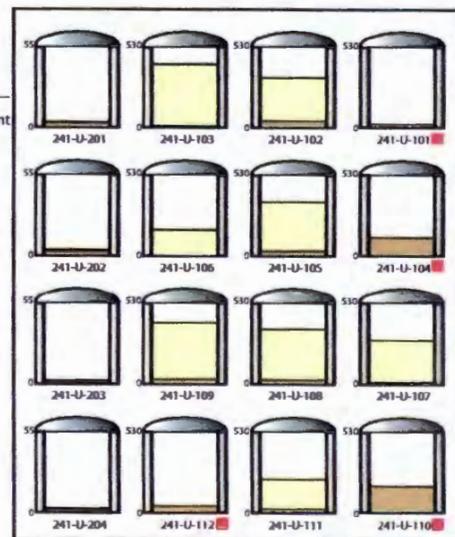

LEGEND

Sludge (brown) Saltcake (yellow) Supernatant (light blue) Available Space (white) Assumed/Confirmed Leaker (red square) Data Derived From Waste Tank Summary Report Dated 9/30/03





UAP0127CHRWDCSAB by Staff Member/Health/Industrial/Tank Figures/200 West Tank Profile 09/30/03.pdf

Figure E-5

Hanford Tank Farm Facilities 200 East

Note:
All single-shell tanks were removed from service (not allowed to receive waste) on or before November 21, 1980

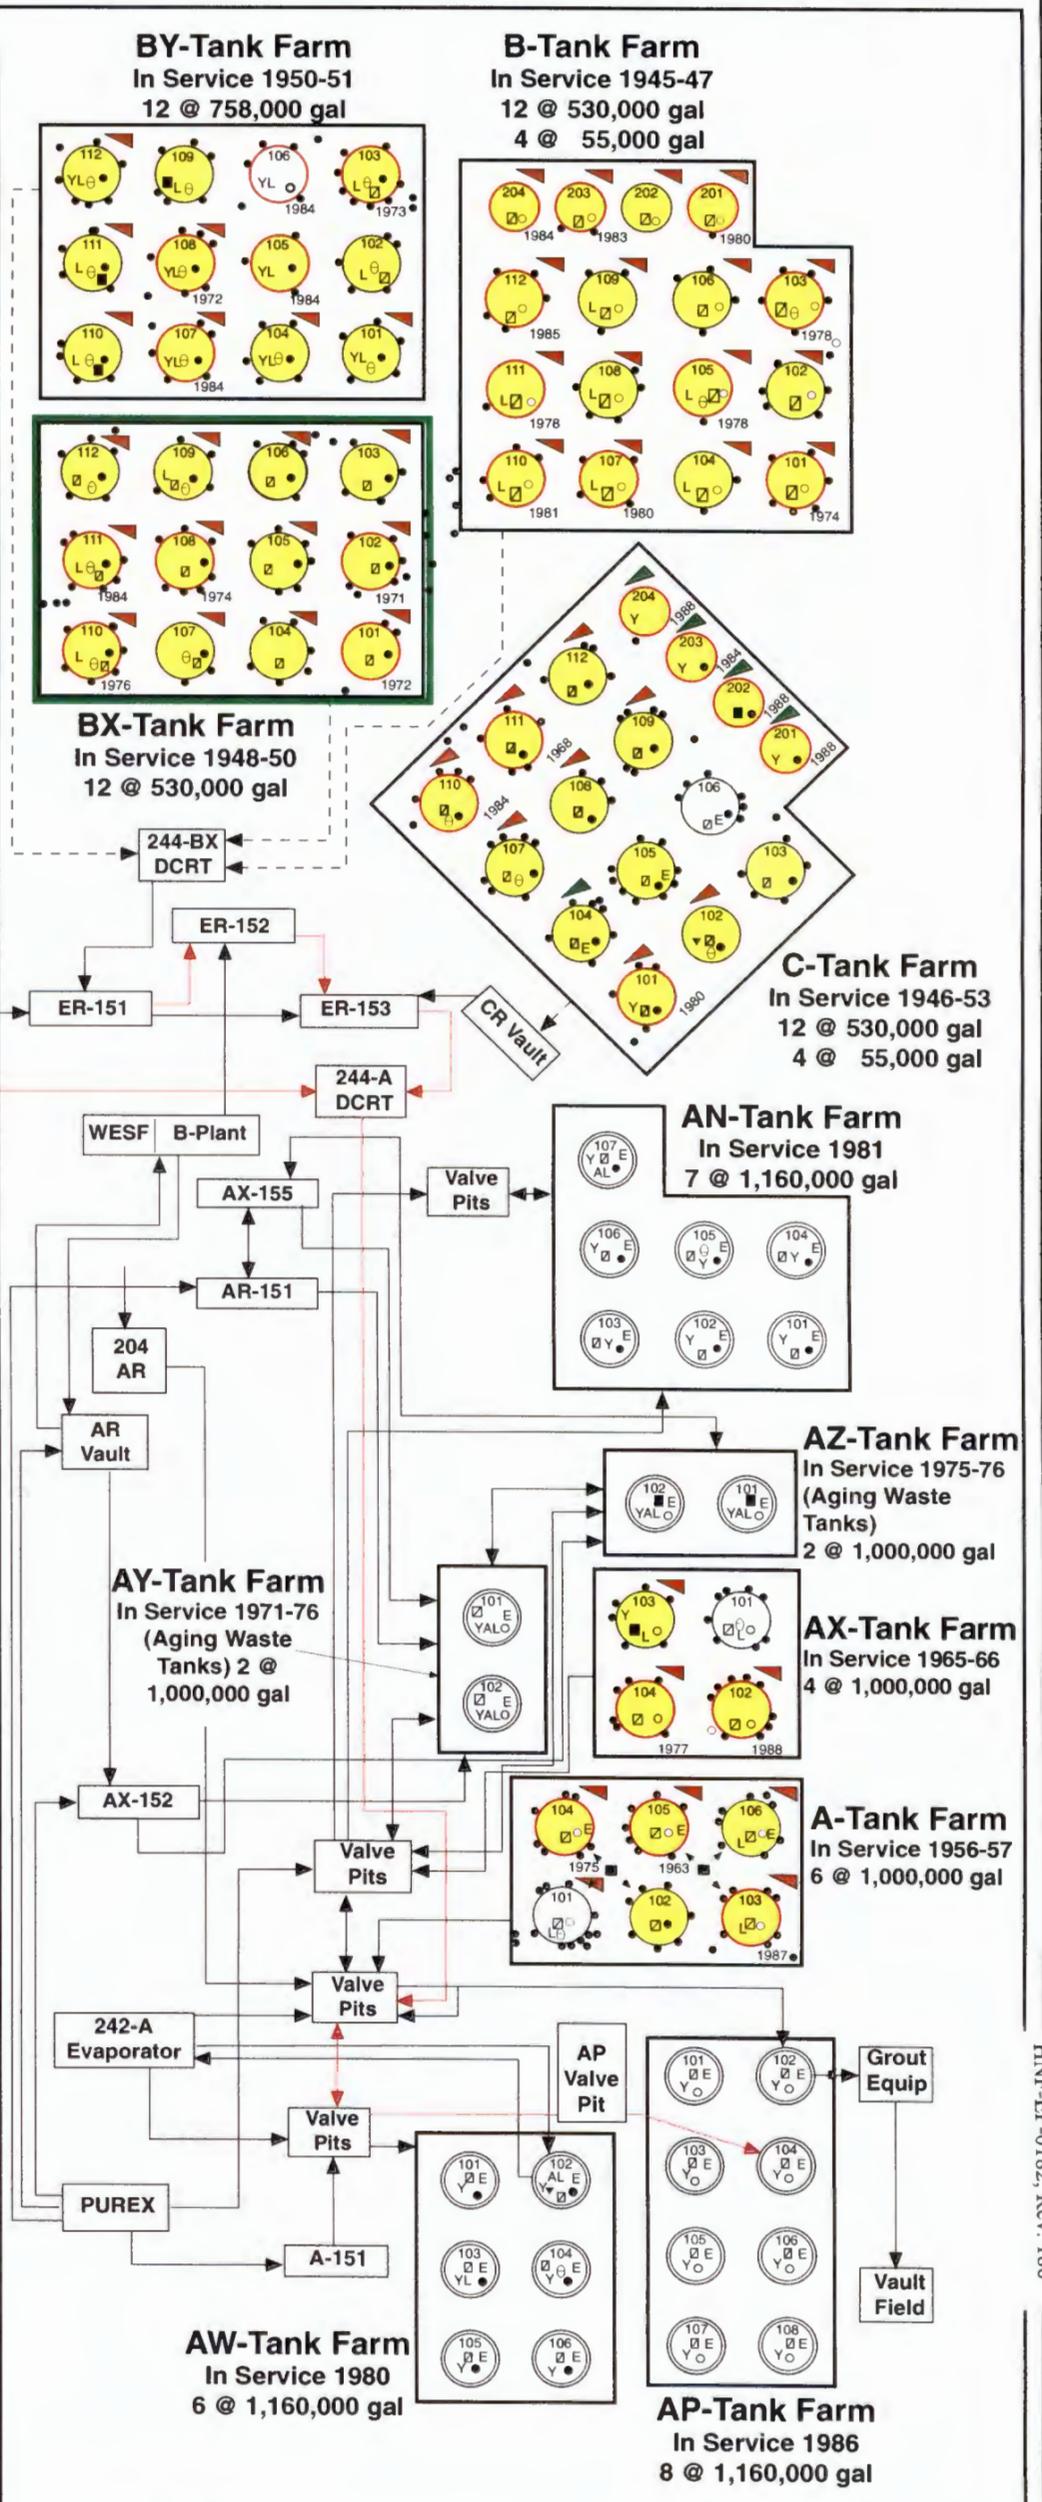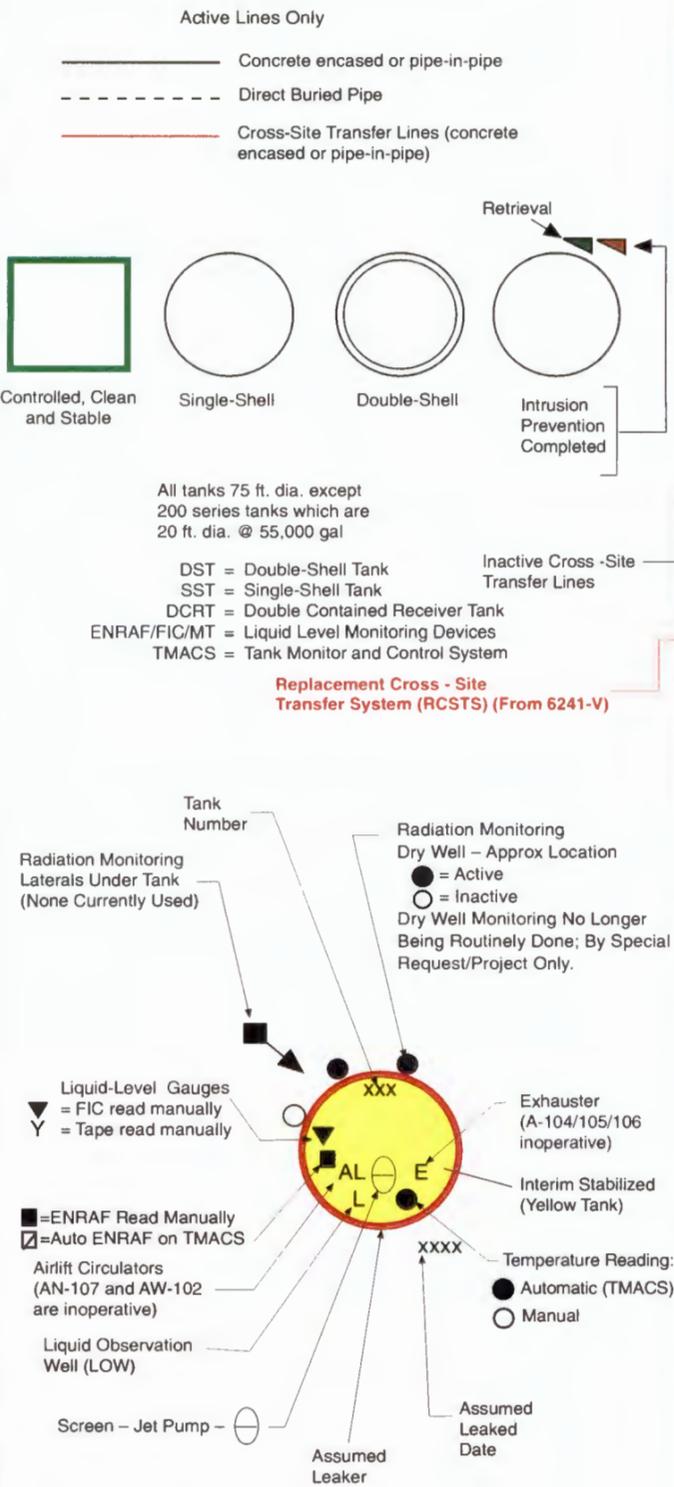

Status as of September 30, 2003
Updated Quarterly
Issued by River Protection Project

Figure E-6
(Schematic)

G03100050.E
09/30/03

E-9/10


HNF-EP-0182, Rev. 186

Hanford Tank Farm Facilities 200 West

Note:
All single-shell tanks were removed from service (not allowed to receive waste) on or before November 21, 1980

Active Lines Only

- Concrete encased or pipe-in-pipe
- - - Direct Buried Pipe
- Cross-Site Transfer Lines (concrete encased or pipe-in-pipe)

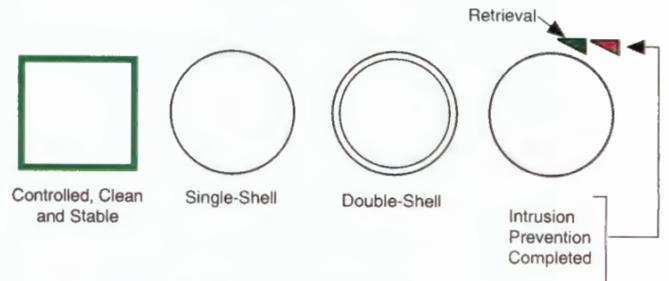

All tanks 75 ft. dia. except 200 series tanks which are 20 ft. dia. @ 55,000 gal

- DST = Double-Shell Tank
- SST = Single-Shell Tank
- DCRT = Double Contained Receiver Tank
- ENRAF/FIC/MT = Liquid Level Monitoring Devices
- TMACS = Tank Monitor and Control System

High Heat Load Tanks = West Area - SX-107/108/109/110/111/112/114

Radiation Monitoring Dry Well - Approx Location
● = Active
○ = Inactive
Dry Well Monitoring No Longer Being Routinely Done; By Special Request/Project Only.

Radiation Monitoring Laterals Under Tank (None Currently Used)

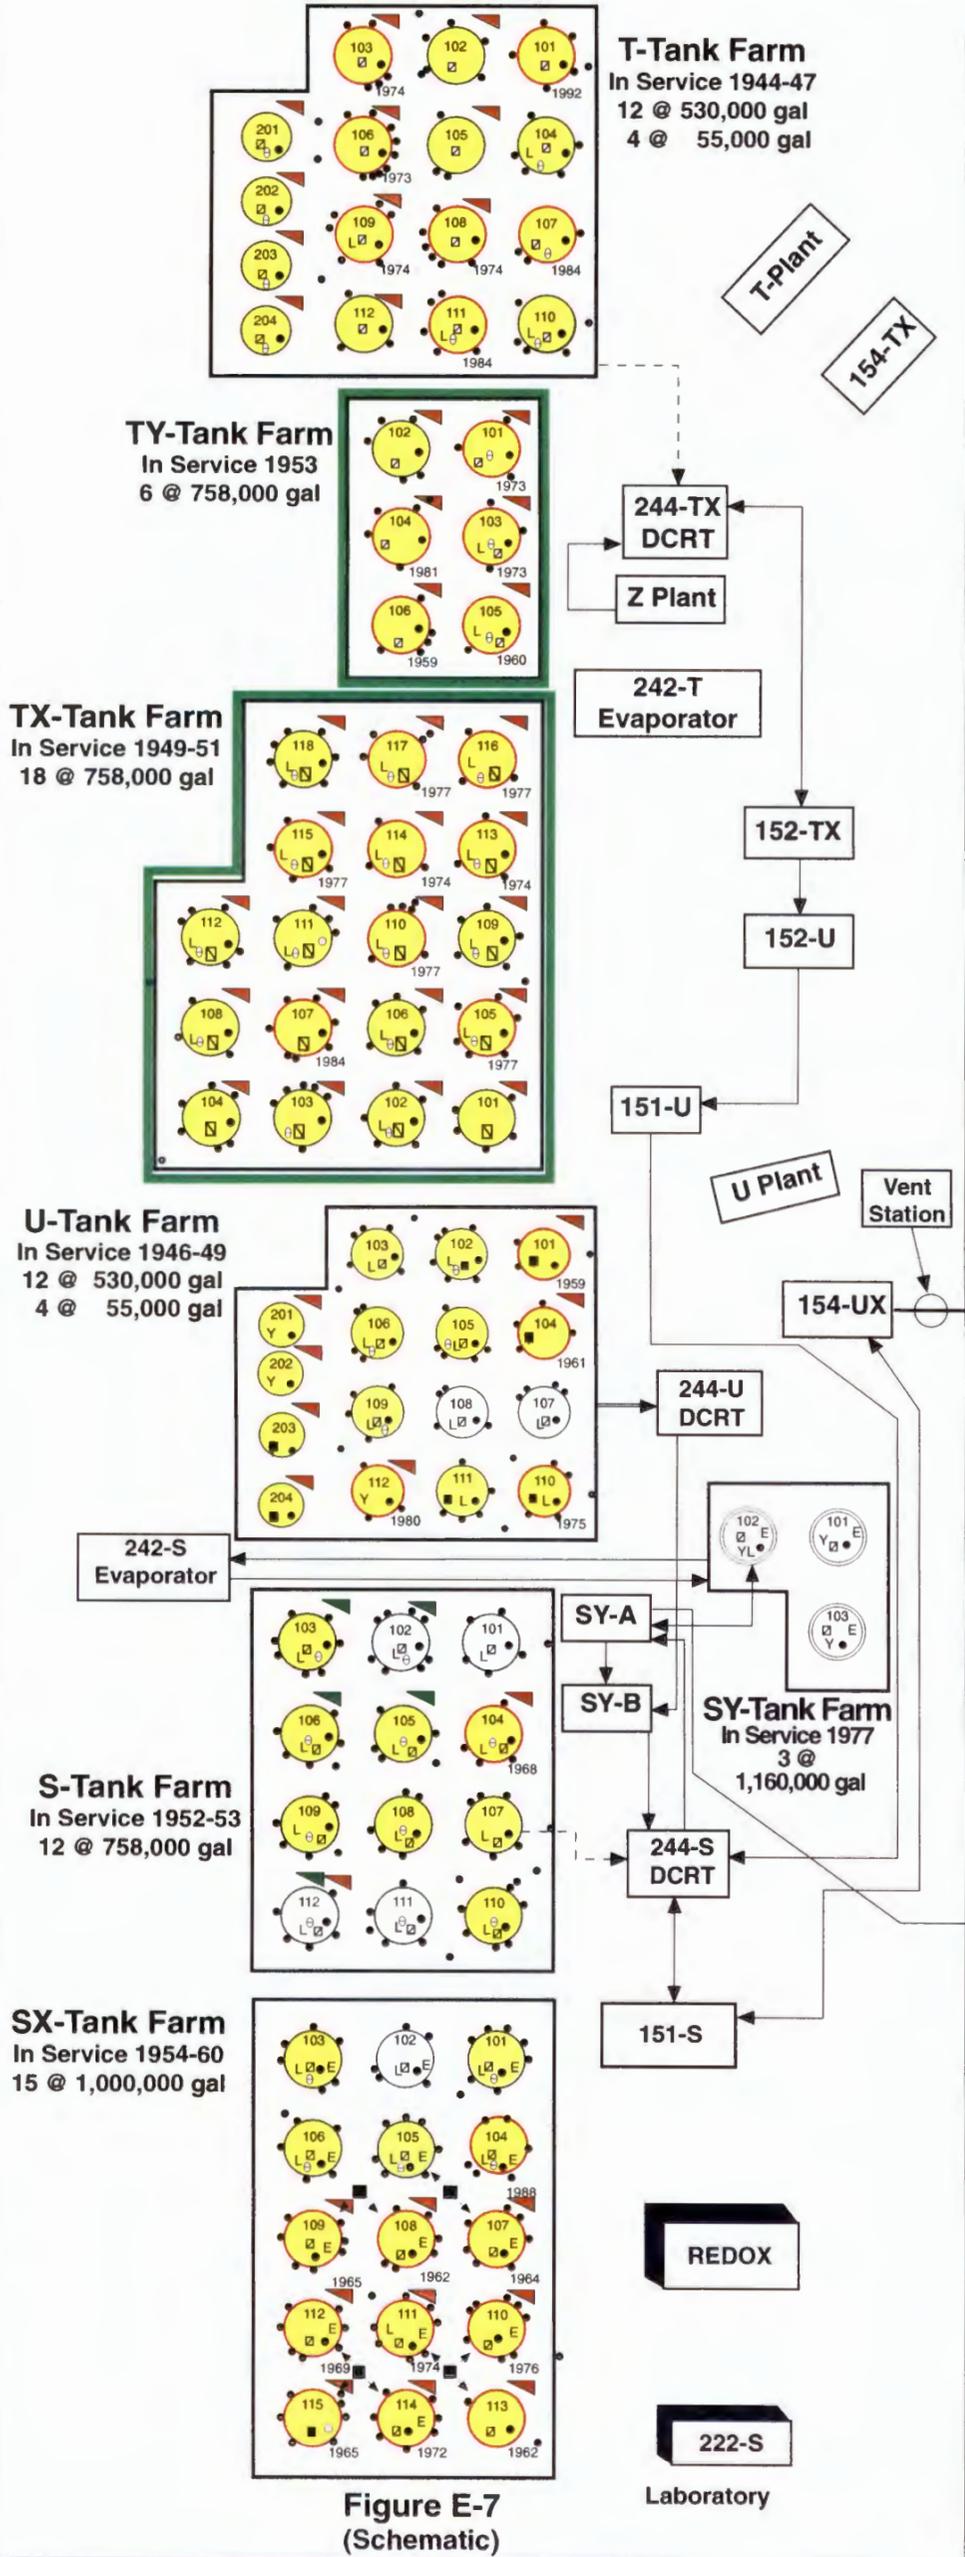
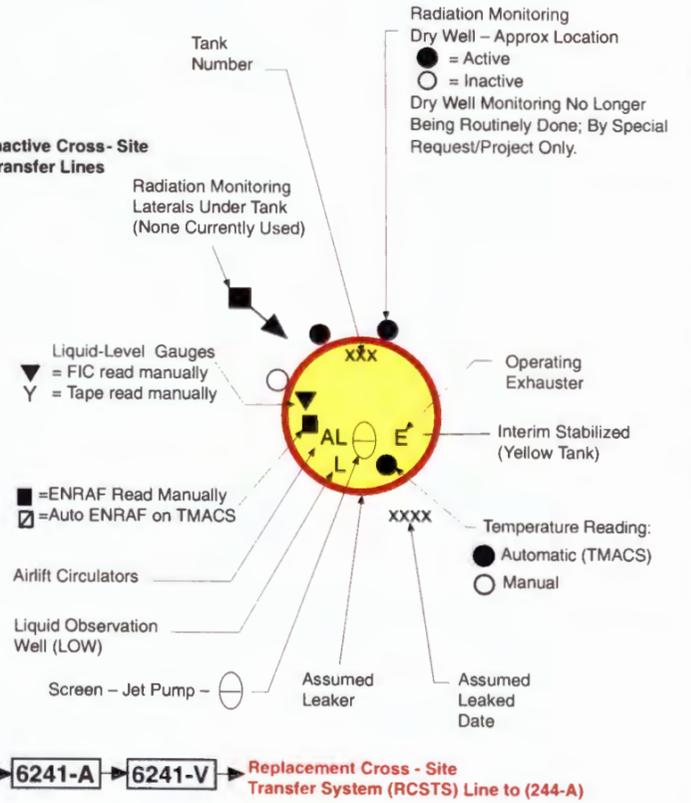


Figure E-7 (Schematic)

Status as of September 30, 2003
Updated Quarterly
Issued by River Protection Project