

ENGINEERING CHANGE NOTICE

1. ECN 653815

Proj. ECN


2. ECN Category (mark one) <input type="checkbox"/> Supplemental <input checked="" type="checkbox"/> Direct Revision <input type="checkbox"/> Change ECN <input type="checkbox"/> Temporary <input type="checkbox"/> Standby <input type="checkbox"/> Supersedure <input type="checkbox"/> Cancel/Void	3. Originator's Name, Organization, MSIN, and Telephone No. Juergen H. Rasmussen, Data Assessment and Interpretation, R2-12, 373-1128	4. USQ Required? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	5. Date 05/26/99	
	6. Project Title/No./Work Order No. Tank 241-BX-101	7. Bldg./Sys./Fac. No. 241-BX-101	8. Approval Designator N/A	
	9. Document Numbers Changed by this ECN (includes sheet no. and rev.) WHC-SD-WM-ER-408, Rev. 0-D	10. Related ECN No(s). ECNs: 623841, 625691, 640357, 640684	11. Related PO No. N/A	

12a. Modification Work <input type="checkbox"/> Yes (fill out Blk. 12b) <input checked="" type="checkbox"/> No (NA Blks. 12b, 12c, 12d)	12b. Work Package No. N/A	12c. Modification Work Complete N/A Design Authority/Cog. Engineer Signature & Date	12d. Restored to Original Condition (Temp. or Standby ECN only) N/A Design Authority/Cog. Engineer Signature & Date
---	------------------------------	---	---

13a. Description of Change
 This ECN has been generated in order to update the document to reflect results of recent data/information evaluation.

13b. Design Baseline Document? Yes No

Replace pages:
 ES-1, ES-2, ES-5, ES-6, 6-1, 6-2, 7-1, and 7-2



14a. Justification (mark one)

Criteria Change <input checked="" type="checkbox"/>	Design Improvement <input type="checkbox"/>	Environmental <input type="checkbox"/>	Facility Deactivation <input type="checkbox"/>
As-Found <input type="checkbox"/>	Facilitate Const <input type="checkbox"/>	Const. Error/Omission <input type="checkbox"/>	Design Error/Omission <input type="checkbox"/>

14b. Justification Details
 A tank characterization report page change revision is required to reflect the results of recent evaluation of data/information pertaining to adequacy of tank sampling for safety screening purposes (Reynolds et al. 1999, Evaluation of Tank Data for Safety Screening, HNF-4217, Rev. 0, Lockheed Martin Hanford Corporation, Richland, Washington).

15. Distribution (include name, MSIN, and no. of copies)
 See attached distribution.

RELEASE STAMP

DATE: MAY 27 1999

STA: A

HANFORD RELEASE

ID: 2

Tank Characterization Report for Single-Shell Tank 241-BX-101

Juergen H. Rasmussen
Lockheed Martin Hanford Corp., Richland, WA 99352
U.S. Department of Energy Contract 8023764-9-K001


EDT/ECN: ECN-653815 UC: 2070
Org Code: 74B20 CACN/COA: 102217/EI00
B&R Code: EW 3120074 Total Pages: 92


Key Words: Waste Characterization, Single-Shell Tank, SST, Tank 241-BX-101, Tank BX-101, BX-101, BX Farm, Tank Characterization Report, TCR, Waste Inventory, TPA Milestone M-44

Abstract: N/A

TRADEMARK DISCLAIMER. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof or its contractors or subcontractors.

Printed in the United States of America. To obtain copies of this document, contact: WHC/BCS Document Control Services, P.O. Box 1970, Mailstop H6-08, Richland WA 99352, Phone (509) 372-2420; Fax (509) 376-4989.

 5/27/99
Release Approval Date

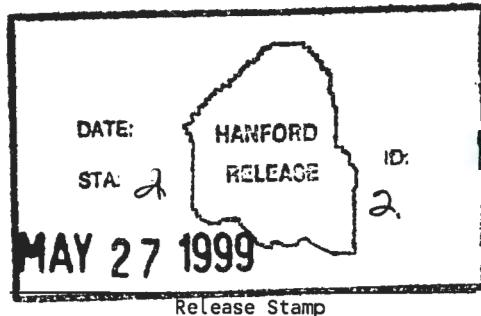

Approved for Public Release

EXECUTIVE SUMMARY

Single-shell tank 241-BX-101 is an underground storage tank containing high-level radioactive waste. It is located in the BX Tank Farm in the Hanford Site's 200 East Area. The tank was auger-sampled in June of 1994 and vapor space sampled on August 29, 1995. Analysis was performed in accordance with WHC-SD-WM-SP-004, *Tank Safety Screening Data Quality Objective* (Babad and Redus 1994). The analysis supports the *Hanford Federal Facility Agreement and Consent Order*, Milestone M-44-08 (Ecology et al. 1994).

Tank 241-BX-101 went into service in 1948 receiving metal waste (produced in the bismuth phosphate process) from B Plant. Other waste types received by the tank during its service life were uranium recovery waste, Plutonium Uranium Extraction (PUREX) Facility cladding waste, evaporator bottoms, B Plant low-level waste, B Plant ion-exchange waste, PUREX organic wash wastes, and Reduction and Oxidation (REDOX) Facility ion-exchange waste.

Tank 241-BX-101 is the first tank in the 241-BX-101, 241-BX-102, 241-BX-103 cascade series. The tank has a capacity of 2,010 kL (530 kgal) and currently contains 163 kL (43 kgal) of waste, existing primarily as sludge, including 3.79 kL (1 kgal) of supernatant. The tank became a suspected leaker in 1973 and was removed from service. The tank was deactivated and the supernatant was pumped, interim stabilizing the tank in 1978. Intrusion prevention was completed in 1981.

The Safety Screening Data Quality Objective (DQO) (Babad and Redus 1994) is the only current DQO that has been applied to tank 241-BX-101. Therefore, only those analyses required by

that DQO were performed in 1994 on the tank auger sample. The analyses included thermogravimetric analysis, differential scanning calorimetry, and total alpha activity. The analyses revealed that the water content in three of the six major subsamples was below the DQO-required limit of 17 wt%, ranging from 11.3 wt% to 16.1 wt% in those three major subsamples. The three subsamples that satisfied the water content requirement ranged from 18.7 wt% to 26.3 wt%. The one subsample that was excluded contained a rock and had a water content of 1.5 wt%. These water content values may pose a safety concern though no exotherms were observed and all of the total alpha results were below the DQO decision limit ($41 \mu\text{Ci/g}$). However, the total alpha results do exceed the transuranic classification criterion (100 nCi/g). The flammability of the gas in the headspace of the tank is another safety screening consideration; no flammable gases were detected in the tank vapor space. Sampling and analyses were sufficient to satisfy safety screening requirements for tank 241-BX-101 (Reynolds et al. 1999).

The current status of tank 241-BX-101 is shown in Table ES-1. A summary of the estimated historical inventory is shown in Table ES-2. The only chemical and radiochemical analytical data for the tank is from a 1976 sampling taken prior to stabilization. These values are based on the historical tank layer model estimates presented in Brevick and Redus (1994).

REFERENCES

Babad, H., J. W. Hunt, and L. S. Redus, 1995, *Tank Safety Screening Data Quality Objective*, WHC-SD-WM-SP-004, Rev. 1, Westinghouse Hanford Company, Richland, Washington.

Brevick, C. H., L. A. Gaddis, and E. D. Johnson, 1995, *Historical Tank Content Estimate for the Northeast Quadrant of the Hanford 200 East Area*, WHC-SD-WM-ER-349, Rev. 0A, Westinghouse Hanford Company, Richland, Washington.

Reynolds, D. A., W. T. Cowley, J. A. Lechelt, B. C. Simpson, and C. DeFig-Price, 1999, *Evaluation of Tank Data for Safety Screening*, HNF-4217, Rev. 0, Lockheed Martin Hanford Corporation, Richland, Washington.

Ecology, EPA, and DOE, 1994, *Hanford Federal Facility Agreement and Consent Order*, as amended, Washington State Department of Ecology, U.S. Environmental Protection Agency, and U.S. Department of Energy, Olympia, Washington.

This page intentionally left blank.

6.0 CONCLUSIONS AND RECOMMENDATIONS

The sludge in tank 241-BX-101 was sampled and analyzed in 1976 and in 1994. The vapor space of tank 241-BX-101 was sampled in 1995 for combustible gases. The 1976 results may no longer be accurate because of subsequent salt well pumping and drying effects. Because the 1994 sampling event focused only on safety screening criteria, the chemical and radiochemical compositions of the waste must be estimated from historical information (Brevick et al. 1994). The tank is expected to be mostly sludge with high concentrations of sodium, iron, and uranium phosphate and nitrate. The analysis of 1994 auger samples indicated that the plutonium concentration was well below criticality levels. No exotherms were observed for the DSC analyses. The average percent moisture results for the tank were very near the safety screening criterion of 17 wt%.

The 1994 sampling and analyses sufficiently satisfied the safety screening requirements for tank 241-BX-101 (Reynolds et al. 1999). Subsamples from the lower and upper areas of the auger samples from the two risers were analyzed, however waste recovery for the auger samples was lower than expected. Limited samples and data from different risers and waste depths make it difficult to determine accurately the variability of the waste composition in the tank. Variability for some of the TGA percent water and total alpha results were greater than desired, but did not have a significant impact on the assessment of the data. Historical information on the heat generation and tank temperature records does not indicate that excessive heat is being generated. Data and historical information do not indicate that tank 241-BX-101 has any immediate safety problems. The flammable gas concentration measurement, from August 1995, in the tank vapor space was 0 percent of the lower flammability limit, which satisfies the safety screening criterion.

C C O 40

This page intentionally left blank.

7.0 REFERENCES

- Agnew, S. F., 1994a, *Waste Status and Transaction Record Summary for the Northeast Quadrant*, WHC-SD-WM-TI-615, Rev. 0, Westinghouse Hanford Company, Richland, Washington.
- Agnew, S. F., 1994b, *Hanford Defined Wastes: Chemical and Radionuclide Compositions*, WHC-SD-WM-TI-629, Rev. 5, Westinghouse Hanford Company, Richland, Washington.
- Agnew, S. F., P. Baca, R. Corbin, T. Duran, and K. Jurgenson, 1994, *Tank Layer Model (TLM) Spreadsheet*, Los Alamos National Laboratory, Los Alamos, New Mexico.
- Alstad, A. T., 1991, *Riser Configuration Survey for SSTs*, WHC-SD-RE-TI-053, Rev. 8, Westinghouse Hanford Company, Richland, Washington.
- Babad, H., and K. S. Redus, 1994, *Tank Safety Screening Data Quality Objective*, WHC-SD-WM-SP-004, Rev. 0, Westinghouse Hanford Company, Richland, Washington.
- Brevick, C. H., 1994, *Supporting Document for the Northeast Quadrant Historical Tank Content Estimate Report for BX Tank Farm*, WHC-SD-WM-ER-311, Rev. 0, Westinghouse Hanford Company, Richland, Washington.
- Brevick, C. H., L. A. Gaddis, and E. D. Johnson, 1995, *Historical Tank Content Estimate for the Northeast Quadrant of the Hanford 200 East Area*, WHC-SD-WM-ER-349, Rev. 0A, Westinghouse Hanford Company, Richland, Washington.
- Carpenter, B. C., 1994, *Tank 241-BX-101 Tank Characterization Plan*, WHC-SD-WM-TP-210, Westinghouse Hanford Company, Richland, Washington.
- Dukelow, G. T., J. W. Hunt, H. Babad, and J. E. Meacham, 1995, *Tank Safety Screening Data Quality Objectives*, WHC-SD-WM-SP-004, Rev. 2, Westinghouse Hanford Company, Richland, Washington.
- De Lorenzo, D. S., A. T. DiCenso, D. B. Hiller, K. W. Johnson, J. H. Rutherford, and D. J. Smith, 1994, *Tank Characterization Reference Guide*, WHC-SD-WM-TI-648, Rev. 0, Westinghouse Hanford Company, Richland, Washington.
- Ecology, EPA, and DOE, 1994, *Hanford Federal Facility Agreement and Consent Order*, as amended, Washington State Department of Ecology, U.S. Environmental Protection Agency, and U.S. Department of Energy, Olympia, Washington.
- Hanlon, B. M., 1995, *Waste Tank Summary Report for Month Ending January 31, 1995*, WHC-EP-0182-82, Westinghouse Hanford Company, Richland, Washington.

Husa, E. I., R. E. Raymond, R. K. Welty, S. M. Griffith, B. M. Hanlon, R. R. Rios, and N. J. Vermeulen, 1993, *Hanford Site Waste Storage Tank Information Notebook*, WHC-EP-0625, Westinghouse Hanford Company, Richland, Washington.

Kocher, K. L., 1994, *Single Shell Tank Waste Characterization for Tank 241-BX-101*, WHC-SD-WM-DP-069, Rev. 0, Westinghouse Hanford Company, Richland, Washington.

Meacham, J. E., R. J. Cash, G. T. Dukelow, H. Babad, J. W. Buck, C. M. Anderson, B. A. Pulsipher, J. J. Toth, and P. J. Turner, 1994, *Data Requirements for the Ferrocyanide Safety Issue Developed through the Data Quality Objective Process*, WHC-SD-WM-DQO-007, Rev. 0, Westinghouse Hanford Company, Richland, Washington.

Postma, A. K., J. E. Meacham, G. S. Barney, G. L. Borsheim, R. J. Cash, M. D. Crippen, D. R. Dickenson, J. M. Grigsby, D. W. Jeppson, M. Kummerer, J. M. McLaren, C. S. Simmons, and B. C. Simpson, 1994, *Ferrocyanide Safety Program: Safety Criteria for Ferrocyanide Watch List Tanks*, WHC-EP-0691, Westinghouse Hanford Company, Richland, Washington.

Reynolds, D. A., W. T. Cowley, J. A. Lechelt, B. C. Simpson, and C. DeFigh-Price, 1999, *Evaluation of Tank Data for Safety Screening*, HNF-4217, Rev. 0, Lockheed Martin Hanford Corporation, Richland, Washington.

Rodenhizer, D. G., 1987, *Hanford Waste Tank Sluicing History*, WHC-SD-WM-TI-302, Rev. 0, Westinghouse Hanford Company, Richland, Washington.

Welty, R. K., 1988, *Waste Storage Tank Status and Leak Detection Criteria*, WHC-SD-WM-TI-356, Rev. 0, Vol. 1, Westinghouse Hanford Company, Richland, Washington.

WHC, 1994, *Alpha and Beta in Liquid Samples*, LA-508-101, Rev. D-1, Westinghouse Hanford Company, Richland, Washington.

DISTRIBUTION SHEET

To Distribution	From Data Assessment and Interpretation	Page 1 of 2			
		Date	05/26/99		
Project Title/Work Order Tank Characterization Report for Single-Shell Tank 241-BX-101, WHC-SD-WM-ER-408, Rev. 0-E		EDT No.	N/A		
		ECN No.	ECN-653815		
Name	MSIN	Text With All Attach.	Text Only	Attach./ Appendix Only	EDT/ECN Only

OFFSITE

Sandia National Laboratory
P.O. Box 5800
MS-0744, Dept. 6404
Albuquerque, NM 87815

D. Powers X

Nuclear Consulting Services Inc.
P. O. Box 29151
Columbus, OH 43229-01051

J. L. Kovach X

Chemical Reaction Sub-TAP
P.O. Box 271
Lindsborg, KS 67456

B. C. Hudson X

SAIC
555 Quince Orchard Rd., Suite 500
Gaithersburg, MD 20878-1437

H. Sutter X

Los Alamos Laboratory
CST-14 MS-J586
P. O. Box 1663
Los Alamos, NM 87545

S. F. Agnew X

Tank Advisory Panel
102 Windham Road
Oak Ridge, TN 37830

D. O. Campbell X

DISTRIBUTION SHEET

To Distribution	From Data Assessment and Interpretation	Page 2 of 2 Date 05/26/99
Project Title/Work Order Tank Characterization Report for Single-Shell Tank 241-BX-101, WHC-SD-WM-ER-408, Rev. 0-E		EDT No. N/A ECN No. ECN-653815

Name	MSIN	Text With All Attach.	Text Only	Attach./Appendix Only	EDT/ECN Only
------	------	-----------------------	-----------	-----------------------	--------------

ONSITE

Department of Energy - Richland Operations

W. S. Liou	S7-54	X			
DOE/RL Reading Room	H2-53	X			

DE&S Hanford, Inc.

G. D. Johnson	S7-73	X			
---------------	-------	---	--	--	--

Fluor Daniel Hanford Corporation

J. S. Hertzell	H8-67	X			
----------------	-------	---	--	--	--

Lockheed Martin Hanford, Corp.

J. W. Cammann	R2-11	X			
R. E. Larson	T4-07	X			
J. E. Rasmussen	R2-12	X			
L. M. Sasaki	R2-12	X			
B. C. Simpson	R2-12	X			
R. R. Thompson	R2-12	X			
ERC (Environmental Resource Center)	R1-51	X			
T.C.S.R.C.	R1-10	5			

Lockheed Martin Services, Inc.

B. G. Lauzon	R1-08	X			
Central Files	B1-07	X			
EDMC	H6-08	X			

Numatec Hanford Corporation

J. S. Garfield	R3-73	X			
D. L. Herting	T6-07	X			

Pacific Northwest National Laboratory

A. F. Noonan	K9-91	X			
--------------	-------	---	--	--	--

Scientific Applications International Corporation

M. D. LeClair	R3-75	X			
---------------	-------	---	--	--	--